
## **User's Manual**



## **Heavy Duty Dissolved Oxygen Meter**

# **Model 407510**

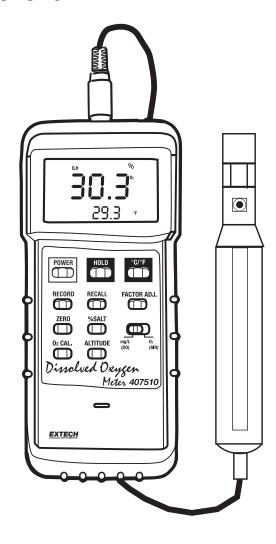


## Introduction

Congratulations on your purchase of Extech's Heavy Duty Dissolved Oxygen / Temperature Meter which simultaneously displays Dissolved Oxygen or Oxygen in air, and Temperature. Units of This solved Oxygen, % for Oxygen in air, and °C/°F for temperature. Oxygen is measured with a remote sensor that also contains a thermistor for measuring temperature. Advanced features include RS 232 PC serial interface, data hold, auto shut off, and Min/Max/Avg recording.

## **Meter Description**

- 1. LCD Display
- 2. POWER ON/OFF key
- 3. Data HOLD key
- 4. °C/°F selection key
- 5. LCD Contrast Adjust
- 6. RECORD key
- 7. RECALL key
- 8. Factor adjust key
- 9. Probe head
- 10. Sensor body
- 11. Sensor plug
- 12. Sensor jack
- 13. RS-232 output jack
- 14. Battery cover (rear)
- 15. Altitude compensation key
- 16. O<sub>2</sub> Cal key
- 17. Zero key
- 18. O<sub>2</sub> calibration key
- 19. % Salt key

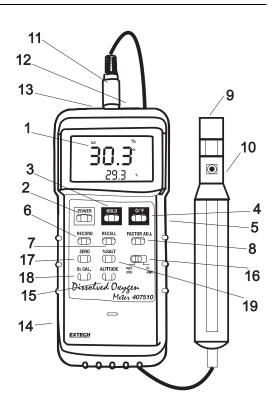


2

Note: The dissolved oxygen probe assembly may be shipped to you from the factory dry. If the probe does not contain electrolyte solution, refer to the Electrolyte Replacement section of this manual for the instructions for adding the electrolyte solution prior to initial use.

## Filling the Electrolyte Container Prior to Initial Use

- Unscrew and remove the electrolyte container from the tip of the probe.
- 2. Fill the electrolyte container with new electrolyte.
- Screw the electrolyte container back onto the electrode holder and probe handle. Excess Electrolyte may be forced out through the threads. Wipe clean.
- 4. Lightly tap the probe to remove any air bubbles.



#### Calibration

For first time use or after long periods (several days) of non-use, calibrate the instrument using the following steps. The procedure should be performed in an open, well-ventilated area.

- 1. Ensure that the sensor is DISCONNECTED from the meter.
- 2. Turn ON the meter.
- 3. Slide the O<sub>2</sub>/DO selector to the O<sub>2</sub> position.
- 4. Press the zero key to null the meter (the display should indicate "OO").
- 5. Connect the DO sensor to the top of the meter (remove the plastic probe head protective cap).
- 6. Allow the meter to stand for at least five minutes until the display stabilizes.
- 7. Press the O<sub>2</sub> Cal key and the display will indicate approx. 20.9 (typical O<sub>2</sub> in air).

## Dissolved Oxygen (DO) Measurements

#### **Measurement Preparation**

Before taking measurements, perform the calibration described above if necessary. In addition, perform the Calibration adjustments as described below:

#### % SALT Compensation

Slide the  $O_2/DO$  switch to the DO position. If the measured liquid is pure water or is known **not** to have a salt content, set the % Salt factor to 0%.

- Press the % Salt key. The display will indicate 0% on the middle portion of the LCD display and S on the bottom portion of the LCD.
- 2. Pressing the Factor Adj. key once will add 1% to the salt factor.
- 3. Press the Factor Adj. key until the correct factor is displayed.
- Press the % Salt key to store the factor.

NOTE: 1% = 10 ppt (parts per thousand)

#### **ALTITUDE Compensation**

The meter has a default calibration for sea level operation (0 meters). Any significant deviation from sea level requires a compensation adjustment. Perform the following steps to do so:

- Press the ALTITUDE key and the display will indicate a "0" in the middle of the LCD and an "H" on the lower portion of the LCD.
- Press the Factor Adj. key once to add 100 meters, twice to add 200 meters, and so on. Maximum compensation is 3900 meters.
- Once the desired compensation is displayed, press the ALTITUDE key again to store the value.

#### **Taking Measurements**

- 1. Immerse the probe in the solution under test. For best automatic temperature compensation, immerse the probe to a depth of at least 4" (10 cm).
- 2. Wait until the display stabilizes.
- The velocity of the liquid coming into contact with the probe must be at least 0.6 to 1
  ft/min (0.2 to 0.3 m/s). If the solution is standing, stir the solution with the probe or use
  an agitator.
- 4. Rinse the probe with clean water after each use.

## Oxygen in Air (O2) Measurements

Follow the same steps above for DO measurements except for the variations described below:

- 1. Slide the O<sub>2</sub>/DO switch to the O<sub>2</sub> position.
- 2. The display will indicate the oxygen air value in %.

#### **Temperature Measurements**

The lower display will indicate the temperature of the measured solution. Press the °C/°F key to change the temperature units.

#### Advanced Features

#### **Data Hold**

Press the Data Hold key to freeze the displayed value. The LCD will display **DH** for Data Hold mode along with the held reading. Press the Hold key again to release the data hold function.

#### MIN/MAX/AVG Data Recording

When selected, the Data Recording function records the Min, Max, and Average readings. To start a data recording session:

- 1. Press the RECORD key once. The REC indicator will appear on the display and the meter will begin to record the lowest (min), highest (max), and average (avg) readings.
- 2. To recall the data, press the RECALL key once. The MAX indicator will appear along with the highest reading recorded since the RECORD key was pressed.
- 3. Press the RECALL key again to view the MIN value.
- 4. Press the RECALL key again to view the AVG reading.
- To exit the Record mode, press the RECORD key again. The display indicators REC, MIN, MAX, and AVG will disappear.

#### **Auto Power OFF**

The meter includes an Auto shut off feature that preserves battery life. The meter will automatically turn off if no function button is pressed in any 10 minute period. To disable this feature press the RECORD key to engage the record function.

#### **LCD Contrast Adjust**

It may be necessary to adjust the display contrast due to a change in viewing angle or voltage drift. Use the LCD Contrast adjustment located on the right side of the meter to set the preferred contrast.

## **CPU** Reset

Certain improper keystroke sequences can cause the meter to "hang" and become inoperable. The following procedure will reset the meter.

- 1. Slide the O<sub>2</sub>/DO switch to the O<sub>2</sub> position.
- 2. Turn the meter OFF and disconnect the DO probe.
- 3. Press and HOLD the O<sub>2</sub> CAL key and then press the POWER key.
- 4. Release the O<sub>2</sub> CAL key and then press the ZERO key.
- 5. Connect the DO probe.
- 6. Wait several minutes for the reading to stabilize and then press the O2 CAL key.

#### RS-232 PC Interface


The meter includes a RS-232 serial data port. This interface was designed to operate with the Extech Data Acquisition Software/Hardware kit Part No. 407001. This kit enables the user to capture, store and display readings using a PC.

## Probe Head Replacement

The probe head on the tip of the probe holds a thin Teflon® membrane and an electrolyte container. Calibration or reading errors could indicate loss of electrolyte or a dirty/damaged membrane in the compact of the co

## Replacement procedure

- 1. Unscrew the probe head and electrolyte container from the probe handle and discard.
- 2. Fill the new probe head/electrolyte container with electrolyte.
- 3. Screw the probe head onto the probe handle. Excess electrolyte may be forced out through the threads. Wipe clean.
- 4. Lightly tap the probe to remove any air bubbles.
  - 1. Probe handle
  - 2. Temperature sensor
  - 3. Probe Head



## **Battery Replacement**

The low battery indication LBT appears on the LCD when the battery runs low. To replace the battery:

- 1. Reredial harmonic for the street of the
- Remove the battery compartment cover using a small coin or screwdriver and remove the 9V battery.
- 3. Replace the 9V battery and reinstall the cover and holster.

## **Specifications**

## **General Specifications**

Circuit	Custom one-chip LSI microprocessor circuit		
Display	Dual function 0.5" (13 mm) 1999 count LCD w/ contrast adjust		
Measurements	Dissolved O <sub>2</sub> : mg/l (milligrams per liter); Oxygen in air: %; Temperature: °C/°F		
Data hold	Data hold key freezes displayed reading		
Sensor Structure	Remote Polarographic Dissolved Oxygen Sensor		
	Temperature sensor: Precision thermistor		
Data recording	Min/Max/Avg readings stored for later recall		
Auto power off	Meter turns off after 10 minutes		
Sample rate	0.4 Sec (approx.)		
Data Output	RS 232 PC serial interface		
Operating conditions	Temperature: 32 to 122 °F (0 to 50 °C); Humidity: < 80% RH		
Battery power	9V alkaline battery		
Power Consumption	Approx. 6.6 mA DC		
Weight	0.74 lbs. / 335 g (including batteries & probe)		
Dimensions	Main instrument: 7.1 x 2.8 x1.3" (180 x 72 x 32mm)		
	Probe: 4.9" x 0.8" length/diameter (125 x 20mm)		
Accessories	Carrying case, 9V battery, and 5 membranes		
Optional accessories	Membranes, data acquisition software & RS232 interface cable		

### **Electrical Specifications**

Measurement	Range	Resolution	Accuracy
Dissolved Oxygen	0.0 - 19.9 mg/L	0.1mg/L	<u>+</u> 0.4 mg/L
Oxygen in air	0 - 100% O <sub>2</sub>	0.1 % O <sub>2</sub>	<u>+</u> 0.7% O <sub>2</sub>
Temperature (probe only)	32 to 122 °F	0.1°F/C	±1.5 °F
	0 to 50 °C		<u>+</u> 0.8 °C
Compensation adjustments	Temperature (automatic)	32 to 122 °F (0 to 50°C)	
	Salt	0 to 39% (1% = ppt)	
	Altitude	0 to 3900 meters	

### Calibration and Repair Services

Extech offers repair and calibration services for the products we sell. Extech also provides NIST certification for most products. Call the Customer Service Department for information on calibrations by a sailability product. Extech recommends that annual calibrations be performed to verify meter performance and accuracy.

#### Warranty

EXTECH INSTRUMENTS CORPORATION warrants this instrument to be free of defects in parts and workmanship for three years from date of shipment (a six month limited warranty applies to sensors and cables). If it should become necessary to return the instrument for service during or beyond the warranty period, contact the Customer Service Department at (781) 890-7440 ext. 210 for authorization or visit our website www.extech.com for contact information. A Return Authorization (RA) number must be issued before any product is returned to Extech. The sender is responsible for shipping charges, freight, insurance and proper packaging to prevent damage in transit. This warranty does not apply to defects resulting from action of the user such as misuse, improper wiring, operation outside of specification, improper maintenance or repair, or unauthorized modification. Extech specifically disclaims any implied warranties or merchantability or fitness for a specific purpose and will not be liable for any direct, indirect, incidental or consequential damages. Extech's total liability is limited to repair or replacement of the product. The warranty set forth above is inclusive and no other warranty, whether written or oral, is expressed or implied.



#### Support line (781) 890-7440

Technical support: Extension 200; E-mail: support@extech.com Repair & Returns: Extension 210; E-mail: repair@extech.com

## Product specifications subject to change without notice

For the latest version of this User's Guide, Software updates, and other up-to-the-minute product information, visit our website: www.extech.com Extech Instruments Corporation, 285 Bear Hill Rd., Waltham, MA 02451

Copyright © 2006 Extech Instruments Corporation. All rights reserved including the right of reproduction in whole or in part in any form.