Features

- High Performance, Low Power AVR[®]32 UC 32-Bit Microcontroller
 - Compact Single-cycle RISC Instruction Set Including DSP Instruction Set
 - Read-Modify-Write Instructions and Atomic Bit Manipulation
 - Performing up to 1.39 DMIPS / MHz
 - Up to 83 DMIPS Running at 60 MHz from Flash
 - Up to 46 DMIPS Running at 30 MHz from Flash
 - Memory Protection Unit
- Multi-hierarchy Bus System
 - High-Performance Data Transfers on Separate Buses for Increased Performance
 - 7 Peripheral DMA Channels Improves Speed for Peripheral Communication
- Internal High-Speed Flash
 - 512K Bytes, 256K Bytes, 128K Bytes, 64K Bytes Versions
 - Single Cycle Access up to 30 MHz
 - Prefetch Buffer Optimizing Instruction Execution at Maximum Speed
 - 4ms Page Programming Time and 8ms Full-Chip Erase Time
 - 100,000 Write Cycles, 15-year Data Retention Capability
 - Flash Security Locks and User Defined Configuration Area
- Internal High-Speed SRAM, Single-Cycle Access at Full Speed
 - 96K Bytes (512KB Flash), 32K Bytes (256KB and 128KB Flash), 16K Bytes (64KB Flash)
- Interrupt Controller
 - Autovectored Low Latency Interrupt Service with Programmable Priority
- System Functions
 - Power and Clock Manager Including Internal RC Clock and One 32KHz Oscillator
 - Two Multipurpose Oscillators and Two Phase-Lock-Loop (PLL) allowing Independent CPU Frequency from USB Frequency
 - Watchdog Timer, Real-Time Clock Timer
- Universal Serial Bus (USB)
 - Device 2.0 and Embedded Host Low Speed and Full Speed
 - Flexible End-Point Configuration and Management with Dedicated DMA Channels
 - On-chip Transceivers Including Pull-Ups
 - USB Wake Up from Sleep Functionality
- One Three-Channel 16-bit Timer/Counter (TC)
 - Three External Clock Inputs, PWM, Capture and Various Counting Capabilities
- One 7-Channel 20-bit Pulse Width Modulation Controller (PWM)
- Three Universal Synchronous/Asynchronous Receiver/Transmitters (USART)
 - Independant Baudrate Generator, Support for SPI, IrDA and ISO7816 interfaces
 - Support for Hardware Handshaking, RS485 Interfaces and Modem Line
- One Master/Slave Serial Peripheral Interfaces (SPI) with Chip Select Signals
- One Synchronous Serial Protocol Controller
 - Supports I²S and Generic Frame-Based Protocols
- One Master/Slave Two-Wire Interface (TWI), 400kbit/s I²C-compatible
- One 8-channel 10-bit Analog-To-Digital Converter, 384ks/s
- 16-bit Stereo Audio Bitstream DAC
 - Sample Rate Up to 50 KHz
- QTouch[®] Library Support
 - Capacitive Touch Buttons, Sliders, and Wheels
 - QTouch[®] and QMatrix[®] Acquisition





32-bit AVR[®] Microcontroller AT32UC3B0512 AT32UC3B0256 AT32UC3B0128 AT32UC3B064 AT32UC3B1512 AT32UC3B1512 AT32UC3B1256 AT32UC3B1128 AT32UC3B164

Preliminary



32059IS-06/2010



查询AT32UC3B1512供应商 • On-Chip Debug System (JTAG interface)

- Nexus Class 2+, Runtime Control, Non-Intrusive Data and Program Trace

O

df.dzsc.c

- 64-pin TQFP/QFN (44 GPIO pins), 48-pin TQFP/QFN (28 GPIO pins)
- 5V Input Tolerant I/Os, including 4 high-drive pins
- Single 3.3V Power Supply or Dual 1.8V-3.3V Power Supply

1. Description

The AT32UC3B is a complete System-On-Chip microcontroller based on the AVR32 UC RISC processor running at frequencies up to 60 MHz. AVR32 UC is a high-performance 32-bit RISC microprocessor core, designed for cost-sensitive embedded applications, with particular emphasis on low power consumption, high code density and high performance.

The processor implements a Memory Protection Unit (MPU) and a fast and flexible interrupt controller for supporting modern operating systems and real-time operating systems.

Higher computation capability is achieved using a rich set of DSP instructions.

The AT32UC3B incorporates on-chip Flash and SRAM memories for secure and fast access.

The Peripheral Direct Memory Access controller enables data transfers between peripherals and memories without processor involvement. PDCA drastically reduces processing overhead when transferring continuous and large data streams between modules within the MCU.

The Power Manager improves design flexibility and security: the on-chip Brown-Out Detector monitors the power supply, the CPU runs from the on-chip RC oscillator or from one of external oscillator sources, a Real-Time Clock and its associated timer keeps track of the time.

The Timer/Counter includes three identical 16-bit timer/counter channels. Each channel can be independently programmed to perform frequency measurement, event counting, interval measurement, pulse generation, delay timing and pulse width modulation.

The PWM modules provides seven independent channels with many configuration options including polarity, edge alignment and waveform non overlap control. One PWM channel can trigger ADC conversions for more accurate close loop control implementations.

The AT32UC3B also features many communication interfaces for communication intensive applications. In addition to standard serial interfaces like UART, SPI or TWI, other interfaces like flexible Synchronous Serial Controller and USB are available.

The Synchronous Serial Controller provides easy access to serial communication protocols and audio standards like I²S, UART or SPI.

The Full-Speed USB 2.0 Device interface supports several USB Classes at the same time thanks to the rich End-Point configuration. The Embedded Host interface allows device like a USB Flash disk or a USB printer to be directly connected to the processor.

Atmel offers the QTouch library for embedding capacitive touch buttons, sliders, and wheels functionality into AVR microcontrollers. The patented charge-transfer signal acquisition offers robust sensing and included fully debounced reporting of touch keys and includes Adjacent Key Suppression[®] (AKS[®]) technology for unambiguous detection of key events. The easy-to-use QTouch Suite toolchain allows you to explore, develop, and debug your own touch applications.

AT32UC3B integrates a class 2+ Nexus 2.0 On-Chip Debug (OCD) System, with non-intrusive real-time trace, full-speed read/write memory access in addition to basic runtime control. The Nanotrace interface enables trace feature for JTAG-based debuggers.










2. **Overview**

2.1 Blockdiagram

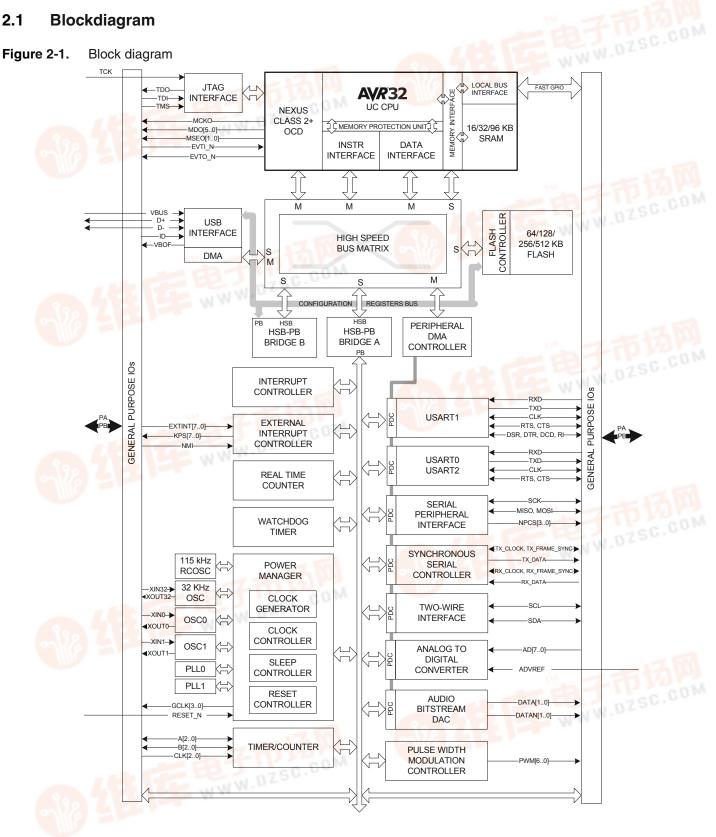



查询AT32UC3B1512供应商 Configuration Summary 3.

128 Kbytes

64 Kbytes

16 Kbytes

16 Kbytes

WWW.DZSC

0

0

6

6

Device

AT32UC3B0512 AT32UC3B0256 AT32UC3B0128 AT32UC3B064 AT32UC3B1512 AT32UC3B1256

AT32UC3B1128

AT32UC3B164

The table below lists all AT32UC3B memory and package configurations:

0

0

	Table 3-1. Memory and Package Configurations							
Fla	sh		SSC	ADC	ABDAC	OSC	USB Configuration	Package
512	2 Kbytes	96 Kbytes	1	8	1	2	Mini-Host + Device	64 lead TQFP/QFN
256	6 Kbytes	32 Kbytes	1	8	0	2	Mini-Host + Device	64 lead TQFP/QFN
128	3 Kbytes	32 Kbytes	1	8	0	2	Mini-Host + Device	64 lead TQFP/QFN
64	Kbytes	16 Kbytes	1	8	0	2	Mini-Host + Device	64 lead TQFP/QFN
512	2 Kbytes	96 Kbytes	0	6	1	1	Device	48 lead QFN
256	6 Kbytes	32 Kbytes	0	6	0	1	Device	48 lead TQFP/QFN

1

1

Device

Device




48 lead TQFP/QFN


48 lead TQFP/QFN

4. Package and Pinout

4.1 Package

The device pins are multiplexed with peripheral functions as described in the Peripheral Multiplexing on I/O Line section.

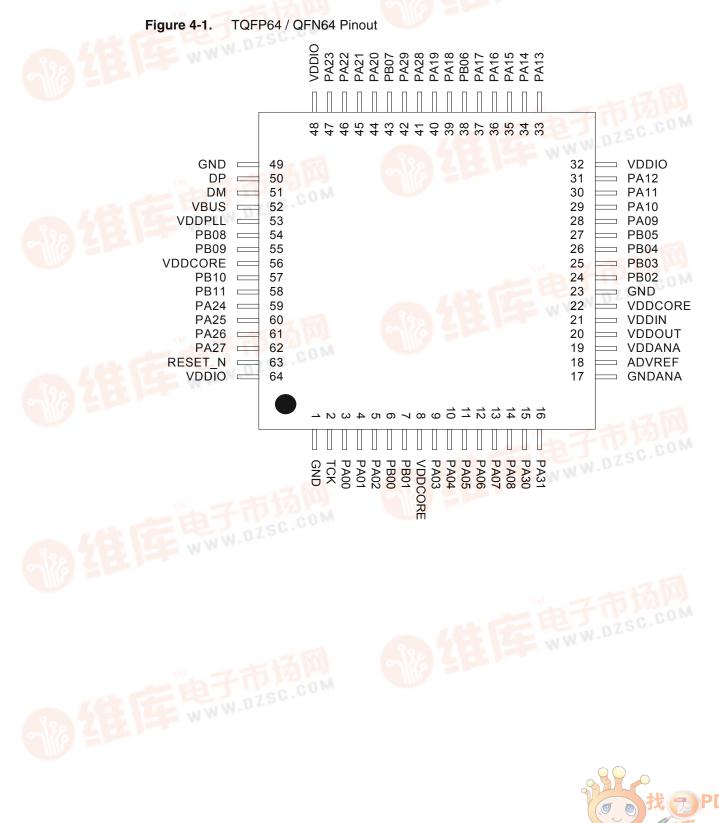

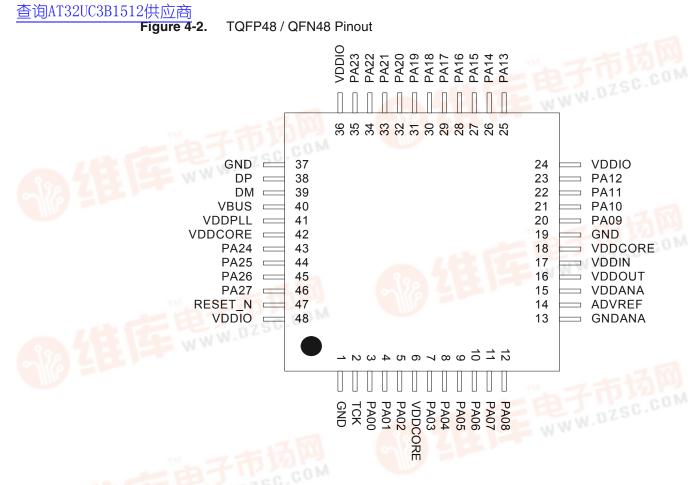

Note: On QFN packages, the exposed pad is not connected to anything.

4.2 Peripheral Multiplexing on I/O lines

4.2.1 Multiplexed signals

Each GPIO line can be assigned to one of 4 peripheral functions; A, B, C or D (D is only available for UC3Bx512 parts). The following table define how the I/O lines on the peripherals A, B,C or D are multiplexed by the GPIO.

TQFP <mark>48</mark> /QFN48	TQFP64 /QFN64	PIN	GPIO Pin	Function A	Function B	Function C	Function D (only for UC <mark>3Bx51</mark> 2)
3	3	PA00	GPIO 0				- D M
4	4	PA01	GPIO 1				N.DZSC.00
5	5	PA02	GPIO 2		180 YA	WW	
7	9	PA03	GPIO 3	ADC - AD[0]	PM - GCLK[0]	USBB - USB_ID	ABDAC - DATA[0]
8	10	PA04	GPIO 4	ADC - AD[1]	PM - GCLK[1]	USBB - USB_VBOF	ABDAC - DATAN[0]
9	11	PA05	GPIO 5	EIC - EXTINT[0]	ADC - AD[2]	USART1 - DCD	ABDAC - DATA[1]
10	12	PA06	GPIO 6	EIC - EXTINT[1]	ADC - AD[3]	USART1 - DSR	ABDAC - DATAN[1]

 Table 4-1.
 GPIO Controller Function Multiplexing



查询A'	Г32UC3B1512供应商
Table 4-1.	GPIO Controller Function Multiplexing

11	13	PA07	GPIO 7	PWM - PWM[0]	ADC - AD[4]	USART1 - DTR	SSC - RX_FRAME_SYNC
12	14	PA08	GPIO 8	PWM - PWM[1]	ADC - AD[5]	USART1 - RI	SSC - RX_CLOCK
20	28	PA09	GPIO 9	TWI - SCL	SPI0 - NPCS[2]	USART1 - CTS	N - 10
21	29	PA10	GPIO 10	TWI - SDA	SPI0 - NPCS[3]	USART1 - RTS	
22	30	PA11	GPIO 11	USART0 - RTS	TC - A2	PWM - PWM[0]	SSC - RX_DATA
23	31	PA12	GPIO 12	USART0 - CTS	TC - B2	PWM - PWM[1]	USART1 - TXD
25	33	PA13	GPIO 13	EIC - NMI	PWM - PWM[2]	USART0 - CLK	SSC - RX_CLOCK
26	34	PA14	GPIO 14	SPI0 - MOSI	PWM - PWM[3]	EIC - EXTINT[2]	PM - GCLK[2]
27	35	PA15	GPIO 15	SPI0 - SCK	PWM - PWM[4]	USART2 - CLK	LTD DO PO
28	36	PA16	GPIO 16	SPI0 - NPCS[0]	TC - CLK1	PWM - PWM[4]	nZSC.COM
29	37	PA17	GPIO 17	SPI0 - NPCS[1]	TC - CLK2	SPI0 - SCK	USART1 - RXD
30	39	PA18	GPIO 18	USARTO - RXD	PWM - PWM[5]	SPI0 - MISO	SSC - RX_FRAME_SYNC
31	40	PA19	GPIO 19	USART0 - TXD	PWM - PWM[6]	SPI0 - MOSI	SSC - TX_CLOCK
32	44	PA20	GPIO 20	USART1 - CLK	TC - CLK0	USART2 - RXD	SSC - TX_DATA
33	45	PA21	GPIO 21	PWM - PWM[2]	TC - A1	USART2 - TXD	SSC -
34	46	PA22	GPIO 22	PWM - PWM[6]	TC - B1	ADC - TRIGGER	ABDAC - DATA[0]
35	47	PA23	GPIO 23	USART1 - TXD	SPI0 - NPCS[1]	EIC - EXTINT[3]	PWM - PWM[0]
43	59	PA24	GPIO 24	USART1 - RXD	SPI0 - NPCS[0]	EIC - EXTINT[4]	PWM - PWM[1]
44	60	PA25	GPIO 25	SPI0 - MISO	PWM - PWM[3]	EIC - EXTINT[5]	
45	61	PA26	GPIO 26	USBB - USB_ID	USART2 - TXD	TC - A0	ABDAC - DATA[1]
46	62	PA27	GPIO 27	USBB - USB_VBOF	USART2 - RXD	TC - B0	ABDAC - DATAN[1
	41	PA28	GPIO 28	USART0 - CLK	PWM - PWM[4]	SPI0 - MISO	ABDAC - DATAN[0
	42	PA29	GPIO 29	TC - CLK0	TC - CLK1	SPI0 - MOSI	-TD WORK
	15	PA30	GPIO 30	ADC - AD[6]	EIC - SCAN[0]	PM - GCLK[2]	DZSC.00
	16	PA31	GPIO 31	ADC - AD[7]	EIC - SCAN[1]	PWM - PWM[6]	
	6	PB00	GPIO 32	TC - A0	EIC - SCAN[2]	USART2 - CTS	
	7	PB01	GPIO 33	TC - B0	EIC - SCAN[3]	USART2 - RTS	
	24	PB02	GPIO 34	EIC - EXTINT[6]	TC - A1	USART1 - TXD	
\sim	25	PB03	GPIO 35	EIC - EXTINT[7]	TC - B1	USART1 - RXD	
	26	PB04	GPIO 36	USART1 - CTS	SPI0 - NPCS[3]	TC - CLK2	-17.00
	27	PB05	GPIO 37	USART1 - RTS	SPI0 - NPCS[2]	PWM - PWM[5]	-TP CON
	38	PB06	GPIO 38	SSC - RX_CLOCK	USART1 - DCD	EIC - SCAN[4]	ABDAC - DATA[0]
	43	PB07	GPIO 39	SSC - RX_DATA	USART1 - DSR	EIC - SCAN[5]	ABDAC - DATAN[0
	54	PB08	GPIO 40	SSC - RX_FRAME_SYNC	USART1 - DTR	EIC - SCAN[6]	ABDAC - DATA[1]



查询AT32UC3B1512供应商 Table 4-1. GPIO Controller Function Multiplexing

55	PB09	GPIO 41	SSC - TX_CLOCK	USART1 - RI	EIC - SCAN[7]	ABDAC - DATAN[1]
57	PB10	GPIO 42	SSC - TX_DATA	TC - A2	USART0 - RXD	-TP SOM
58	PB11	GPIO 43	SSC - TX_FRAME_SYNC	TC - B2	USART0 - TXD	N.DZSU.U

4.2.2 JTAG Port Connections

If the JTAG is enabled, the JTAG will take control over a number of pins, irrespective of the I/O Controller configuration.

Table 4-2. JTAG Pinout

64QFP/QFN	48QFP/QFN	Pin name	JTAG pin
2	2	тск	ТСК
3	3	PA00	TDI
4	4	PA01	TDO
5	5	PA02	TMS

4.2.3 Nexus OCD AUX port connections

If the OCD trace system is enabled, the trace system will take control over a number of pins, irrespectively of the PIO configuration. Two different OCD trace pin mappings are possible, depending on the configuration of the OCD AXS register. For details, see the AVR32 UCTechnical Reference Manual.

et l'	Pin	AXS=0	AXS=1
	EVTI_N	PB05	PA14
	MDO[5]	PB04	PA08
	MDO[4]	PB03	PA07
	MDO[3]	PB02	PA06
	MDO[2]	PB01	PA05
	MDO[1]	PB00	PA04
4	MDO[0]	PA31	PA03
	EVTO_N	PA15	PA15
	МСКО	PA30	PA13
	MSEO[1]	PB06	PA09
	MSEO[0]	PB07	PA10

Table 4-3. Nexus OCD AUX port connections

4.2.4 Oscillator Pinout



The oscillators are not mapped to the normal A, B or C functions and their muxings are controlled by registers in the Power Manager (PM). Please refer to the power manager chapter for more information about this.



QFP48 pin	QFP64 pin	Pad	Oscillator pin
30	39	PA18	XINO
	41	PA28	XIN1
22	30	PA11	XIN32
31 250	40	PA19	XOUT0
WWW	42	PA29	XOUT1
23	31	PA12	XOUT32

4.3 High Drive Current GPIO

Ones of GPIOs can be used to drive twice current than other GPIO capability (see Electrical Characteristics section).

 Table 4-5.
 High Drive Current GPIO

GPIO Name
PA20
PA21
PA22
PA23

5. Signals Description

The following table gives details on the signal name classified by peripheral.

Table 5-1.	Signal Description List	
	Signal Description List	

Signal Name	Function	Туре	Active Level	Comments
	Power			
VDDPLL	PLL Power Supply	Power Input		1.65V to 1.95 V
VDDCORE	Core Power Supply	Power Input		1.65V to 1.95 V
VDDIO	I/O Power Supply	Power Input	C: [3.0V to 3.6V
VDDANA	Analog Power Supply	Power Input	30.90	3.0V to 3.6V
VDDIN	Voltage Regulator Input Supply	Power Input		3.0V to 3.6V



查询AT32UC3B1512供应商 Table 5-1. Signal Description List (Continued)

Signal Name	Function	Туре	Active Level	Comments
VDDOUT	Voltage Regulator Output	Power Output		1.65V to 1.95 V
GNDANA	Analog Ground	Ground		
GND	Ground	Ground		
~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	Clocks, Oscillators,	and PLL's		
XIN0, XIN1, XIN32	Crystal 0, 1, 32 Input	Analog		一一方场网
XOUT0, XOUT1, XOUT32	Crystal 0, 1, 32 Output	Analog	A.F	WWW.DZSC.COM
	JTAG	~\}{}		
тск	Test Clock	Input		
TDI	Test Data In	Input		
TDO	Test Data Out	Output		一一五日四
TMS	Test Mode Select	Input	-	=BJ DZSC.COM
	Auxiliary Port -	AUX		WWW.UL
МСКО	Trace Data Output Clock	Output		
MDO0 - MDO5	Trace Data Output	Output		
MSEO0 - MSEO1	Trace Frame Control	Output		
EVTI_N Event In		Output	Low	" 一方场网
EVTO_N	Event Out	Output	Low	EBJ DZSC.COM
	Power Manager	- PM	1-11	WWWW
GCLK0 - GCLK2	Generic Clock Pins	Output		
RESET_N	Reset Pin	Input	Low	
- (~\x)	External Interrupt Cor	troller - EIC		
EXTINTO - EXTINT7	External Interrupt Pins	Input		~ 一方场网
KPS0 - KPS7	Keypad Scan Pins	Output	-	= BJ nZSC.COM
NMI	Non-Maskable Interrupt Pin	Input	Low	WWWW
	General Purpose I/O pin-	<mark>GPIOA, G</mark> PIO	ОВ	1
PA0 - PA31	Parallel I/O Controller GPIOA	I/O		
PB0 - PB11	Parallel I/O Controller GPIOB	I/O		



### 查询AT32UC3B1512供应商 Table 5-1. Signal Description List (Continued)

Signal Name	Function	Туре	Active Level	Comments
	Serial Peripheral In	iterface - SPI0	7:37	WWW.DZSO.
MISO	Master In Slave Out	• I/O		
MOSI	Master Out Slave In	1/0		
NPCS0 - NPCS3	SPI Peripheral Chip Select	I/O	Low	
SCK	Clock	Output		
	Synchronous Serial	Controller - SS	c	一百万万万
RX_CLOCK	SSC Receive Clock	I/O	647	WWW.BZSC.Co.
RX_DATA	SSC Receive Data	Input		
RX_FRAME_SYNC	SSC Receive Frame Sync	1/0		
TX_CLOCK	SSC Transmit Clock	I/O		
TX_DATA	SSC Transmit Data	Output		
TX_FRAME_SYNC	SSC Transmit Frame Sync	I/O		=BJ DZSC.COM
	Timer/Counter	r - TIMER		WWW.025
AO	Channel 0 Line A	I/O		
A1	Channel 1 Line A	I/O		
A2	Channel 2 Line A	I/O		
B0	Channel 0 Line B	I/O		一一十五四
B1	Channel 1 Line B	I/O		=BJ DZSC.COM
B2	Channel 2 Line B	· I/O		WWW.UZ
CLK0	Channel 0 External Clock Input	Input		
CLK1	Channel 1 External Clock Input	Input		
CLK2	Channel 2 External Clock Input	Input		
	Two-wire Inter	face - TWI		一方场网
SCL	Serial Clock	I/O		EED DZSC.COM
SDA	Serial Data	I/O		WWW.022
Un	iversal Synchronous Asynchronous Receive	r Tr <mark>ansmitte</mark> r -	USARTO, L	JSART1, USART2
СLК	Clock	I/O		
CTS	Clear To Send	Input		



#### 查询AT32UC3B1512供应商 Table 5-1. Signal Description List (Continued)

Signal Name	Function	Туре	Active Level	Comments
DCD	Data Carrier Detect			Only USART1
DSR	Data Set Ready	~\}}		Only USART1
DTR	Data Terminal Ready			Only USART1
RI	Ring Indicator			Only USART1
RTS	Request To Send	Output		TM
RXD	Receive Data	Input		
TXD	Transmit Data	Output		WWW.DZSC.05
	Analog to Digital Co	nv <mark>erte</mark> r - ADC	1-1-	
AD0 - AD7	Analog input pins	Analog input		
ADVREF	Analog positive reference voltage input	Analog input		2.6 to 3.6V
	Audio Bitstream D/	AC - ABDAC		EBJ DZSC.COM
DATA0 - DATA1	D/A Data out	Output		WWW.DC
DATAN0 - DATAN1	D/A Data inverted out	Output		
	Pulse Width Modu	lator - PWM		
PWM <mark>0 - PWM6</mark>	PWM Output Pins	Output		
	Universal Serial Bus	Device - USBE	3	一方场网
DDM	USB Device Port Data -	Analog	-	EBJ DZSC.COM
DDP	USB Device Port Data +	Analog		WWWW
VBUS	USB VBUS Monitor and Embedded Host Negotiation	Analog Input		
USBID	ID Pin of the USB Bus	Input		
USB_VBOF	USB VBUS On/off: bus power control port	output		

### 5.1 JTAG pins

TMS and TDI pins have pull-up resistors. TDO pin is an output, driven at up to VDDIO, and has no pull-up resistor. These 3 pins can be used as GPIO-pins. At reset state, these pins are in GPIO mode.



TCK pin cannot be used as GPIO pin. JTAG interface is enabled when TCK pin is tied low.



#### 5.2 RESET_N pin

The RESET_N pin is a schmitt input and integrates a permanent pull-up resistor to VDDIO. As the product integrates a power-on reset cell, the RESET_N pin can be left unconnected in case no reset from the system needs to be applied to the product.

#### 5.3 TWI pins



When these pins are used for TWI, the pins are open-drain outputs with slew-rate limitation and inputs with inputs with spike-filtering. When used as GPIO-pins or used for other peripherals, the pins have the same characteristics as GPIO pins.

#### 5.4 GPIO pins

All the I/O lines integrate a pull-up resistor. Programming of this pull-up resistor is performed independently for each I/O line through the GPIO Controllers. After reset, I/O lines default as inputs with pull-up resistors disabled, except when indicated otherwise in the column "Reset Value" of the GPIO Controller user interface table.

### 5.5 High drive pins

The four pins PA20, PA21, PA22, PA23 have high drive output capabilities.

### 5.6 **Power Considerations**

#### 5.6.1 Power Supplies

The AT32UC3B has several types of power supply pins:

- VDDIO: Powers I/O lines. Voltage is 3.3V nominal.
- VDDANA: Powers the ADC Voltage is 3.3V nominal.
- VDDIN: Input voltage for the voltage regulator. Voltage is 3.3V nominal.
- VDDCORE: Powers the core, memories, and peripherals. Voltage is 1.8V nominal.
- VDDPLL: Powers the PLL. Voltage is 1.8V nominal.


The ground pins GND are common to VDDCORE, VDDIO and VDDPLL. The ground pin for VDDANA is GNDANA.

For QFN packages, the center pad must be left unconnected.

Refer to "Electrical Characteristics" on page 35 for power consumption on the various supply pins.

The main requirement for power supplies connection is to respect a star topology for all electrical connection.



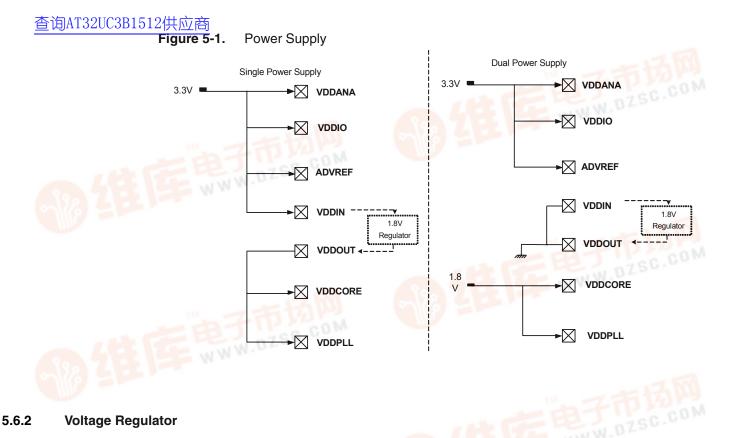


## 5.6.2.1 Single Power Supply

The AT32UC3B embeds a voltage regulator that converts from 3.3V to 1.8V. The regulator takes its input voltage from VDDIN, and supplies the output voltage on VDDOUT that should be externally connected to the 1.8V domains.

Adequate input supply decoupling is mandatory for VDDIN in order to improve startup stability and reduce source voltage drop. Two input decoupling capacitors must be placed close to the chip.

Adequate output supply decoupling is mandatory for VDDOUT to reduce ripple and avoid oscillations. The best way to achieve this is to use two capacitors in parallel between VDDOUT and GND as close to the chip as possible

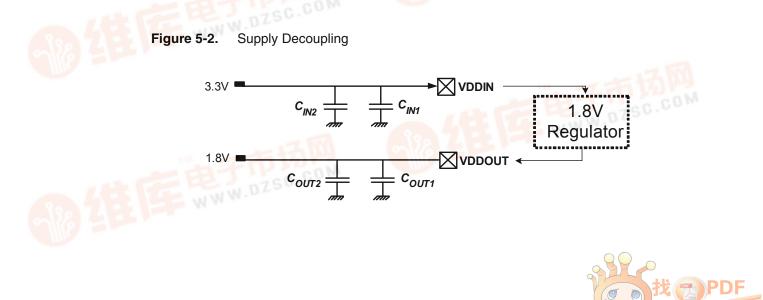


Refer to Section 9.3 on page 38 for decoupling capacitors values and regulator characteristics.

#### 5.6.2.2 Dual Power Supply

In case of dual power supply, VDDIN and VDDOUT should be connected to ground to prevent from leakage current.


To avoid over consumption during the power up sequence, VDDIO and VDDCORE voltage difference needs to stay in the range given Figure 5-3.

#### Figure 5-3. VDDIO versus VDDCORE during power up sequence

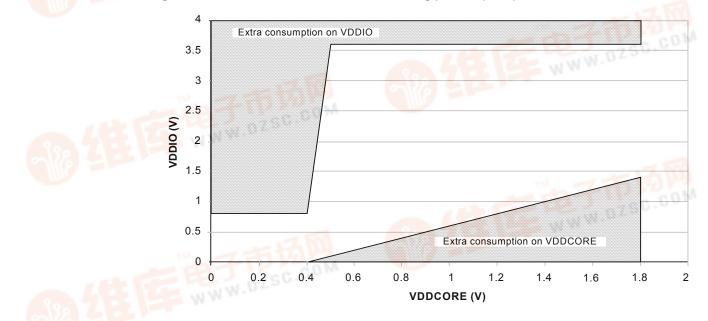

#### 5.6.3 Analog-to-Digital Converter (ADC) reference.

The ADC reference (ADVREF) must be provided from an external source. Two decoupling capacitors must be used to insure proper decoupling.

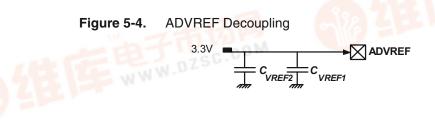

Refer to Section 9.4 on page 38 for decoupling capacitors values and electrical characteristics. In case ADC is not used, the ADVREF pin should be connected to GND to avoid extra consumption.



#### 查询AT32UC3B1512供应商 Processor and Architecture

#### Rev: 1.0.0.0

This chapter gives an overview of the AVR32UC CPU. AVR32UC is an implementation of the AVR32 architecture. A summary of the programming model, instruction set, and MPU is presented. For further details, see the AVR32 Architecture Manual and the AVR32UC Technical Reference Manual.

#### 6.1 Features

6.

- 32-bit load/store AVR32A RISC architecture
  - 15 general-purpose 32-bit registers
  - 32-bit Stack Pointer, Program Counter and Link Register reside in register file
  - Fully orthogonal instruction set
  - Privileged and unprivileged modes enabling efficient and secure Operating Systems
  - Innovative instruction set together with variable instruction length ensuring industry leading code density
  - DSP extention with saturating arithmetic, and a wide variety of multiply instructions
- 3-stage pipeline allows one instruction per clock cycle for most instructions
  - Byte, halfword, word and double word memory access
  - Multiple interrupt priority levels
- MPU allows for operating systems with memory protection

#### 6.2 AVR32 Architecture

AVR32 is a high-performance 32-bit RISC microprocessor architecture, designed for cost-sensitive embedded applications, with particular emphasis on low power consumption and high code density. In addition, the instruction set architecture has been tuned to allow a variety of microarchitectures, enabling the AVR32 to be implemented as low-, mid-, or high-performance processors. AVR32 extends the AVR family into the world of 32- and 64-bit applications.

Through a quantitative approach, a large set of industry recognized benchmarks has been compiled and analyzed to achieve the best code density in its class. In addition to lowering the memory requirements, a compact code size also contributes to the core's low power characteristics. The processor supports byte and halfword data types without penalty in code size and performance.

Memory load and store operations are provided for byte, halfword, word, and double word data with automatic sign- or zero extension of halfword and byte data. The C-compiler is closely linked to the architecture and is able to exploit code optimization features, both for size and speed.

In order to reduce code size to a minimum, some instructions have multiple addressing modes. As an example, instructions with immediates often have a compact format with a smaller immediate, and an extended format with a larger immediate. In this way, the compiler is able to use the format giving the smallest code size.

Another feature of the instruction set is that frequently used instructions, like add, have a compact format with two operands as well as an extended format with three operands. The larger format increases performance, allowing an addition and a data move in the same instruction in a single cycle. Load and store instructions have several different formats in order to reduce code size and speed up execution.





The register file is organized as sixteen 32-bit registers and includes the Program Counter, the Link Register, and the Stack Pointer. In addition, register R12 is designed to hold return values from function calls and is used implicitly by some instructions.

### 6.3 The AVR32UC CPU

The AVR32UC CPU targets low- and medium-performance applications, and provides an advanced OCD system, no caches, and a Memory Protection Unit (MPU). Java acceleration hardware is not implemented.




AVR32UC provides three memory interfaces, one High Speed Bus master for instruction fetch, one High Speed Bus master for data access, and one High Speed Bus slave interface allowing other bus masters to access data RAMs internal to the CPU. Keeping data RAMs internal to the CPU allows fast access to the RAMs, reduces latency, and guarantees deterministic timing. Also, power consumption is reduced by not needing a full High Speed Bus access for memory accesses. A dedicated data RAM interface is provided for communicating with the internal data RAMs.

副维

A local bus interface is provided for connecting the CPU to device-specific high-speed systems, such as floating-point units and fast GPIO ports. This local bus has to be enabled by writing the LOCEN bit in the CPUCR system register. The local bus is able to transfer data between the CPU and the local bus slave in a single clock cycle. The local bus has a dedicated memory range allocated to it, and data transfers are performed using regular load and store instructions. Details on which devices that are mapped into the local bus space is given in the Memories chapter of this data sheet.

Figure 6-1 on page 19 displays the contents of AVR32UC.



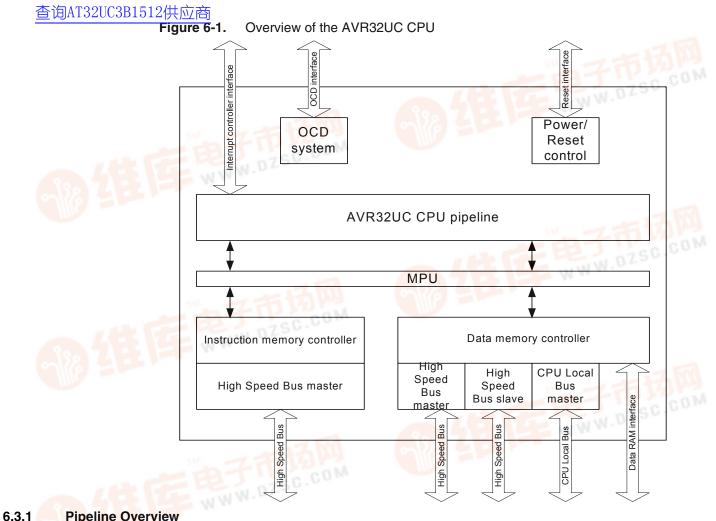

#### **Pipeline Overview**

AVR32UC has three pipeline stages, Instruction Fetch (IF), Instruction Decode (ID), and Instruction Execute (EX). The EX stage is split into three parallel subsections, one arithmetic/logic (ALU) section, one multiply (MUL) section, and one load/store (LS) section.


Instructions are issued and complete in order. Certain operations require several clock cycles to complete, and in this case, the instruction resides in the ID and EX stages for the required number of clock cycles. Since there is only three pipeline stages, no internal data forwarding is required, and no data dependencies can arise in the pipeline.

Figure 6-2 on page 20 shows an overview of the AVR32UC pipeline stages.



#### 查询AT32UC3B1512供应商 Figure 6-2.

The AVR32UC Pipeline

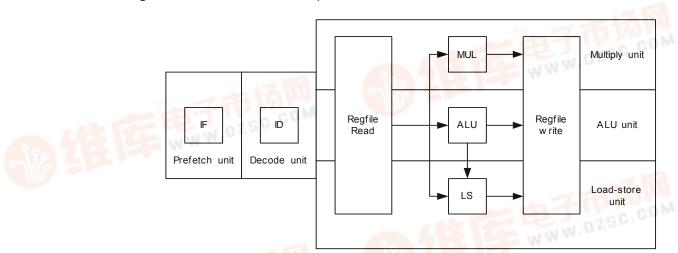

#### 6.3.2 AVR32A Microarchitecture Compliance



AVR32UC implements an AVR32A microarchitecture. The AVR32A microarchitecture is targeted at cost-sensitive, lower-end applications like smaller microcontrollers. This microarchitecture does not provide dedicated hardware registers for shadowing of register file registers in interrupt contexts. Additionally, it does not provide hardware registers for the return address registers and return status registers. Instead, all this information is stored on the system stack. This saves chip area at the expense of slower interrupt handling.

Upon interrupt initiation, registers R8-R12 are automatically pushed to the system stack. These registers are pushed regardless of the priority level of the pending interrupt. The return address and status register are also automatically pushed to stack. The interrupt handler can therefore use R8-R12 freely. Upon interrupt completion, the old R8-R12 registers and status register are restored, and execution continues at the return address stored popped from stack.

The stack is also used to store the status register and return address for exceptions and *scall*. Executing the *rete* or *rets* instruction at the completion of an exception or system call will pop this status register and continue execution at the popped return address.

#### 6.3.3 Java Support

AVR32UC does not provide Java hardware acceleration.

#### 6.3.4 Memory Protection

The MPU allows the user to check all memory accesses for privilege violations. If an access is attempted to an illegal memory address, the access is aborted and an exception is taken. The MPU in AVR32UC is specified in the AVR32UC Technical Reference manual.

#### 6.3.5 Unaligned Reference Handling



AVR32UC does not support unaligned accesses, except for doubleword accesses. AVR32UC is able to perform word-aligned *st.d* and *ld.d*. Any other unaligned memory access will cause an address exception. Doubleword-sized accesses with word-aligned pointers will automatically be performed as two word-sized accesses.



The following table shows the instructions with support for unaligned addresses. All other instructions require aligned addresses.

 Table 6-1.
 Instructions with Unaligned Reference Support

Instruction	Supported alignment
ld.d	Word
st.d	Word

#### 6.3.6 Unimplemented Instructions

The following instructions are unimplemented in AVR32UC, and will cause an Unimplemented Instruction Exception if executed:

- All SIMD instructions
- All coprocessor instructions if no coprocessors are present
- retj, incjosp, popjc, pushjc
- tlbr, tlbs, tlbw
- cache

#### 6.3.7 CPU and Architecture Revision

Three major revisions of the AVR32UC CPU currently exist.




AVR32UC CPU revision 3 is fully backward-compatible with revisions 1 and 2, ie. code compiled for revision 1 or 2 is binary-compatible with revision 3 CPUs.





#### 6.4 Programming Model

#### 6.4.1 Register File Configuration

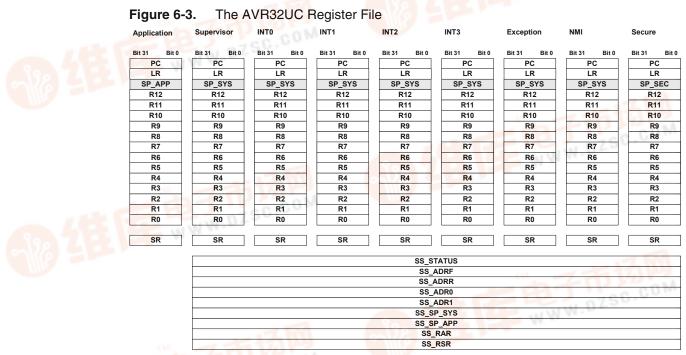



#### The AVR32UC register file is shown below.

#### 6.4.2 Status Register Configuration

The Status Register (SR) is split into two halfwords, one upper and one lower, see Figure 6-4 on page 22 and Figure 6-5 on page 23. The lower word contains the C, Z, N, V, and Q condition code flags and the R, T, and L bits, while the upper halfword contains information about the mode and state the processor executes in. Refer to the *AVR32 Architecture Manual* for details.

Figure 6-4. The Status Register High Halfword

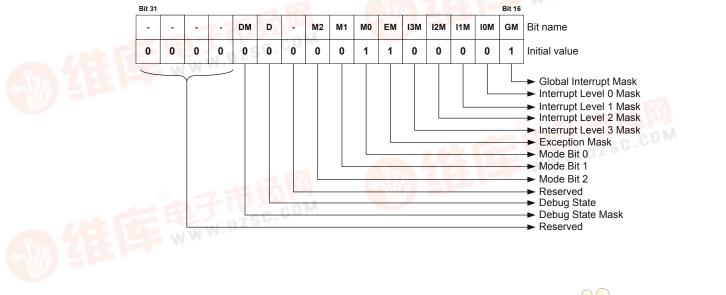

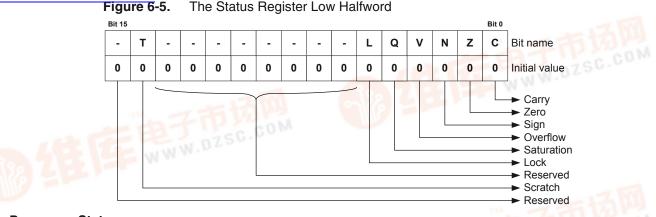

#### 6.4.3 Processor States

#### 6.4.3.1 Normal RISC State

The AVR32 processor supports several different execution contexts as shown in Table 6-2 on page 23.

Priority	Mode	Security	Description
1	Non Maskable Interrupt	Privileged	Non Maskable high priority interrupt mode
2	Exception	Privileged	Execute exceptions
3	Interrupt 3	Privileged	General purpose interrupt mode
4 👐	Interrupt 2	Privileged	General purpose interrupt mode
5	Interrupt 1	Privileged	General purpose interrupt mode
6 W	Interrupt 0	Privileged	General purpose interrupt mode
N/A	Supervisor	Privileged	Runs supervisor calls
N/A	Application	Unprivileged	Normal program execution mode

Table 6-2.	Overview of Execution Modes, their Priorities and Privilege Levels.
Table 0-2.	Overview of Execution modes, their Fhonties and Finneye Levels.

Mode changes can be made under software control, or can be caused by external interrupts or exception processing. A mode can be interrupted by a higher priority mode, but never by one with lower priority. Nested exceptions can be supported with a minimal software overhead.



When running an operating system on the AVR32, user processes will typically execute in the application mode. The programs executed in this mode are restricted from executing certain instructions. Furthermore, most system registers together with the upper halfword of the status register cannot be accessed. Protected memory areas are also not available. All other operating modes are privileged and are collectively called System Modes. They have full access to all privileged and unprivileged resources. After a reset, the processor will be in supervisor mode.

#### 6.4.3.2 Debug State



The AVR32 can be set in a debug state, which allows implementation of software monitor routines that can read out and alter system information for use during application development. This implies that all system and application registers, including the status registers and program counters, are accessible in debug state. The privileged instructions are also available.



All interrupt levels are by default disabled when debug state is entered, but they can individually be switched on by the monitor routine by clearing the respective mask bit in the status register.

Debug state can be entered as described in the AVR32UC Technical Reference Manual.

Debug state is exited by the retd instruction.

#### 6.4.4 System Registers



The system registers are placed outside of the virtual memory space, and are only accessible using the privileged *mfsr* and *mtsr* instructions. The table below lists the system registers specified in the AVR32 architecture, some of which are unused in AVR32UC. The programmer is responsible for maintaining correct sequencing of any instructions following a *mtsr* instruction. For detail on the system registers, refer to the *AVR32UC Technical Reference Manual*.

Table 6-3.System Registers









Reg #	Address	Name	Function
0	0	SR	Status Register
1	4	EVBA	Exception Vector Base Address
2	8	ACBA	Application Call Base Address
3	12	CPUCR	CPU Control Register
4	16	ECR	Exception Cause Register
5	20	RSR_SUP	Unused in AVR32UC
6	24	RSR_INT0	Unused in AVR32UC
7	28	RSR_INT1	Unused in AVR32UC
8	32	RSR_INT2	Unused in AVR32UC
9	36	RSR_INT3	Unused in AVR32UC
10	40	RSR_EX	Unused in AVR32UC
11	44	RSR_NMI	Unused in AVR32UC
12	48	RSR_DBG	Return Status Register for Debug mode
13	52	RAR_SUP	Unused in AVR32UC
14	56	RAR_INT0	Unused in AVR32UC
15	60	RAR_INT1	Unused in AVR32UC
16	64	RAR_INT2	Unused in AVR32UC
17	68	RAR_INT3	Unused in AVR32UC
18	72	RAR_EX	Unused in AVR32UC
19	76	RAR_NMI	Unused in AVR32UC
20	80	RAR_DBG	Return Address Register for Debug mode
21	84	JECR	Unused in AVR32UC
22	88	JOSP	Unused in AVR32UC
23	92	JAVA_LV0	Unused in AVR32UC
24	96	JAVA_LV1	Unused in AVR32UC
25	100	JAVA_LV2	Unused in AVR32UC



### 查询AT32UC3B1512供应商 Table 6-3.

### System Registers (Continued)











Reg #	Address	Name	Function
26	104	JAVA_LV3	Unused in AVR32UC
27	108	JAVA_LV4	Unused in AVR32UC
28	112	JAVA_LV5	Unused in AVR32UC
29	116	JAVA_LV6	Unused in AVR32UC
30	120	JAVA_LV7	Unused in AVR32UC
31	124	JTBA	Unused in AVR32UC
32	128	JBCR	Unused in AVR32UC
33-63	132-252	Reserved	Reserved for future use
64	256	CONFIG0	Configuration register 0
65	260	CONFIG1	Configuration register 1
66 🗾 🥏	264	COUNT	Cycle Counter register
67	268	COMPARE	Compare register
68	272	TLBEHI	Unused in AVR32UC
69	276	TLBELO	Unused in AVR32UC
70	280	PTBR	Unused in AVR32UC
71	284	TLBEAR	Unused in AVR32UC
72	288	MMUCR	Unused in AVR32UC
73 🙌 💋	292	TLBARLO	Unused in AVR32UC
74	296	TLBARHI	Unused in AVR32UC
75 W W	300	PCCNT	Unused in AVR32UC
76	304	PCNT0	Unused in AVR32UC
77	308	PCNT1	Unused in AVR32UC
78	312	PCCR	Unused in AVR32UC
79	316	BEAR	Bus Error Address Register
80	320	MPUAR0	MPU Address Register region 0
81	324	MPUAR1	MPU Address Register region 1
82	328	MPUAR2	MPU Address Register region 2
83	332	MPUAR3	MPU Address Register region 3
84	336	MPUAR4	MPU Address Register region 4
85	340	MPUAR5	MPU Address Register region 5
86	344	MPUAR6	MPU Address Register region 6
87	348	MPUAR7	MPU Address Register region 7
88	352	MPUPSR0	MPU Privilege Select Register region 0
89	356	MPUPSR1	MPU Privilege Select Register region 1
90	360	MPUPSR2	MPU Privilege Select Register region 2
91	364	MPUPSR3	MPU Privilege Select Register region 3



	Gyötölli H		
Reg #	Address	Name	Function
92	368	MPUPSR4	MPU Privilege Select Register region 4
93	372	MPUPSR5	MPU Privilege Select Register region 5
94	376	MPUPSR6	MPU Privilege Select Register region 6
95	380	MPUPSR7	MPU Privilege Select Register region 7
96	384	MPUCRA	Unused in this version of AVR32UC
97	388	MPUCRB	Unused in this version of AVR32UC
98	392	MPUBRA	Unused in this version of AVR32UC
99	396	MPUBRB	Unused in this version of AVR32UC
100	400	MPUAPRA	MPU Access Permission Register A
101	404	MPUAPRB	MPU Access Permission Register B
102	408	MPUCR	MPU Control Register
103-191	448-764	Reserved	Reserved for future use
192-255	768-1020	IMPL	IMPLEMENTATION DEFINED

#### System Registers (Continued)

#### 6.5 Exceptions and Interrupts

AVR32UC incorporates a powerful exception handling scheme. The different exception sources, like Illegal Op-code and external interrupt requests, have different priority levels, ensuring a welldefined behavior when multiple exceptions are received simultaneously. Additionally, pending exceptions of a higher priority class may preempt handling of ongoing exceptions of a lower priority class.

When an event occurs, the execution of the instruction stream is halted, and execution control is passed to an event handler at an address specified in Table 6-4 on page 29. Most of the handlers are placed sequentially in the code space starting at the address specified by EVBA, with four bytes between each handler. This gives ample space for a jump instruction to be placed there, jumping to the event routine itself. A few critical handlers have larger spacing between them, allowing the entire event routine to be placed directly at the address specified by the EVBA-relative offset generated by hardware. All external interrupt sources have autovectored interrupt service routine (ISR) addresses. This allows the interrupt controller to directly specify the ISR address as an address relative to EVBA. The autovector offset has 14 address bits, giving an offset of maximum 16384 bytes. The target address of the event handler is calculated as (EVBA I event_handler_offset), not (EVBA + event_handler_offset), so EVBA and exception code segments must be set up appropriately. The same mechanisms are used to service all different types of events, including external interrupt requests, yielding a uniform event handling scheme.

An interrupt controller does the priority handling of the external interrupts and provides the autovector offset to the CPU.

#### 6.5.1 System Stack Issues



Event handling in AVR32UC uses the system stack pointed to by the system stack pointer, SP_SYS, for pushing and popping R8-R12, LR, status register, and return address. Since event code may be timing-critical, SP_SYS should point to memory addresses in the IRAM section, since the timing of accesses to this memory section is both fast and deterministic.



The user must also make sure that the system stack is large enough so that any event is able to push the required registers to stack. If the system stack is full, and an event occurs, the system will enter an UNDEFINED state.

#### 6.5.2 **Exceptions and Interrupt Requests**

When an event other than scall or debug request is received by the core, the following actions are performed atomically:

- 1. The pending event will not be accepted if it is masked. The I3M, I2M, I1M, I0M, EM, and GM bits in the Status Register are used to mask different events. Not all events can be masked. A few critical events (NMI, Unrecoverable Exception, TLB Multiple Hit, and Bus Error) can not be masked. When an event is accepted, hardware automatically sets the mask bits corresponding to all sources with equal or lower priority. This inhibits acceptance of other events of the same or lower priority, except for the critical events listed above. Software may choose to clear some or all of these bits after saving the necessary state if other priority schemes are desired. It is the event source's responsability to ensure that their events are left pending until accepted by the CPU.
- When a request is accepted, the Status Register and Program Counter of the current 2. context is stored to the system stack. If the event is an INT0, INT1, INT2, or INT3, registers R8-R12 and LR are also automatically stored to stack. Storing the Status Register ensures that the core is returned to the previous execution mode when the current event handling is completed. When exceptions occur, both the EM and GM bits are set, and the application may manually enable nested exceptions if desired by clearing the appropriate bit. Each exception handler has a dedicated handler address, and this address uniquely identifies the exception source.
- 3. The Mode bits are set to reflect the priority of the accepted event, and the correct register file bank is selected. The address of the event handler, as shown in Table 6-4, is loaded into the Program Counter.

The execution of the event handler routine then continues from the effective address calculated.

The rete instruction signals the end of the event. When encountered, the Return Status Register and Return Address Register are popped from the system stack and restored to the Status Register and Program Counter. If the rete instruction returns from INT0, INT1, INT2, or INT3, registers R8-R12 and LR are also popped from the system stack. The restored Status Register contains information allowing the core to resume operation in the previous execution mode. This concludes the event handling.

#### 6.5.3 Supervisor Calls

The AVR32 instruction set provides a supervisor mode call instruction. The scall instruction is designed so that privileged routines can be called from any context. This facilitates sharing of code between different execution modes. The scall mechanism is designed so that a minimal execution cycle overhead is experienced when performing supervisor routine calls from timecritical event handlers.

The scall instruction behaves differently depending on which mode it is called from. The behaviour is detailed in the instruction set reference. In order to allow the scall routine to return to the correct context, a return from supervisor call instruction, rets, is implemented. In the AVR32UC CPU, scall and rets uses the system stack to store the return address and the status register.

**Debug Requests** 

The AVR32 architecture defines a dedicated Debug mode. When a debug request is received by the core, Debug mode is entered. Entry into Debug mode can be masked by the DM bit in the







6.5.4

status register. Upon entry into Debug mode, hardware sets the SR[D] bit and jumps to the Debug Exception handler. By default, Debug mode executes in the exception context, but with dedicated Return Address Register and Return Status Register. These dedicated registers remove the need for storing this data to the system stack, thereby improving debuggability. The mode bits in the status register can freely be manipulated in Debug mode, to observe registers in all contexts, while retaining full privileges.

Debug mode is exited by executing the retd instruction. This returns to the previous context.

#### 6.5.5 Entry Points for Events

Several different event handler entry points exists. In AVR32UC, the reset address is 0x8000_0000. This places the reset address in the boot flash memory area.

TLB miss exceptions and *scall* have a dedicated space relative to EVBA where their event handler can be placed. This speeds up execution by removing the need for a jump instruction placed at the program address jumped to by the event hardware. All other exceptions have a dedicated event routine entry point located relative to EVBA. The handler routine address identifies the exception source directly.

AVR32UC uses the ITLB and DTLB protection exceptions to signal a MPU protection violation. ITLB and DTLB miss exceptions are used to signal that an access address did not map to any of the entries in the MPU. TLB multiple hit exception indicates that an access address did map to multiple TLB entries, signalling an error.

All external interrupt requests have entry points located at an offset relative to EVBA. This autovector offset is specified by an external Interrupt Controller. The programmer must make sure that none of the autovector offsets interfere with the placement of other code. The autovector offset has 14 address bits, giving an offset of maximum 16384 bytes.

Special considerations should be made when loading EVBA with a pointer. Due to security considerations, the event handlers should be located in non-writeable flash memory, or optionally in a privileged memory protection region if an MPU is present.

If several events occur on the same instruction, they are handled in a prioritized way. The priority ordering is presented in Table 6-4. If events occur on several instructions at different locations in the pipeline, the events on the oldest instruction are always handled before any events on any younger instruction, even if the younger instruction has events of higher priority than the oldest instruction. An instruction B is younger than an instruction A if it was sent down the pipeline later than A.

The addresses and priority of simultaneous events are shown in Table 6-4. Some of the exceptions are unused in AVR32UC since it has no MMU, coprocessor interface, or floating-point unit.









Priority	Handler Address	Name	Event source	Stored Return Address
1	0x8000_0000	Reset	External input	Undefined
2	Provided by OCD system	OCD Stop CPU	OCD system	First non-completed instruction
3	EVBA+0x00	Unrecoverable exception	Internal	PC of offending instruction
4	EVBA+0x04	TLB multiple hit	MPU	
5	EVBA+0x08	Bus error data fetch	Data bus	First non-completed instruction
6	EVBA+0x0C	Bus error instruction fetch	Data bus	First non-completed instruction
7	EVBA+0x10	NMI	External input	First non-completed instruction
8	Autovectored	Interrupt 3 request	External input	First non-completed instruction
9	Autovectored	Interrupt 2 request	External input	First non-completed instruction
10	Autovectored	Interrupt 1 request	External input	First non-completed instruction
11	Autovectored	Interrupt 0 request	External input	First non-completed instruction
12	EVBA+0x14	Instruction Address	CPU	PC of offending instruction
13	EVBA+0x50	ITLB Miss	MPU	
14	EVBA+0x18	ITLB Protection	MPU	PC of offending instruction
15	EVBA+0x1C	Breakpoint	OCD system	First non-completed instruction
16	EVBA+0x20	Illegal Opcode	Instruction	PC of offending instruction
17	EVBA+0x24	Unimplemented instruction	Instruction	PC of offending instruction
18	EVBA+0x28	Privilege violation	Instruction	PC of offending instruction
19	EVBA+0x2C	Floating-point	UNUSED	
20	EVBA+0x30	Coprocessor absent	Instruction	PC of offending instruction
21	EVBA+0x100	Supervisor call	Instruction	PC(Supervisor Call) +2
22	EVBA+0x34	Data Address (Read)	CPU	PC of offending instruction
23	EVBA+0x38	Data Address (Write)	CPU	PC of offending instruction
24	EVBA+0x60	DTLB Miss (Read)	MPU	
25	EVBA+0x70	DTLB Miss (Write)	MPU	
26	EVBA+0x3C	DTLB Protection (Read)	MPU	PC of offending instruction
27	EVBA+0x40	DTLB Protection (Write)	MPU	PC of offending instruction
28	EVBA+0x44	DTLB Modified	UNUSED	

#### Table 6-4. Priority and Handler Addresses for Events







### 查询AT32UC3B1512供应商 Module Configuration 6.6

All AT32UC3B parts do not implement the same CPU and Architecture Revision. W.DZSC.COM

#### Table 6-5. **CPU and Architecture Revision**

Part Name	Architecture Revision
AT32UC3Bx512	2
AT32UC3Bx256	SC.COM
AT32UC3Bx128	1
AT32UC3Bx64	1











#### 7. Memories

#### 7.1 Embedded Memories

- Internal High-Speed Flash
  - 512KBytes (AT32UC3B0512, AT32UC3B1512)
  - 256 KBytes (AT32UC3B0256, AT32UC3B1256)
  - 128 KBytes (AT32UC3B0128, AT32UC3B1128)
  - 64 KBytes (AT32UC3B064, AT32UC3B164)
    - 0 Wait State Access at up to 30 MHz in Worst Case Conditions
    - 1 Wait State Access at up to 60 MHz in Worst Case Conditions
    - Pipelined Flash Architecture, allowing burst reads from sequential Flash locations, hiding penalty of 1 wait state access WWW.BZSC.COM
    - 100 000 Write Cycles, 15-year Data Retention Capability
    - 4 ms Page Programming Time, 8 ms Chip Erase Time
    - Sector Lock Capabilities, Bootloader Protection, Security Bit
    - 32 Fuses, Erased During Chip Erase
  - User Page For Data To Be Preserved During Chip Erase
- Internal High-Speed SRAM, Single-cycle access at full speed
  - 96KBytes ((AT32UC3B0512, AT32UC3B1512)
  - 32KBytes (AT32UC3B0256, AT32UC3B0128, AT32UC3B1256 and AT32UC3B1128)
  - 16KBytes (AT32UC3B064 and AT32UC3B164)

#### 7.2 Physical Memory Map



The system bus is implemented as a bus matrix. All system bus addresses are fixed, and they are never remapped in any way, not even in boot. Note that AVR32 UC CPU uses unsegmented translation, as described in the AVR32UC Technical Architecture Manual. The 32-bit physical address space is mapped as follows:

Table 7-1.	AT32UC3B Physical Memory Map
------------	------------------------------

Device Start Address		Embedded Embedded USB Data		HSB-PB Bridge A	HSB-PB Bridge B		
		0x0000_0000	0x8000_0000	0xD000_0000	0xFFFF_0000	0xFFFE_0000	
Size	AT32UC3B0512 AT32UC3B1512	96 Kbytes	512 Kbytes	64 Kbytes	64 Kbytes	64 Kbytes	
	AT32UC3B0256 AT32UC3B1256	32 Kbytes	256 Kbytes	64 Kbytes	64 Kbytes	64 Kbytes	
	AT32UC3B0128 AT32UC3B1128	32 Kbytes	128 Kbytes	64 Kbytes	64 Kbytes	64 Kbytes	
	AT32UC3B064 AT32UC3B164	16 Kbytes	64 Kbytes	64 Kbytes	64 Kbytes	64 Kbytes	
	4日在	WW.DZSC.C	MO	IIII			



# 查询AT32UC3B1512供应商7.3 ● Peripheral Address Map

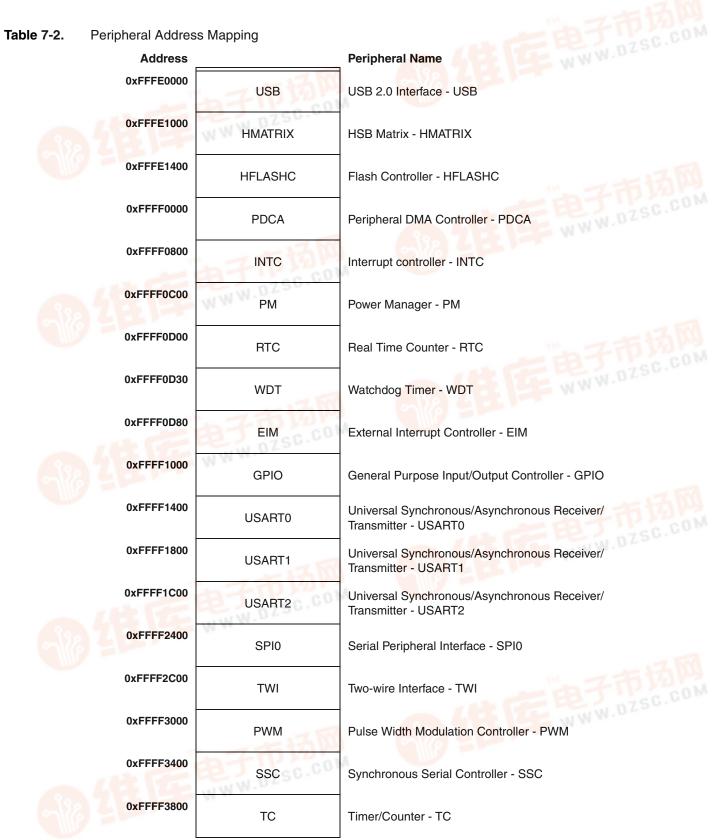




Table 7-2. Peripheral Address Mapping

0xF	FFF	<b>400</b>	0

0xFFFF3C00

ABDAC

ADC

Analog to Digital Converter - ADC

Audio Bitstream DAC - ABDAC

### 7.4 CPU Local Bus Mapping

Some of the registers in the GPIO module are mapped onto the CPU local bus, in addition to being mapped on the Peripheral Bus. These registers can therefore be reached both by accesses on the Peripheral Bus, and by accesses on the local bus.

Mapping these registers on the local bus allows cycle-deterministic toggling of GPIO pins since the CPU and GPIO are the only modules connected to this bus. Also, since the local bus runs at CPU speed, one write or read operation can be performed per clock cycle to the local busmapped GPIO registers.

The following GPIO registers are mapped on the local bus:

Port	Register	Mode	Local Bus Address	Access
0	Output Driver Enable Register (ODER)	WRITE	0x4000_0040	Write-only
		SET	0x4000_0044	Write-only
		CLEAR	0x4000_0048	Write-only
-	ATD COM	TOGGLE	0x4000_004C	Write-only
5	Output Value Register (OVR)	WRITE	0x4000_0050	Write-only
	Q	SET	0x4000_0054	Write-only
		CLEAR	0x4000_0058	Write-only
		TOGGLE	0x4000_005C	Write-only
	Pin Value Register (PVR)	-16-15	0x4000_0060	Read-only
1	Output Driver Enable Register (ODER)	WRITE	0x4000_0140	Write-only
15	子市场吗	SET	0x4000_0144	Write-only
	WW.DZSC.COM	CLEAR	0x4000_0148	Write-only
	11 11 11 11	TOGGLE	0x4000_014C	Write-only
	Output Value Register (OVR)	WRITE	0x4000_0150	Write-only
		SET	0x4000_0154	Write-only
		CLEAR	0x4000_0158	Write-only
	90	TOGGLE	0x4000_015C	Write-only
	Pin Value Register (PVR)	19197	0x4000_0160	Read-only

 Table 7-3.
 Local bus mapped GPIO registers



### 8. Boot Sequence

This chapter summarizes the boot sequence of the AT32UC3B. The behaviour after power-up is controlled by the Power Manager. For specific details, refer to section Power Manager (PM).

#### 8.1 Starting of clocks



After power-up, the device will be held in a reset state by the Power-On Reset circuitry, until the power has stabilized throughout the device. Once the power has stabilized, the device will use the internal RC Oscillator as clock source.

On system start-up, the PLLs are disabled. All clocks to all modules are running. No clocks have a divided frequency, all parts of the system recieves a clock with the same frequency as the internal RC Oscillator.

#### 8.2 Fetching of initial instructions

After reset has been released, the AVR32 UC CPU starts fetching instructions from the reset address, which is 0x8000_0000. This address points to the first address in the internal Flash.



The code read from the internal Flash is free to configure the system to use for example the PLLs, to divide the frequency of the clock routed to some of the peripherals, and to gate the clocks to unused peripherals.

## 查询AT32UC3B1512供应商 Electrical Characteristics 9.

#### 9.1 **Absolute Maximum Ratings***

Operating Temperature40°C to +85°C
Storage Temperature60°C to +150°C
Voltage on GPIO Pins with respect to Ground for TCK, RESET_N, PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31
Voltage on GPIO Pins with respect to Ground except for TCK, RESET_N, PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31
Maximum Operating Voltage (VDDCORE, VDDPLL) 1.95V
Maximum Operating Voltage (VDDIO,VDDIN,VDDANA) 3.6V
Total DC Output Current on all I/O Pin for 48-pin package

Stresses beyond those listed under "Absolute Maximum Ratings" may cause permanent damage to the device. This is a stress rating only and functional operation of the device at these or

other conditions beyond those indicated in the operational sections of this specification is not implied. Exposure to absolute maximum rating conditions for extended periods may affect

*NOTICE:

device reliability.







# 查询AT32UC3B1512供应商 DC Characteristics

## 9.2

The following characteristics are applicable to the operating temperature range:  $T_A = -40^{\circ}C$  to 85°C, unless otherwise specified and are certified for a junction temperature up to  $T_J = 100^{\circ}C$ . BE BUN DZSC.COM

Symbol	Parameter	Conditions	-12 X - 1	Min.	Тур.	Max.	Unit
V _{VDDCORE}	DC Supply Core	TIMO		1.65		1.95	V
V _{VDDPLL}	DC Supply PLL	DZSC.COM		1.65		1.95	V
V _{VDDIO}	DC Supply Peripheral I/Os			3.0		3.6	V
VIL	Input Low-level Voltage	AT32UC3B064 AT32UC3B0128 AT32UC3B0256 AT32UC3B164 AT32UC3B1128 AT32UC3B1256	All pins	-0.3	BJ NWW.	+0.8	V
		AT32UC3B0512	All pins exept Reset_N	-0.3		+0.8	V
		AT32UC3B1512	Reset_N	-0.3		+0.3	V
VIH	Input High-level Voltage	AT32UC3B064 AT32UC3B0128 AT32UC3B0256 AT32UC3B164 AT32UC3B1128 AT32UC3B1256	All I/O except TCK, RESET_N, PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31	2.0		5.5	D V
			TCK, RESET_N, PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31	2.0		3.6	v
		AT32UC3B0512 AT32UC3B1512	All I/O except TCK, RESET_N, PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31	2.0	aJ NWW.	5.5	V
			TCK, RESET_N	2.5		3.6	V
			PA03, PA04, PA05, PA06, PA07, PA08, PA11, PA12, PA18, PA19, PA28, PA29, PA30, PA31	2.0	-7	3.6	V
V _{OL}	Output Low-level Voltage	I _{OL} = -4mA for all I/O except for PA20, PA21, PA22, PA23			NWW.	0.4	v
UL		I _{OL} = -8mA for I/O F			0.4	V	
V _{OH}		I _{OL} = -4mA for all I/O except for PA20, PA21, PA22, PA23		V _{VDDI} o ^{-0.4}			V
	Output High-level Voltage	I _{OL} = -8mA for I/O PA20, PA21, PA22, PA23		V _{VDDI} 0 ^{-0.4}			v



#### 查询AT32UC3B1512供应商 Table 9-1. DC Characteristics

Symbol	Parameter	Conditions			Min.	Тур.	Max.	Unit	
		AllI GPIOs except f	or PA20, PA21, PA22	2, PA23		24	-4	mA	
l _{OL}	Output Low-level Current	I/O PA20, PA21, PA	22, PA23			WW.	-8	mA	
		AllI I/O except for P	A20, P <mark>A21, PA22</mark> , PA	A23			4	mA	
I _{ОН}	Output High-level Current	I/O PA20, PA21, PA	22, PA23				8	mA	
I _{LEAK}	Input Leakage Current	Pullup resistors dis	abled				1	μA	
1.80	WW	QFP64					7	pF	
	Input Conscitones	QFP48					7	pF	
C _{IN}	Input Capacitance	QFN64			101	- 1:	7	pF	
		QFN48		-		27	70	pF	
R _{PULLUP}	and B3	AT32UC3B064 AT32UC3B0128 AT32UC3B0256 AT32UC3B164	All I/O pins excep RESET_N, TCK, TMS pins		13	19	25	KΩ	
		AT32	AT32UC3B164 AT32UC3B1128 AT32UC3B1256	RESET_N pin, TO TDI, TMS pins	CK,	5	12	25	KΩ
	Pull-up Resistance	AT32UC3B0512	All I/O pins excep PA21, PA22, P RESET_N, TCK TMS pins	A23, K <mark>, TDI,</mark>	13	15	25	KΩ	
		AT32UC3B1512	PA20, PA21, PA22	2, PA23		8		KΩ	
		.DZSC.COM	RESET_N pin, TDI, TMS pi		5	10	25	KΩ	
	4 32 144	AT32UC3B064 AT32UC3B0128 AT32UC3B0256	On V _{VDDCORE} = 1.8V, device in static mode	T _A = 25°C		6	市场	μA	
1	Static Current	AT32UC3B164 AT32UC3B1128 AT32UC3B1256	All inputs driven including JTAG; RES <mark>ET_</mark> N=1	T _A = 85°C	-	42.5	0250	μA	
Isc		AT32UC3B0512	On V _{VDDCORE} = 1.8V, device in static mode	T _A = 25°C		7.5		μA	
		AT32UC3B1512	All inputs driven including JTAG; RESET_N=1	T _A = 85°C		62.5	TH	μΑ	





# 查询AT32UC3B1512供应商 Regulator Characteristics 9.3

Table 9-2. **Electrical Characteristics** 

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
V _{VDDIN}	Supply voltage (input)		3	3.3	3.6	V
V _{VDDOUT}	Supply voltage (output)		1.70	1.8	1.85	V
I _{OUT}	Maximum DC output current	V _{VDDIN} = 3.3V			100	mA
I _{SCR}	Static Current of internal regulator	Low Power mode (stop, deep stop or static) at $T_A = 25^{\circ}C$		10		μA

#### Table 9-3. **Decoupling Requirements**

Symbol	Parameter	Conditions	Тур.	Technology	Unit
C _{IN1}	Input Regulator Capacitor 1		1	NPO	nF
C _{IN2}	Input Regulator Capacitor 2	COM	4.7	X7R	μF
C _{OUT1}	Output Regulator Capacitor 1	0.001	470	NPO	pF
C _{OUT2}	Output Regulator Capacitor 2		2.2	X7R	μF

#### **Analog Characteristics** 9.4

#### 9.4.1 **ADC Reference**

Table 9-4. **Electrical Characteristics** 

Symbol	Parameter 2007 SC	Conditions	Min.	Тур.	Max.	Unit
V _{ADVREF}	Analog voltage reference (input)		2.6		3.6	V

#### Table 9-5. **Decoupling Requirements**

Symbol	Parameter	Conditions	Тур.	Technology	Unit
C _{VREF1}	Voltage reference Capacitor 1	1-1 M	10	NPO	nF
C _{VREF2}	Voltage reference Capacitor 2		1	NPO	uF

#### BOD 9.4.2


Table 9-6.         BOD Level Values						
Symbol	Parameter Value	Conditions	Min.	Тур.	Max.	Unit
	00 0000b			1.44	DZSC.	V
	01 0111b	157		1.52		V
BODLEVEL	01 1111b			1.61		V
	10 0111b	.001		1.71		V

 Table 9-6 describes the values of the BODLEVEL field in the flash FGPFR register.











#### Table 9-7. **BOD** Timing


Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
T _{BOD}	Minimum time with VDDCORE < VBOD to detect power failure	Falling VDDCORE from 1.8V to 1.1V	193	300	800	ns
9.4.3 Re	eset Sequence	COM				

#### 9.4.3 **Reset Sequence**

#### Table 9-8. Electrical Characteristics

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
V _{DDRR}	VDDCORE rise rate to ensure power- on-reset	-	0.01	27	DZSC.	V/ms
V _{DDFR}	VDDCORE fall rate to ensure power- on-reset		0.01	11 11 11 11	400	V/ms
V _{POR+}	Rising threshold voltage: voltage up to which device is kept under reset by POR on rising VDDCORE	Rising VDDCORE: V _{RESTART} -> V _{POR+}	1.4	1.55	1.65	V
V _{POR-}	Falling threshold voltage: voltage when POR resets device on falling VDDCORE	Falling VDDCORE: 1.8V -> V _{POR+}	1.2	1.3	1.4	v
V _{RESTART}	On falling VDDCORE, voltage must go down to this value before supply can rise again to ensure reset signal is released at V _{POR+}	Falling VDDCORE: 1.8V -> V _{RESTART}	-0.1	WWW.	0.5	V
T _{POR}	Minimum time with VDDCORE <	Falling VDDCORE: 1.8V -> 1.1V		15		μs
T _{RST}	Time for reset signal to be propagated to system			200	400	μs
T _{SSU1}	Time for Cold System Startup: Time for CPU to fetch its first instruction (RCosc not calibrated)		480	BJ NWW.	960	μs
T _{SSU2}	Time for Hot System Startup: Time for CPU to fetch its first instruction (RCosc calibrated)			420		μs



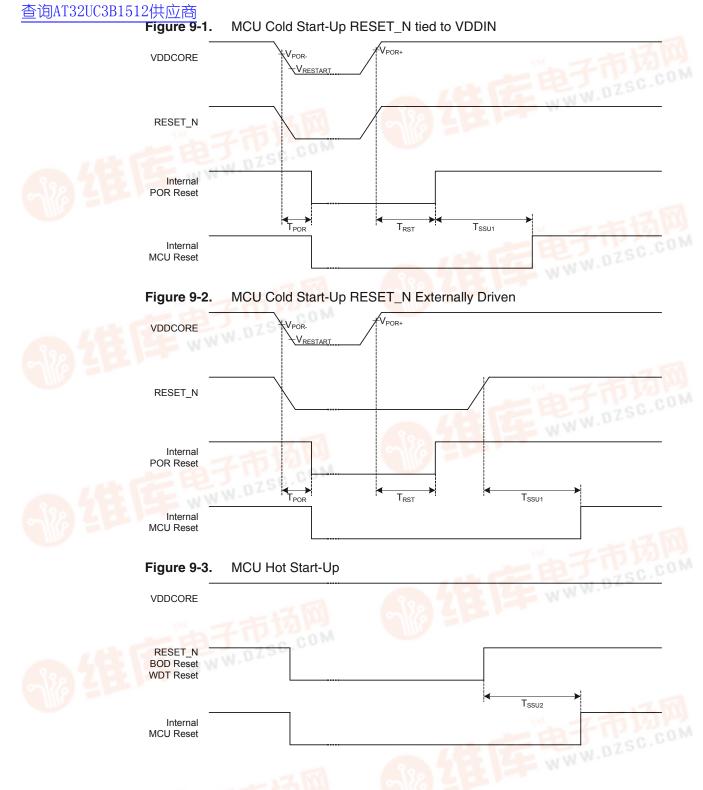

#### 9.4.4 RESET_N Characteristics


#### Table 9-9. RESET_N Waveform Parameters

Sym <mark>bol</mark>	Parameter	Conditions	Min.	Тур.	Max.	Unit
t _{RESET}	RESET_N minimum pulse width		10			ns



# 查询AT32UC3B1512供应商 Power Consumption 9.5

The values in Table 9-10, Table 9-11 on page 42 and Table 9-12 on page 43 are measured values of power consumption with operating conditions as follows:

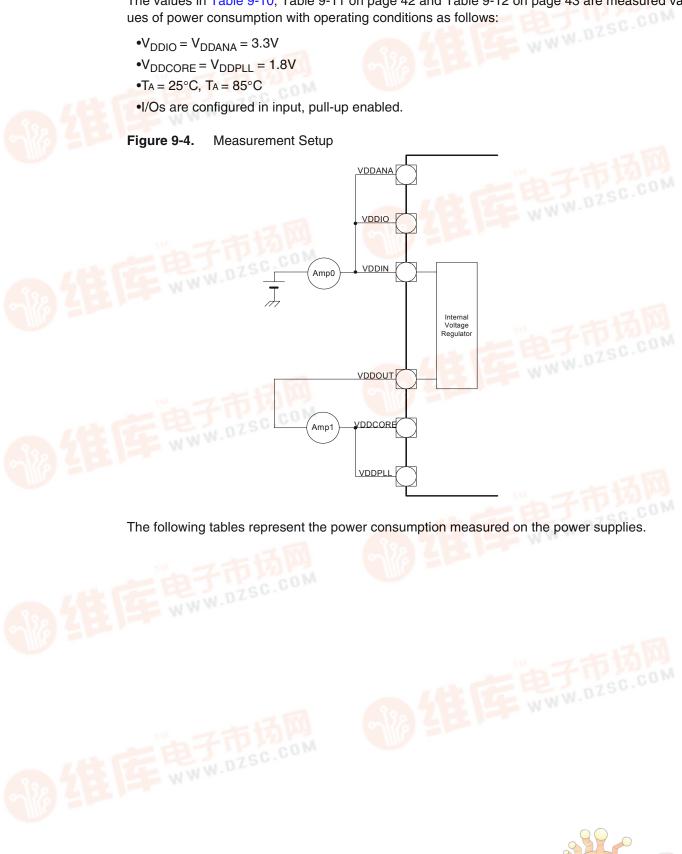



## 9.5.1 Power Consumtion for Different Sleep Modes

Table 9-10.Power Consumption for Different Sleep Modes for AT32UC3B064, AT32UC3B0128, AT32UC3B0256,<br/>AT32UC3B164, AT32UC3B1128, AT32UC3B1256

Mode	Conditions		Тур.	Unit
Active	<ul> <li>-CPU running a recursive Fibonacci Algorithm from flas at f MHz.</li> <li>-Voltage regulator is on.</li> <li>-XIN0 : external clock. Xin1 Stopped. XIN32 stopped.</li> <li>-All peripheral clocks activated with a division by 8.</li> <li>- GPIOs are inactive with internal pull-up, JTAG unconnup and Input pins are connected to GND</li> </ul>		0.3xf(MHz)+0.443	mA/MHz
	Same conditions at 60 MHz		18.5	mA
1-11-	See Active mode conditions		0.117xf(MHz)+0.28	mA/MHz
Idle	Same conditions at 60 MHz		7.3	mA
_	See Active mode conditions		0.058xf(MHz)+0.115	mA/MHz
Frozen	Same conditions at 60 MHz		3.6	mA
o	See Active mode conditions		0.042xf(MHz)+0.115	mA/MHz
Standby	Same conditions at 60 MHz		2.7	mA
Stop	<ul> <li>-CPU running in sleep mode</li> <li>-XIN0, Xin1 and XIN32 are stopped.</li> <li>-All peripheral clocks are desactived.</li> <li>- GPIOs are inactive with internal pull-up, JTAG unconnected with external pull-up and Input pins are connected to GND.</li> </ul>		37.8	μA
Deepstop	See Stop mode conditions		24.9	μA
QL 11		Voltage Regulator On	13.9	μA
Static	See Stop mode conditions	Voltage Regulator Off	8.9	μΑ

Notes: 1. Core frequency is generated from XIN0 using the PLL so that 140 MHz <  $f_{PLL0}$  < 160 MHz and 10 MHz <  $f_{XIN0}$  < 12 MHz.

Table 9-11.	Power Consumption for Different Sleep Modes for AT32UC3B0512, AT32UC3B1512
-------------	----------------------------------------------------------------------------

Mode	Conditions	Тур.	Unit
Active	<ul> <li>-CPU running a recursive Fibonacci Algorithm from flash and clocked from PLL0 at f MHz.</li> <li>-Voltage regulator is on.</li> <li>-XIN0 : external clock. Xin1 Stopped. XIN32 stopped.</li> <li>-All peripheral clocks activated with a division by 8.</li> <li>- GPIOs are inactive with internal pull-up, JTAG unconnected with external pull-up and Input pins are connected to GND</li> </ul>	0.388xf(MHz)+0.781	mA/MHz
	Same conditions at 60 MHz	24	mA
	See Active mode conditions	0.143xf(MHz)+0.248	mA/MHz
Idle	Same conditions at 60 MHz	9	mA
	See Active mode conditions	0.07xf(MHz)+0.094	mA/MHz
Frozen	Same conditions at 60 MHz	4.3	mA



# Table 9-11. Power Consumption for Different Sleep Modes for AT32UC3B0512, AT32UC3B1512

Mode	Conditions		Тур.	Unit
Ota is allow	See Active mode conditions		0.052xf(MHz)+0.091	mA/MHz
Standby	Same conditions at 60 MHz	- 18	3.2	mA
Stop	-CPU running in sleep mode -XIN0, Xin1 and XIN32 are stopped. -All peripheral clocks are desactived. - GPIOs are inactive with internal pull-up, JTAC up and Input pins are connected to GND.	a unconnected with external pull-	63.2	μA
Deep <mark>stop</mark>	See Stop mode conditions		30.3	μA
Chatia		Voltage Regulator On	16.5	
Static	See Stop mode conditions	Voltage Regulator Off	7.5 7.5	μA

Notes: 1. Core frequency is generated from XIN0 using the PLL so that  $140 \text{ MHz} < f_{PLL0} < 160 \text{ MHz}$  and 10 MHz <  $f_{XIN0} < 12 \text{ MHz}$ .

#### Table 9-12. Peripheral Interface Power Consumption in Active Mode

Peripheral	Conditions	Consumption	Unit
INTC		20	7 50
GPIO		16	26
PDCA	AT32UC3B064	12 12	C.COM
USART	AT32UC3B0128	14	
USB	AT32UC3B0256	23	
ADC	AT32UC3B164 AT32UC3B1128	8	
TWI	AT32UC3B1256	7	µA/MHz
PWM	AT32UC3B0512	18	
SPI	AT32UC3B1512	8	319
SSC		11	C.COM
TC	A 48 8	W WIN. DZS	
ABDAC	AT32UC3B0512 AT32UC3B1512	6.5	



# 查询AT32UC3B1512供应商 System Clock Characteristics 9.6

These parameters are given in the following conditions:

- V_{DDCORE} = 1.8V
- Ambient Temperature = 25°C

#### 9.6.1 **CPU/HSB Clock Characteristics**

#### Core Clock Waveform Parameters Table 9-13.

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
1/(t _{CPCPU} )	CPU Clock Frequency				60	MHz
t _{CPCPU}	CPU Clock Period		16.6	1	5	ns
9.6.2 PE	A Clock Characteristics	-		AWW.	DZSC.	COM

#### 9.6.2 **PBA Clock Characteristics**

#### PBA Clock Waveform Parameters Table 9-14.

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
1/(t _{CPPBA} )	PBA Clock Frequency				60	MHz
t _{CPPBA}	PBA Clock Period		16.6			ns

#### 9.6.3 **PBB Clock Characteristics**

#### PBB Clock Waveform Parameters Table 9-15.

Symbol	Parameter do	Conditions	Min.	Тур.	Max.	Unit
1/(t _{CPPBB} )	PBB Clock Frequency				60	MHz
t _{CPPBB}	PBB Clock Period		16.6			ns





# 查询AT32UC3B1512供应商 Oscillator Characteristics 9.7

The following characteristics are applicable to the operating temperature range: T_A = -40°C to 85°C and worst case of WWW.DZSC.COM power supply, unless otherwise specified.

#### 9.7.1 Slow Clock RC Oscillator

#### RC Oscillator Frequency Table 9-16.

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
	WWW.D	Calibration point: $T_A = 85^{\circ}C$		115.2	116	KHz
F _{RC}	RC Oscillator Frequency	$T_A = 25^{\circ}C$		112		KHz
		$T_A = -40^{\circ}C$	105	108	-17	KHz

#### 9.7.2 32 KHz Oscillator

Table 9-17. 32 KHz Oscillator Characteristics

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
1//+		External clock on XIN32			30	MHz
1/(t _{CP32KHz} )	Oscillator Frequency	Crystal		32 768		Hz
CL	Equivalent Load Capacitance		6		12.5	pF
ESR	Crystal Equivalent Series Resistance		L i	27	100	KΩ
t _{ST}	Startup Time	$C_{L} = 6pF^{(1)}$ $C_{L} = 12.5pF^{(1)}$	9	NWW.	600 1200	ms
t _{CH}	XIN32 Clock High Half-period		0.4 t _{CP}		0.6 t _{CP}	
t _{CL}	XIN32 Clock Low Half-period	COM	0.4 t _{CP}		0.6 t _{CP}	
C _{IN}	XIN32 Input Capacitance				5	pF
- (~)/e	Current Consumption	Active mode			1.8	μA
losc	Current Consumption	Standby mode	135	-	0.1	μA

Note: 1.  $C_L$  is the equivalent load capacitance.







#### 查询AT32UC3B1512供应商 Main Oscillators 9.7.3

#### Table 9-18. Main Oscillators Characteristics

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
4 //1 \		External clock on XIN	5-1	NWW.	50	MHz
1/(t _{CPMAIN} )	Oscillator Frequency	Crystal	0.4		20	MHz
C _{L1} , C _{L2}	Internal Load Capacitance (C _{L1} = C _{L2} )	COM		12		pF
ESR	Crystal Equivalent Series Resistance				75	Ω
	Duty Cycle		40	50	60	%
t _{ST}	Startup Time	f = 3 MHz f = 8 MHz f = 16 MHz	E	时	14.5 4 1.4	ms
t _{CH}	XIN Clock High Half-period		0.4 t _{CP}	N 44	0.6 t _{CP}	
t _{CL}	XIN Clock Low Half-period		0.4 t _{CP}		0.6 t _{CP}	
C _{IN}	XIN Input Capacitance	.001		12		pF
. <u>१</u> .		Active mode at 450 KHz. Gain = G0		25		μA
losc	Current Consumption	Active mode at 16 MHz. Gain = G3		325		μA

#### Phase Lock Loop 9.7.4

#### Phase Lock Loop Characteristics Table 9-19.

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
FOUT	VCO Output Frequency		80		240	MHz
F _{IN}	Input Frequency		4		16	MHz
I _{PLL}	Current Consumption	Active mode F _{VCO} @96 MHz Active mode F _{VCO} @128 MHz Active mode F _{VCO} @160 MHz	Ĕ	320 410 450	市场	μΑ
		Standby mode	5-1	5	320	μA



#### ● 查询AT32UC3B1512供应商 ● ADC Characteristics

#### Table 9-20. Channel Conversion Time and ADC Clock



Parameter	Conditions	Min.	Тур.	Max.	Unit
ADC Clock Frequency	10-bit resolution mode		WWV	5	MHz
ADC Clock Frequency	8-bit resolution mode	6 -		8	MHz
Startup Time	Return from Idle Mode			20	μs
Track and Hold Acquisition Time	N.BLOC	600			ns
Track and Hold Input Resistor			350		Ω
Track and Hold Capacitor			12	-17	pF
	ADC Clock = 5 MHz		- 42-7	2	μs
Conversion Time	ADC Clock = 8 MHz		WW V	1.25	μs
There exists a set	ADC Clock = 5 MHz	271 - 1 -		384 ⁽¹⁾	kSPS
Throughput Rate	ADC Clock = 8 MHz			533 ⁽²⁾	kSPS

Notes: 1. Corresponds to 13 clock cycles: 3 clock cycles for track and hold acquisition time and 10 clock cycles for conversion. 2. Corresponds to 15 clock cycles: 5 clock cycles for track and hold acquisition time and 10 clock cycles for conversion.

#### Table 9-21. External Voltage Reference Input

Table o En External Voltage Helefel					
Parameter	Conditions	Min.	Тур.	Max.	Unit
ADVREF Input Voltage Range	(1)	2.6	WWV	VDDANA	V
ADVREF Average Current	On 13 samples with ADC Clock = 5 MHz	H	200	250	μA
Current Consumption on VDDANA	On 13 samples with ADC Clock = 5 MHz			1	mA

Note: 1. ADVREF should be connected to GND to avoid extra consumption in case ADC is not used.

#### Table 9-22. Analog Inputs

Parameter	Conditions	Min.	Тур.	Max.	Unit
Input Voltage Range		0	- 49-7	VADVREF	V
Input Leakage Current			WWV	1.0450.	μA
Input Capacitance	-12151 - 22.74		7		pF

#### Table 9-23. Transfer Characteristics in 8-bit Mode

Parameter	Conditions	Min.	Тур.	Max.	Unit
Resolution			8	-17	Bit
	ADC Clock = 5 MHz		- ma	0.8	LSB
Absolute Accuracy	ADC Clock = 8 MHz			1.5	LSB
Interval New Jincovity	ADC Clock = 5 MHz	3274375	0.35	0.5	LSB
Integral Non-linearity	ADC Clock = 8 MHz		0.5	1.0	LSB
和维库	WWW.DZSC.COM		1		



# 查询AT32UC3B1512供应商 9-23. Transfer Characteristics in 8-bit Mode Table 9-23.

Parameter	Conditions	Min.	Тур.	Max.	Unit
Differential New Jacovity	ADC Clock = 5 MHz		0.3	0.5	LSB
Differential Non-linearity	ADC Clock = 8 MHz	115	0.5	1.0	LSB
Offset Error	ADC Clock = 5 MHz	-0.5		0.5	LSB
Gain Error	ADC Clock = 5 MHz	-0.5		0.5	LSB

#### Table 9-24. Transfer Characteristics in 10-bit Mode

Parameter	Conditions	Min.	Тур.	Max.	Unit
Resolution			10	-10 1/2	Bit
Absolute Accuracy	ADC Clock = 5 MHz		- 62 -	3	LSB
Integral Non-linearity	ADC Clock = 5 MHz		1.5	2	LSB
	ADC Clock = 5 MHz	6	1	2	LSB
Differential Non-linearity	ADC Clock = 2.5 MHz		0.6	1	LSB
Offset Error	ADC Clock = 5 MHz	-2		2	LSB
Gain Error	ADC Clock = 5MHz	-2		2	LSB

#### 9.9 **JTAG Characteristics**


#### 9.9.1 **JTAG Interface Signals**


Table 9-25. JTAG Interface Timing Specification

Symbol	Parameter Parameter 2015	Conditions	Min.	Max.	Unit
JTAG ₀	TCK Low Half-period	(1)	6		ns
JTAG ₁	TCK High Half-period	(1)	3		ns
JTAG ₂	TCK Period	(1)	9	工市场	ns
JTAG ₃	TDI, TMS Setup before TCK High	(1)	1	W DZSC	ns
JTAG ₄	TDI, TMS Hold after TCK High	(1)	0	44.1	ns
JTAG ₅	TDO Hold Time	(1)	4		ns
JTAG ₆	TCK Low to TDO Valid	(1)		6	ns
JTAG ₇	Device Inputs Setup Time	(1)			ns
JTAG ₈	Device Inputs Hold Time	(1)			ns
JTAG ₉	Device Outputs Hold Time	(1)		1 - 5 17	ns
JTAG ₁₀	TCK to Device Outputs Valid	(1)		TTV P	ns

Notes: 1.  $V_{VDDIO}$  from 3.0V to 3.6V, maximum external capacitor = 40pF 推荐电子市场叫 www.bzsc.com



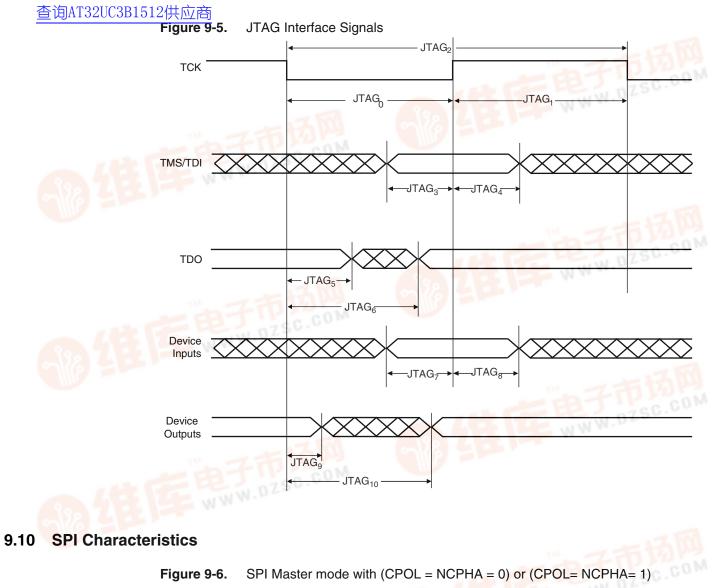

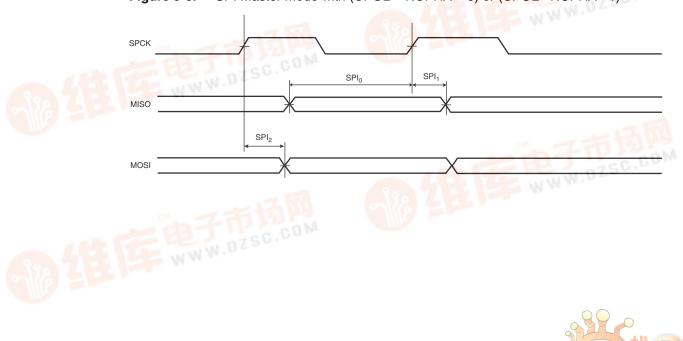



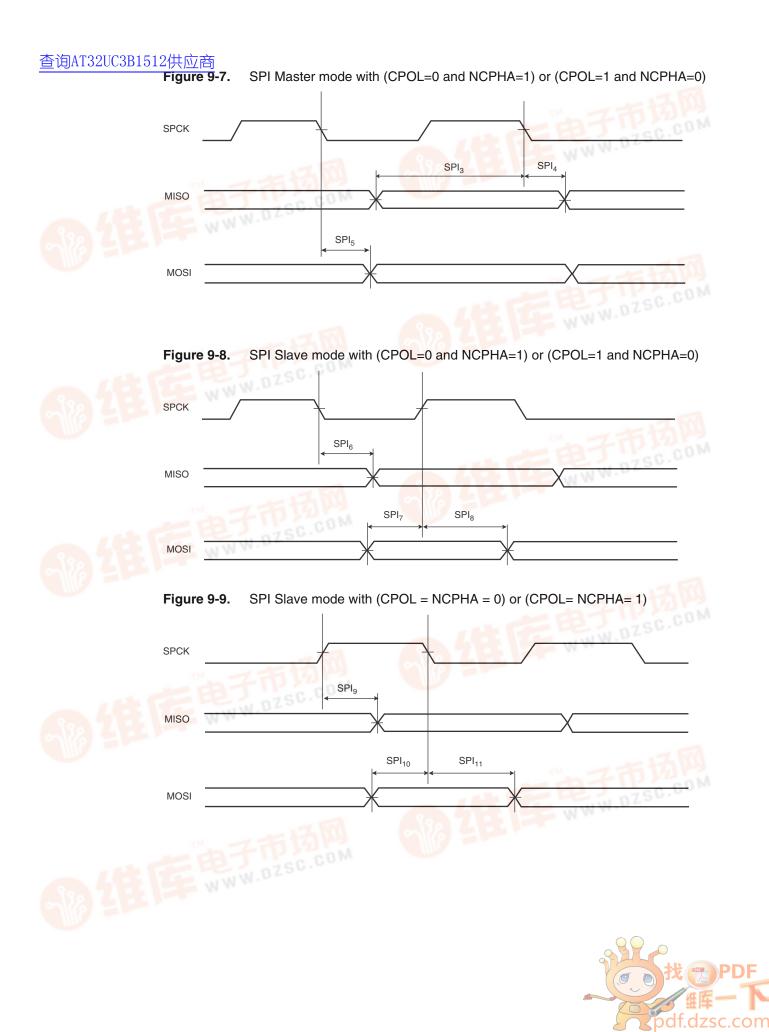




Table 9-26. **SPI** Timings

Symbol	Parameter	Conditions	Min.	Max.	Unit
SPI0	MISO Setup time before SPCK rises (master)	3.3V domain ⁽¹⁾	22 + (t _{CPMCK} )/ 2 ⁽²⁾	W.025	ns
SPI1	MISO Hold time after SPCK rises (master)	3.3V domain ⁽¹⁾	0		ns
SPI ₂	SPCK rising to MOSI Delay (master)	3.3V domain ⁽¹⁾		7	ns
SPI ₃	MISO Setup time before SPCK falls (master)	3.3V domain ⁽¹⁾	22 + (t _{CPMCK} )/ 2 ⁽²⁾	Fit	ns
SPI4	MISO Hold time after SPCK falls (master)	3.3V domain ⁽¹⁾	0		ns
SPI5	SPCK falling to MOSI Delay master)	3.3V domain ⁽¹⁾		7	ns
SPI ₆	SPCK falling to MISO Delay (slave)	3.3V domain ⁽¹⁾		26.5	ns
SPI ₇	MOSI Setup time before SPCK rises (slave)	3.3V domain ⁽¹⁾	0	开市场	ns
SPI ₈	MOSI Hold time after SPCK rises (slave)	3.3V domain ⁽¹⁾	1.5	W.0230	ns
SPI ₉	SPCK rising to MISO Delay (slave)	3.3V domain ⁽¹⁾		27	ns
SPI ₁₀	MOSI Setup time before SPCK falls (slave)	3.3V domain ⁽¹⁾	0		ns
SPI ₁₁	MOSI Hold time after SPCK falls (slave)	3.3V domain ⁽¹⁾	1	W.DZSC	ns



# 查询AT32UC3B1512供应商 9.11 Flash Memory Characteristics

The following table gives the device maximum operating frequency depending on the field FWS of the Flash FSR register. This field defines the number of wait states required to access the Flash Memory. Flash operating frequency equals the CPU/HSB frequency.

Flash Operating Frequency Table 9-27.

Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
F _{FOP}	Flash Operating Frequency	FWS = 0			33	MHz
		FWS = 1			60	MHz

#### Table 9-28. **Programming TIme**

					of C. Lin	U -
Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
T _{FPP}	Page Programming Time	日出国	SH I	4		ms
T _{FFP}	Fuse Programming Time			0.5		ms
T _{FCE}	Chip Erase Time	1250		4		ms

Table 9-29.	Flash Parameters		154	n7	市场	
Symbol	Parameter	Conditions	Min.	Тур.	Max.	Unit
N _{FARRAY}	Flash Array Write/Erase cycle	and Ale	74:1 22	11 44 11	100K	Cycle
N _{FFUSE}	General Purpose Fuses write cycle				10K	Cycle
T _{FDR}	Flash Data Retention Time	C.COM		15		Year



#### 查询AT32UC3B1512供应商 10. Mechanical Characteristics

# **10.1** Thermal Considerations

#### 10.1.1 Thermal Data

Table 10-1 summarizes the thermal resistance data depending on the package.

Symbol	Parameter	Condition	Package	Тур	Unit
θ _{JA}	Junction-to-ambient thermal resistance	Still Air	TQFP64	49.6	C 144
$\theta_{JC}$	Junction-to-case thermal resistance		TQFP64	13.5	·C/W
$\theta_{JA}$	Junction-to-ambient thermal resistance	Still Air	TQFP48	51.1	0.00
$\theta_{JC}$	Junction-to-case thermal resistance		TQFP48	13.7	·C/W

Table 10-1.	Thermal Resistance Data
	mermai nesistance Data

#### 10.1.2 Junction Temperature

The average chip-junction temperature,  $T_J$ , in °C can be obtained from the following:

1. 
$$T_J = T_A + (P_D \times \theta_{JA})$$

**2.**  $T_J = T_A + (P_D \times (\theta_{HEATSINK} + \theta_{JC}))$ 

where:

- θ_{JA} = package thermal resistance, Junction-to-ambient (°C/W), provided in Table 10-1 on page 53.
- $\theta_{JC}$  = package thermal resistance, Junction-to-case thermal resistance (°C/W), provided in Table 10-1 on page 53.
- $\theta_{HEAT SINK}$  = cooling device thermal resistance (°C/W), provided in the device datasheet.
- P_D = device power consumption (W) estimated from data provided in the section "Power Consumption" on page 41.
- T_A = ambient temperature (°C).


From the first equation, the user can derive the estimated lifetime of the chip and decide if a cooling device is necessary or not. If a cooling device is to be fitted on the chip, the second equation should be used to compute the resulting average chip-junction temperature  $T_{J}$  in °C.





### 查询AT32UC3B1512供应商 10.2 Package Drawings


Figure 10-1. TQFP-64 package drawing

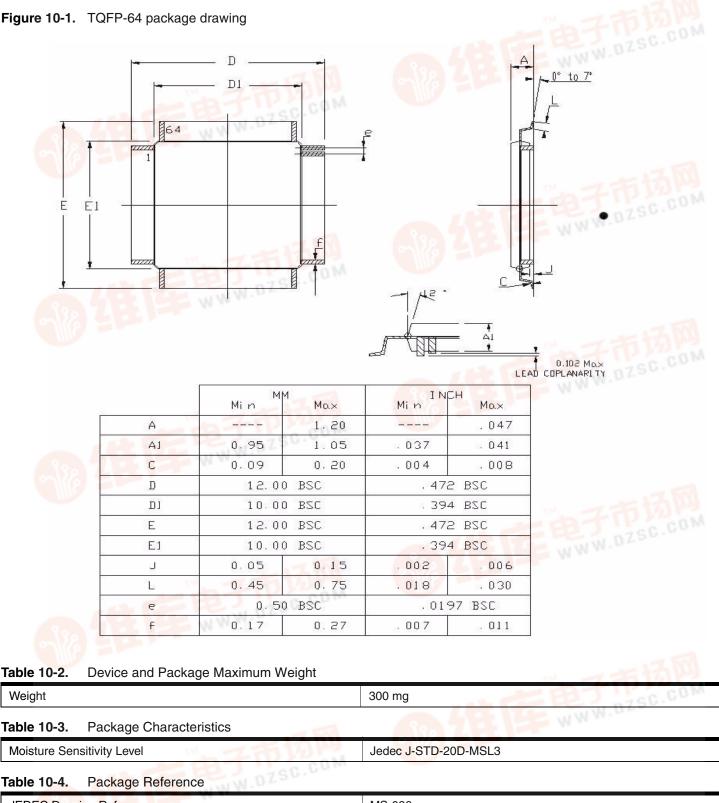

JEDEC Drawing Reference MS-026 JESD97 Classification e3



### 查询AT32UC3B1512供应商 Figure 10-2. TQFP-48 package drawing

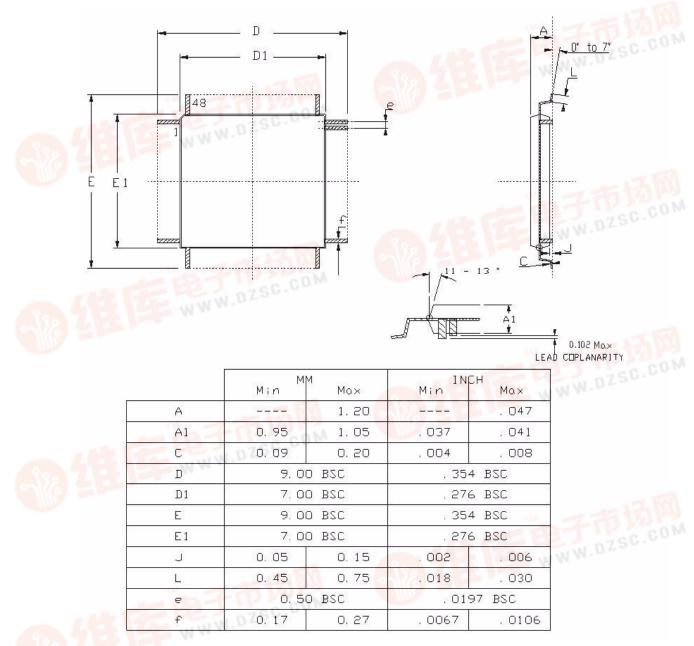

# Table 10-5. Device and Package Maximum Weight

Weight		100 mg
Table 10-6.	Package Characteristics	WWW.DZSC.Co.
Moisture Sensitivity Level		Jedec J-STD-20D-MSL3
Table 10-7.	~ 771	COM
Table 10-7. JEDEC Drav	~ 771	MS-026



#### 查询AT32UC3B1512供应商 Figure 10-3. QFN-64 package drawing


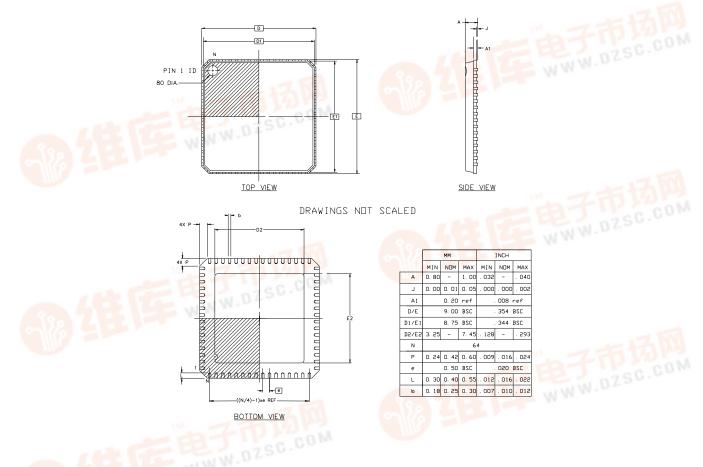


Table 10-8.	Device and Package Maximum	Weight
-------------	----------------------------	--------

Weight		200 mg	「「ゴーズ市」の
Table 10-9.	Package Characteristics	- LE 15	WWW.DZSC.CO
Moisture Sensitivity Level		Jedec J-STD-20D-MSL3	
Table 10-10.	. Package Reference	COM	
JEDEC Drav	wing Reference	M0-220	
JESD97 Cla	ssification	e3	



#### 查询AT32UC3B1512供应商 Figure 10-4. QFN-48 package drawing

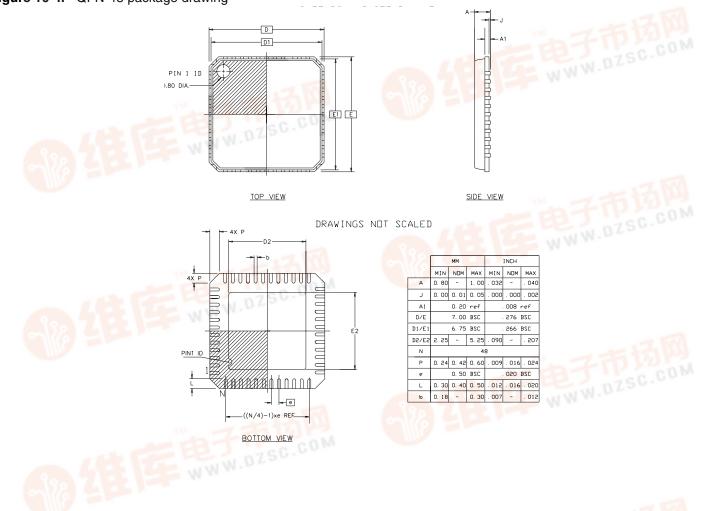

Weight	100 mg
Table 10-12. Package Characteristics	390 Y 1 - 1 W W W.
Tuble 10 12. Tubliage characteristics	

JEDEC Drawing Reference	M0-220
JESD97 Classification	e3





# 查询AT32UC3B1512供应商 10.3 Soldering Profile

Table 10-14 gives the recommended soldering profile from J-STD-20.



Table 10-14. Soldering Profile	able 10-14. So	Idering Profile	ļ
--------------------------------	----------------	-----------------	---

Green Package
3°C/s
Min. 150°C, Max. 200°C
60-150s
30s
260°C
6°C/s
Max. 8mn

It is recommended to apply a soldering temperature higher than 250°C. Note: A maximum of three reflow passes is allowed per component. WWW.DZSI



# 查询AT32UC3B1512供应商 11. Ordering Information

Device	Ordering Code	Package	Conditioning	Temperature Operating Range
AT32UC3B0512	AT32UC3B0512-A2UES	TQFP 64	74:3 54	Industrial (-40°C to 85°C)
	AT32UC3B0512-A2UR	TQFP 64	Reel	Industrial (-40°C to 85°C)
	AT32UC3B0512-A2UT	TQFP 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B0512-Z2UES	QFN 64	-	Industrial (-40°C to 85°C)
	AT32UC3B0512-Z2UR	QFN 64	Reel	Industrial (-40°C to 85°C)
	AT32UC3B0512-Z2UT	QFN 64	Tray	Industrial (-40°C to 85°C)
AT32UC3B0256	AT32UC3B0256-A2UT	TQFP 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B0256-A2UR	TQFP 64	Reel	Industrial (-40°C to 85°C)
	AT32UC3B0256-Z2UT	QFN 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B0256-Z2UR	QFN 64	Reel	Industrial (-40°C to 85°C)
AT32UC3B0128	AT32UC3B0128-A2UT	TQFP 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B0128-A2UR	TQFP 64	Reel	Industrial (-40°C to 85°C)
	AT32UC3B0128-Z2UT	QFN 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B0128-Z2UR	QFN 64	Reel	Industrial (-40°C to 85°C)
AT32UC3B064	AT32UC3B064-A2UT	TQFP 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B064-A2UR	TQFP 64	Reel	Industrial (-40°C to 85°C)
	AT32UC3B064-Z2UT	QFN 64	Tray	Industrial (-40°C to 85°C)
	AT32UC3B064-Z2UR	QFN 64	Reel	Industrial (-40°C to 85°C)
AT32UC3B1512	AT32UC3B1512-Z1UT	QFN 48	-	Industrial (-40°C to 85°C)
	AT32UC3B1512-Z1UR	QFN 48	-	Industrial (-40°C to 85°C)
AT32UC3B1256	AT32UC3B1256-AUT	TQFP 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B1256-AUR	TQFP 48	Reel	Industrial (-40°C to 85°C)
	AT32UC3B1256-Z1UT	QFN 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B1256-Z1UR	QFN 48	Reel	Industrial (-40°C to 85°C)
AT32UC3B1128	AT32UC3B1128-AUT	TQFP 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B1128-AUR 🦪	TQFP 48	Reel	Industrial (-40°C to 85°C)
	AT32UC3B1128-Z1UT	QFN 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B1128-Z1UR	QFN 48	Reel	Industrial (-40°C to 85°C)
AT32UC3B164	AT32UC3B164-AUT	TQFP 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B164-AUR	TQFP 48	Reel	Industrial (-40°C to 85°C)
	AT32UC3B164-Z1UT	QFN 48	Tray	Industrial (-40°C to 85°C)
	AT32UC3B164-Z1UR	QFN 48	Reel	Industrial (-40°C to 85°C)







# 12. Errata

# 12.1 AT32UC3B0512, AT32UC3B1512

- 12.1.1 Rev D
- 12.1.1.1 PWM

#### **1. PWM channel interrupt enabling triggers an interrupt**

When enabling a PWM channel that is configured with center aligned period (CALG=1), an interrupt is signalled.

#### Fix/Workaround

When using center aligned mode, enable the channel and read the status before channel interrupt is enabled.

#### 2. PWM counter restarts at 0x0001

The PWM counter restarts at 0x0001 and not 0x0000 as specified. Because of this the first PWM period has one more clock cycle.

#### Fix/Workaround

- The first period is 0x0000, 0x0001, ..., period
- Consecutive periods are 0x0001, 0x0002, ..., period

#### 3. PWM update period to a 0 value does not work

It is impossible to update a period equal to 0 by the using the PWM update register (PWM_CUPD).

## Fix/Workaround

Do not update the PWM_CUPD register with a value equal to 0.

12.1.1.2 SPI

#### 1. SPI Slave / PDCA transfer: no TX UNDERRUN flag

There is no TX UNDERRUN flag available, therefore in SPI slave mode, there is no way to be informed of a character lost in transmission. **Fix/Workaround** 

For PDCA transfer: none.

2. SPI Bad Serial Clock Generation on 2nd chip_select when SCBR = 1, CPOL=1 and NCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an aditional pulse will be generated on SCK. **Fix/workaround** 

When multiple CS are in use, if one of the baudrate equals 1, the other must also equal 1 if CPOL=1 and CPHA=0.

3. SPI Glitch on RXREADY flag in slave mode when enabling the SPI or during the first transfer

In slave mode, the SPI can generate a false RXREADY signal during enabling of the SPI or during the first transfer.

### Fix/Workaround

- 1. Set slave mode, set required CPOL/CPHA.
- 2. Enable SPI.
- 3. Set the polarity CPOL of the line in the opposite value of the required one.
- 4. Set the polarity CPOL to the required one.





5. Read the RXHOLDING register. Transfers can now befin and RXREADY will now behave as expected.

#### 4. SPI Disable does not work in Slave mode SPI Disable does not work in Slave mode.

#### Fix/workaround

Read the last received data then perform a Software reset.

#### . Module hangs when CSAAT=1 on CS0

SPI data transfer hangs with CSAAT=1 in CSR0 and MODFDIS=0 in MR. When CSAAT=1 in CSR0 and mode fault detection is enabled (MODFDIS=0 in MR), the SPI module will not start a data transfer.

### Fix/Workaround

Disable mode fault detection by writing a one to MODFDIS in MR.

#### 6. Disabling SPI has no effect on flag TDRE flag

Disabling SPI has no effect on TDRE whereas the write data command is filtered when SPI is disabled. This means that as soon as the SPI is disabled it becomes impossible to reset the TDRE flag by writing in the TDR. So if the SPI is disabled during a PDCA transfer, the PDCA will continue to write data in the TDR (as TDRE stays high) until its buffer is empty, and all data written after the disable command is lost.

# Fix/Workaround

Disable the PDCA, 2 NOP (minimum), disable SPI. When you want to continue the transfer: Enable SPI, enable PDCA.

#### 12.1.1.3 Power Manager

1. If the BOD level is higher than VDDCORE, the part is constantly under reset If the BOD level is set to a value higher than VDDCORE and enabled by fuses, the part will be in constant reset.

#### Fix/Workaround

Apply an external voltage on VDDCORE that is higher than the BOD level and is lower than VDDCORE max and disable the BOD.

2. When the main clock is RCSYS, TIMER_CLOCK5 is equal to PBA clock When the main clock is generated from RCSYS, TIMER_CLOCK5 is equal to PBA Clock and not PBA Clock / 128. Fix/workaround:

None.

# 3. Clock sources will not be stopped in STATIC sleep mode if the difference between CPU and PBx division factor is too big

If the division factor between the CPU/HSB and PBx frequencies is more than 4 when going to a sleep mode where the system RC oscillator is turned off, then high speed clock sources will not be turned off. This will result in a significantly higher power consumption during the sleep mode.

### Fix/Workaround

Before going to sleep modes where the system RC oscillator is stopped, make sure that the factor between the CPU/HSB and PBx frequencies is less than or equal to 4.

#### 4. Increased Power Consunption in VDDIO in sleep modes

If the OSC0 is enabled in crystal mode when entering a sleep mode where the OSC0 is disabled, this will lead to an increased power consumption in VDDIO.







#### Fix/Workaround

Disable the OSC0 through the Power Manager (PM) before going to any sleep mode where the OSC0 is disabled, or pull down or up XIN0 and XOUT0 with 1Mohm resistor. W.DZSC.COM

- 12.1.1.4 SSC
- 1. Additional delay on TD output

A delay from 2 to 3 system clock cycles is added to TD output when: TCMR.START = Receive Start, TCMR.STTDLY = more than ZERO,RCMR.START = Start on falling edge / Start on Rising edge / Start on any edge, RFMR.FSOS = None (input). Fix/Workaround None.

2. TF output is not correct TF output is not correct (at least emitted one serial clock cycle later than expected) when: TFMR.FSOS = Driven Low during data transfer/ Driven High during data transfer

None.

Fix/Workaround

- 3. Frame Synchro and Frame Synchro Data are delayed by one clock cycle. The frame synchro and the frame synchro data are delayed from 1 SSC CLOCK when: Clock is CKDIV The START is selected on either a frame synchro edge or a level, Frame synchro data is enabled, Transmit clock is gated on output (through CKO field). Fix/Workaround Transmit or receive CLOCK must not be gated (by the mean of CKO field) when START condition is performed on a generated frame synchro. 12.1.1.5 USB

TCMR.START = Receive start RFMR.FSOS = None (Input)

RCMR.START = any on RF (edge/level)

1. For isochronous pipe, the INTFRQ is irrelevant IN and OUT tokens are sent every 1 ms (Full Speed). Fix/Workaround

For longer polling time, the software must freeze the pipe for the desired period in order to prevent any "extra" token.

- 12.1.1.6 ADC
- Sleep Mode activation needs additional A to D conversion 1.

If the ADC sleep mode is activated when the ADC is idle the ADC will not enter sleep mode before after the next AD conversion.

Fix/Workaround

Activate the sleep mode in the mode register and then perform an AD conversion.

12.1.1.7 PDCA



Wrong PDCA behavior when using two PDCA channels with the same PID Wrong PDCA behavior when using two PDCA channels with the same PID. Fix/Workaround



The same PID should not be assigned to more than one channel.

#### 2. Transfer error will stall a transmit peripheral handshake interface

If a tranfer error is encountered on a channel transmitting to a peripheral, the peripheral handshake of the active channel will stall and the PDCA will not do any more transfers on the affected peripheral handshake interface.

Disable and then enable the peripheral after the transfer error.



1. The TWI RXRDY flag in SR register is not reset when a software reset is performed The TWI RXRDY flag in SR register is not reset when a software reset is performed. Fix/Workaround

After a Software Reset, the register TWI RHR must be read.

#### 2. TWI in master mode will continue to read data

TWI in master mode will continue to read data on the line even if the shift register and the RHR register are full. This will generate an overrun error. **Fix/workaround** 


To prevent this, read the RHR register as soon as a new RX data is ready.

3. TWI slave behaves improperly if master acknowledges the last transmitted data byte before a STOP condition

In I2C slave transmitter mode, if the master acknowledges the last data byte before a STOP condition (what the master is not supposed to do), the following TWI slave receiver mode frame may contain an inappropriate clock stretch. This clock stretch can only be stopped by resetting the TWI.

#### Fix/Workaround

If the TWI is used as a slave transmitter with a master that acknowledges the last data byte before a STOP condition, it is necessary to reset the TWI beforeentering slave receiver mode.



LDM instruction with PC in the register list and without ++ increments Rp
For LDM with PC in the register list: the instruction behaves as if the ++ field is always set, ie
the pointer is always updated. This happens even if the ++ field is cleared. Specifically, the

increment of the pointer is done in parallel with the testing of R12. Fix/Workaround None.

- 2. RETE instruction does not clear SREG[L] from interrupts The RETE instruction clears SREG[L] as expected from exceptions. Fix/Workaround When using the STCOND instruction, clear SREG[L] in the stacked value of SR before returning from interrupts with RETE.
- 3. Privilege violation when using interrupts in application mode with protected system stack



If the system stack is protected by the MPU and an interrupt occurs in application mode, an MPU DTLB exception will occur. **Fix/Workaround** 



Make a DTLB Protection (Write) exception handler which permits the interrupt request to be handled in privileged mode.

12.1.1.10 USART

- 1. ISO7816 info register US_NER cannot be read The NER register always returns zero. Fix/Workaround None.
- ISO7816 Mode T1: RX impossible after any TX RX impossible after any TX.
   Fix/Workaround
   SOFT_RESET on RX+ Config US_MR + Config_US_CR
- 3. The RTS output does not function correctly in hardware handshaking mode The RTS signal is not generated properly when the USART receives data in hardware handshaking mode. When the Peripheral DMA receive buffer becomes full, the RTS output should go high, but it will stay low.

# Fix/Workaround

Do not use the hardware handshaking mode of the USART. If it is necessary to drive the RTS output high when the Peripheral DMA receive buffer becomes full, use the normal mode of the USART. Configure the Peripheral DMA Controller to signal an interrupt when the receive buffer is full. In the interrupt handler code, write a one to the RTSDIS bit in the USART Control Register (CR). This will drive the RTS output high. After the next DMA transfer is started and a receive buffer is available, write a one to the RTSEN bit in the USART CR so that RTS will be driven low.

4. Corruption after receiving too many bits in SPI slave mode

If the USART is in SPI slave mode and receives too much data bits (ex: 9bitsinstead of 8 bits) by the the SPI master, an error occurs . After that, the next reception may be corrupted even if the frame is correct and the USART has been disabled, reseted by a soft reset and re-enabled.

Fix/Workaround None.

5. USART slave synchronous mode external clock must be at least 9 times lower in frequency than CLK_USART

When the USART is operating in slave synchronous mode with an external clock, the frequency of the signal provided on CLK must be at least 9 times lower than CLK_USART. **Fix/Workaround** 

When the USART is operating in slave synchronous mode with an external clock, provide a signal on CLK that has a frequency at least 9 times lower than CLK_USART.

```
12.1.1.11 HMATRIX
```

In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits
 In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits wide, instead of
 four bits. The unused bits are undefined when reading the registers.
 Fix/Workaround

Mask undefined bits when reading PRAS and PRBS.









 Instruction breakpoints affected on all MAC instruction Hardware breakpoints on MAC instructions may corrupt the destination register of the MAC instruction.
 Fix/Workaround

df

zsc.com

Place breakpoints on earlier or later instructions.

#### 查询AT32UC3B1512供应商 .1.2 Rev C

# 12.1.2 Rev

12.1.2.1 PWM



1. PWM channel interrupt enabling triggers an interrupt

When enabling a PWM channel that is configured with center aligned period (CALG=1), an interrupt is signalled.

# Fix/Workaround

When using center aligned mode, enable the channel and read the status before channel interrupt is enabled.

#### 2. PWM counter restarts at 0x0001

The PWM counter restarts at 0x0001 and not 0x0000 as specified. Because of this the first PWM period has one more clock cycle.

#### Fix/Workaround

- The first period is 0x0000, 0x0001, ..., period
- Consecutive periods are 0x0001, 0x0002, ..., period

#### 3. PWM update period to a 0 value does not work

It is impossible to update a period equal to 0 by the using the PWM update register (PWM_CUPD).

#### Fix/Workaround

Do not update the PWM_CUPD register with a value equal to 0.



#### 1. SPI Slave / PDCA transfer: no TX UNDERRUN flag

There is no TX UNDERRUN flag available, therefore in SPI slave mode, there is no way to be informed of a character lost in transmission. **Fix/Workaround** 

#### Fix/Workaround

For PDCA transfer: none.

2. SPI Bad Serial Clock Generation on 2nd chip_select when SCBR = 1, CPOL=1 and NCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an aditional pulse will be generated on SCK. **Fix/workaround** 

When multiple CS are in use, if one of the baudrate equals 1, the other must also equal 1 if CPOL=1 and CPHA=0.

# 3. SPI Glitch on RXREADY flag in slave mode when enabling the SPI or during the first transfer

In slave mode, the SPI can generate a false RXREADY signal during enabling of the SPI or during the first transfer.

# Fix/Workaround

- 1. Set slave mode, set required CPOL/CPHA.
- 2. Enable SPI.
- 3. Set the polarity CPOL of the line in the opposite value of the required one.
- 4. Set the polarity CPOL to the required one.
- 5. Read the RXHOLDING register.

Transfers can now befin and RXREADY will now behave as expected.

4. SPI Disable does not work in Slave mode





SPI Disable does not work in Slave mode. Fix/workaround

Read the last received data then perform a Software reset.

#### 5. Module hangs when CSAAT=1 on CS0

SPI data transfer hangs with CSAAT=1 in CSR0 and MODFDIS=0 in MR. When CSAAT=1 in CSR0 and mode fault detection is enabled (MODFDIS=0 in MR), the SPI module will not start a data transfer.

#### Fix/Workaround

Disable mode fault detection by writing a one to MODFDIS in MR.

#### 6. Disabling SPI has no effect on flag TDRE flag

Disabling SPI has no effect on TDRE whereas the write data command is filtered when SPI is disabled. This means that as soon as the SPI is disabled it becomes impossible to reset the TDRE flag by writing in the TDR. So if the SPI is disabled during a PDCA transfer, the PDCA will continue to write data in the TDR (as TDRE stays high) until its buffer is empty, and all data written after the disable command is lost.

Disable the PDCA, 2 NOP (minimum), disable SPI. When you want to continue the transfer: Enable SPI, enable PDCA.

#### 12.1.2.3 Power Manager

1. If the BOD level is higher than VDDCORE, the part is constantly under reset If the BOD level is set to a value higher than VDDCORE and enabled by fuses, the part will be in constant reset.

#### Fix/Workaround

Apply an external voltage on VDDCORE that is higher than the BOD level and is lower than VDDCORE max and disable the BOD.

- 2. When the main clock is RCSYS, TIMER_CLOCK5 is equal to PBA clock When the main clock is generated from RCSYS, TIMER_CLOCK5 is equal to PBA Clock and not PBA Clock / 128. Fix/workaround:
  - None.
- 3. VDDCORE power supply input needs to be 1.95V When used in dual power supply, VDDCORE needs to be 1.95V. Fix/workaround:

When used in single power supply, VDDCORE needs to be connected to VDDOUT, which is configured on revision C at 1.95V (typ.).

4. Clock sources will not be stopped in STATIC sleep mode if the difference between CPU and PBx division factor is too big

If the division factor between the CPU/HSB and PBx frequencies is more than 4 when going to a sleep mode where the system RC oscillator is turned off, then high speed clock sources will not be turned off. This will result in a significantly higher power consumption during the sleep mode.

#### Fix/Workaround

Before going to sleep modes where the system RC oscillator is stopped, make sure that the factor between the CPU/HSB and PBx frequencies is less than or equal to 4.

5. Increased Power Consunption in VDDIO in sleep modes





If the OSC0 is enabled in crystal mode when entering a sleep mode where the OSC0 is disabled, this will lead to an increased power consumption in VDDIO. Fix/Workaround

Disable the OSC0 through the Power Manager (PM) before going to any sleep mode where the OSC0 is disabled, or pull down or up XIN0 and XOUT0 with 1Mohm resistor.

#### 12.1.2.4 SSC



- 1. Additional delay on TD output A delay from 2 to 3 system clock cycles is added to TD output when: TCMR.START = Receive Start, TCMR.STTDLY = more than ZERO. RCMR.START = Start on falling edge / Start on Rising edge / Start on any edge, RFMR.FSOS = None (input). Fix/Workaround None.
- 2. TF output is not correct

TF output is not correct (at least emitted one serial clock cycle later than expected) when: TFMR.FSOS = Driven Low during data transfer/ Driven High during data transfer TCMR.START = Receive start RFMR.FSOS = None (Input)

RCMR.START = any on RF (edge/level) Fix/Workaround

- None.
- 3. Frame Synchro and Frame Synchro Data are delayed by one clock cycle.

The frame synchro and the frame synchro data are delayed from 1 SSC CLOCK when: Clock is CKDIV

The START is selected on either a frame synchro edge or a level, Frame synchro data is enabled,

Transmit clock is gated on output (through CKO field).

#### Fix/Workaround

Transmit or receive CLOCK must not be gated (by the mean of CKO field) when START con-DZSC.COM dition is performed on a generated frame synchro.

```
12.1.2.5
             USB
```



1. For isochronous pipe, the INTFRQ is irrelevant IN and OUT tokens are sent every 1 ms (Full Speed). Fix/Workaround

For longer polling time, the software must freeze the pipe for the desired period in order to prevent any "extra" token.

1. Sleep Mode activation needs additional A to D conversion If the ADC sleep mode is activated when the ADC is idle the ADC will not enter sleep mode before after the next AD conversion. Fix/Workaround

Activate the sleep mode in the mode register and then perform an AD conversion.

- 12.1.2.7 PDCA
- 1. Wrong PDCA behavior when using two PDCA channels with the same PID



Wrong PDCA behavior when using two PDCA channels with the same PID. Fix/Workaround

The same PID should not be assigned to more than one channel.

2. Transfer error will stall a transmit peripheral handshake interface

If a tranfer error is encountered on a channel transmitting to a peripheral, the peripheral handshake of the active channel will stall and the PDCA will not do any more transfers on the affected peripheral handshake interface.

### Fix/workaround:

Disable and then enable the peripheral after the transfer error.

1. The TWI RXRDY flag in SR register is not reset when a software reset is performed The TWI RXRDY flag in SR register is not reset when a software reset is performed. Fix/Workaround

After a Software Reset, the register TWI RHR must be read.

#### 2. TWI in master mode will continue to read data

TWI in master mode will continue to read data on the line even if the shift register and the RHR register are full. This will generate an overrun error.

# Fix/workaround

To prevent this, read the RHR register as soon as a new RX data is ready.

3. TWI slave behaves improperly if master acknowledges the last transmitted data byte before a STOP condition

In I2C slave transmitter mode, if the master acknowledges the last data byte before a STOP condition (what the master is not supposed to do), the following TWI slave receiver mode frame may contain an inappropriate clock stretch. This clock stretch can only be stopped by resetting the TWI.

## Fix/Workaround

If the TWI is used as a slave transmitter with a master that acknowledges the last data byte before a STOP condition, it is necessary to reset the TWI beforeentering slave receiver mode.

#### 12.1.2.9 Processor and Architecture

1. LDM instruction with PC in the register list and without ++ increments Rp

For LDM with PC in the register list: the instruction behaves as if the ++ field is always set, ie the pointer is always updated. This happens even if the ++ field is cleared. Specifically, the increment of the pointer is done in parallel with the testing of R12. Fix/Workaround

None.

2. RETE instruction does not clear SREG[L] from interrupts The RETE instruction clears SREG[L] as expected from exceptions.

**Fix/Workaround** 

When using the STCOND instruction, clear SREG[L] in the stacked value of SR before returning from interrupts with RETE.

- Privilege violation when using interrupts in application mode with protected system stack

If the system stack is protected by the MPU and an interrupt occurs in application mode, an MPU DTLB exception will occur.





TW

12.1.2.8





#### Fix/Workaround

Make a DTLB Protection (Write) exception handler which permits the interrupt request to be handled in privileged mode.

12.1.2.10 Flash

12.1.2.11

1. Reset vector is 80000020h rather than 80000000h Reset vector is 80000020h rather than 80000000h. Fix/Workaround

The flash program code must start at the address 80000020h. The flash memory range 80000000h-80000020h must be programmed with 00000000h.

1. ISO7816 info register US_NER cannot be read The NER register always returns zero. Fix/Workaround None.



- ISO7816 Mode T1: RX impossible after any TX RX impossible after any TX.
   Fix/Workaround
   SOFT_RESET on RX+ Config US_MR + Config_US_CR
- 3. The RTS output does not function correctly in hardware handshaking mode The RTS signal is not generated properly when the USART receives data in hardware handshaking mode. When the Peripheral DMA receive buffer becomes full, the RTS output should go high, but it will stay low.

Fix/Workaround

Do not use the hardware handshaking mode of the USART. If it is necessary to drive the RTS output high when the Peripheral DMA receive buffer becomes full, use the normal mode of the USART. Configure the Peripheral DMA Controller to signal an interrupt when the receive buffer is full. In the interrupt handler code, write a one to the RTSDIS bit in the USART Control Register (CR). This will drive the RTS output high. After the next DMA transfer is started and a receive buffer is available, write a one to the RTSEN bit in the USART CR so that RTS will be driven low.

### 4. Corruption after receiving too many bits in SPI slave mode

If the USART is in SPI slave mode and receives too much data bits (ex: 9bitsinstead of 8 bits) by the the SPI master, an error occurs . After that, the next reception may be corrupted even if the frame is correct and the USART has been disabled, reseted by a soft reset and re-enabled.

# Fix/Workaround None.

5. USART slave synchronous mode external clock must be at least 9 times lower in frequency than CLK_USART

When the USART is operating in slave synchronous mode with an external clock, the frequency of the signal provided on CLK must be at least 9 times lower than CLK_USART. **Fix/Workaround** 

When the USART is operating in slave synchronous mode with an external clock, provide a signal on CLK that has a frequency at least 9 times lower than CLK_USART.





USART





#### 查询AT32UC3B1512供应商 12.1.2.12 HMATRIX

1. In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits wide, instead of four bits. The unused bits are undefined when reading the registers. Fix/Workaround

Mask undefined bits when reading PRAS and PRBS.

#### 12.1.2.13 DSP Operations

# Instruction breakpoints affected on all MAC instruction Hardware breakpoints on MAC instructions may corrupt the destination register of the MAC instruction. Fix/Workaround

Place breakpoints on earlier or later instructions.

# 12.2 AT32UC3B0256, AT32UC3B0128, AT32UC3B064, AT32UC3B1256, AT32UC3B1128, AT32UC3B164

All industrial parts labelled with -UES (for engineering samples) are revision B parts.

#### 12.2.1 Rev. G

12.2.1.1 PWM

#### 1. PWM channel interrupt enabling triggers an interrupt When enabling a PWM channel that is configured with center aligned period (CALG=1), an

interrupt is signalled.

Fix/Workaround

When using center aligned mode, enable the channel and read the status before channel interrupt is enabled.

#### 2. PWM counter restarts at 0x0001

The PWM counter restarts at 0x0001 and not 0x0000 as specified. Because of this the first PWM period has one more clock cycle.

#### Fix/Workaround

- The first period is 0x0000, 0x0001, ..., period
- Consecutive periods are 0x0001, 0x0002, ..., period

#### 3. PWM update period to a 0 value does not work

It is impossible to update a period equal to 0 by the using the PWM update register (PWM_CUPD).

#### Fix/Workaround

Do not update the PWM_CUPD register with a value equal to 0.

### 12.2.1<mark>.2</mark> SP

#### 1. SPI Slave / PDCA transfer: no TX UNDERRUN flag

There is no TX UNDERRUN flag available, therefore in SPI slave mode, there is no way to be informed of a character lost in transmission. **Fix/Workaround** 

For PDCA transfer: none.

2. SPI Bad Serial Clock Generation on 2nd chip_select when SCBR = 1, CPOL=1 and NCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an aditional pulse will be generated on SCK. **Fix/workaround** 

When multiple CS are in use, if one of the baudrate equals 1, the other must also equal 1 if CPOL=1 and CPHA=0.

3. SPI Glitch on RXREADY flag in slave mode when enabling the SPI or during the first transfer

In slave mode, the SPI can generate a false RXREADY signal during enabling of the SPI or during the first transfer.

#### Fix/Workaround

1. Set slave mode, set required CPOL/CPHA.

2. Enable SPI.



- 3. Set the polarity CPOL of the line in the opposite value of the required one.
- 4. Set the polarity CPOL to the required one.
- 5. Read the RXHOLDING register.

Transfers can now befin and RXREADY will now behave as expected.

#### 4. SPI Disable does not work in Slave mode

SPI Disable does not work in Slave mode. Fix/workaround

Read the last received data then perform a Software reset.

#### 5. Disabling SPI has no effect on flag TDRE flag

Disabling SPI has no effect on TDRE whereas the write data command is filtered when SPI is disabled. This means that as soon as the SPI is disabled it becomes impossible to reset the TDRE flag by writing in the TDR. So if the SPI is disabled during a PDCA transfer, the PDCA will continue to write data in the TDR (as TDRE stays high) until its buffer is empty, and all data written after the disable command is lost.

Disable the PDCA, 2 NOP (minimum), disable SPI. When you want to continue the transfer: Enable SPI, enable PDCA.

#### 12.2.1.3 Power Manager

1. If the BOD level is higher than VDDCORE, the part is constantly under reset If the BOD level is set to a value higher than VDDCORE and enabled by fuses, the part will be in constant reset.

Fix/Workaround

Apply an external voltage on VDDCORE that is higher than the BOD level and is lower than VDDCORE max and disable the BOD.

2. When the main clock is RCSYS, TIMER_CLOCK5 is equal to PBA clock When the main clock is generated from RCSYS, TIMER_CLOCK5 is equal to PBA Clock and not PBA Clock / 128. Fix/workaround:

None.

3. Clock sources will not be stopped in STATIC sleep mode if the difference between CPU and PBx division factor is too big

If the division factor between the CPU/HSB and PBx frequencies is more than 4 when going to a sleep mode where the system RC oscillator is turned off, then high speed clock sources will not be turned off. This will result in a significantly higher power consumption during the sleep mode.

#### Fix/Workaround

Before going to sleep modes where the system RC oscillator is stopped, make sure that the factor between the CPU/HSB and PBx frequencies is less than or equal to 4.

#### 4. Increased Power Consunption in VDDIO in sleep modes

If the OSC0 is enabled in crystal mode when entering a sleep mode where the OSC0 is disabled, this will lead to an increased power consumption in VDDIO. **Fix/Workaround** 

Disable the OSC0 through the Power Manager (PM) before going to any sleep mode where the OSC0 is disabled, or pull down or up XIN0 and XOUT0 with 1Mohm resistor.



1. Frame Synchro and Frame Synchro Data are delayed by one clock cycle.






The frame synchro	and the frame synchro data are delayed from 1 SSC_CLOCK wher	n:
Clock is CKDIV		

The START is selected on either a frame synchro edge or a level, Frame synchro data is enabled,

Transmit clock is gated on output (through CKO field).

#### Fix/Workaround

Transmit or receive CLOCK must not be gated (by the mean of CKO field) when START condition is performed on a generated frame synchro.

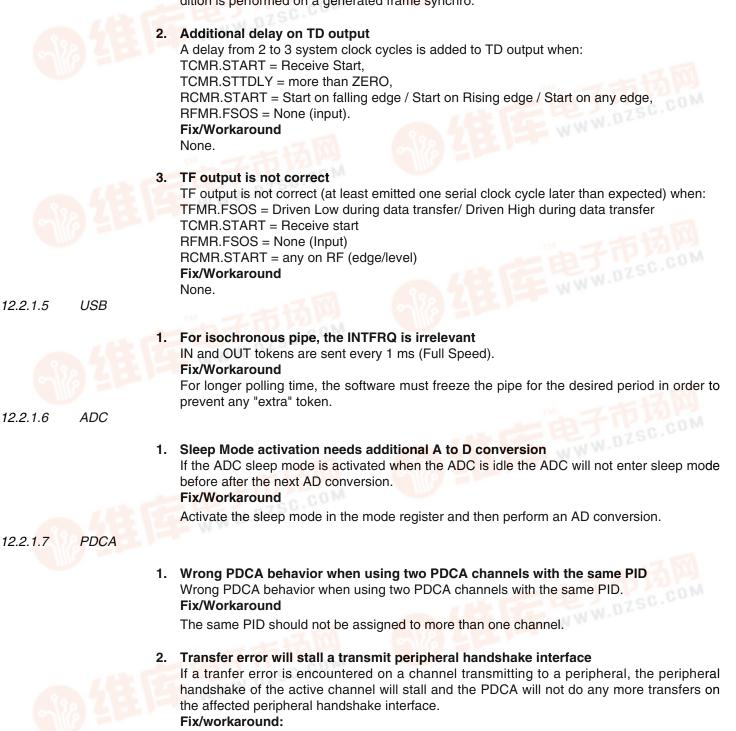



Disable and then enable the peripheral after the transfer error.

#### 12.2.1.8 TWI

1. The TWI RXRDY flag in SR register is not reset when a software reset is performed The TWI RXRDY flag in SR register is not reset when a software reset is performed. Fix/Workaround

After a Software Reset, the register TWI RHR must be read.

#### 2. TWI in master mode will continue to read data

TWI in master mode will continue to read data on the line even if the shift register and the RHR register are full. This will generate an overrun error.

#### Fix/workaround

To prevent this, read the RHR register as soon as a new RX data is ready.

3. TWI slave behaves improperly if master acknowledges the last transmitted data byte before a STOP condition

In I2C slave transmitter mode, if the master acknowledges the last data byte before a STOP condition (what the master is not supposed to do), the following TWI slave receiver mode frame may contain an inappropriate clock stretch. This clock stretch can only be stopped by resetting the TWI.

#### Fix/Workaround

If the TWI is used as a slave transmitter with a master that acknowledges the last data byte before a STOP condition, it is necessary to reset the TWI beforeentering slave receiver mode.

1. PA29 (TWI SDA) and PA30 (TWI SCL) GPIO VIH (input high voltage) is 3.6V max instead of 5V tolerant

The following GPIOs are not 5V tolerant : PA29 and PA30. Fix/Workaround None.

 The auxiliary trace does not work for CPU/HSB speed higher than 50MHz. The auxiliary trace does not work for CPU/HSB speed higher than 50MHz. Workaround:

Do not use the auxiliary trace for CPU/HSB speed higher than 50MHz.

#### 12.2.1.11 Processor and Architecture

- LDM instruction with PC in the register list and without ++ increments Rp For LDM with PC in the register list: the instruction behaves as if the ++ field is always set, ie the pointer is always updated. This happens even if the ++ field is cleared. Specifically, the increment of the pointer is done in parallel with the testing of R12. Fix/Workaround None.
  - 2. RETE instruction does not clear SREG[L] from interrupts The RETE instruction clears SREG[L] as expected from exceptions. Fix/Workaround When using the STCOND instruction, clear SREG[L] in the stacked value of SR before

returning from interrupts with RETE.





```
12.2.1.9 GPIO
```

12.2.1.10 OCD

#### 3. Exceptions when system stack is protected by MPU

RETS behaves incorrectly when MPU is enabled and MPU is configured so thatsystem stack is not readable in unprivileged mode.

#### Fix/Workaround

Workaround 1: Make system stack readable in unprivileged mode, or

Workaround 2: Return from supervisor mode using rete instead of rets. This requires: 1. Changing the mode bits from 001b to 110b before issuing the instruction.

Updating the mode bits to the desired value must be done using a single mtsr instruction so it is done atomically. Even if this step is described in general as not safe in the UC technical reference guide, it is safe in this very specific case.

2. Execute the RETE instruction.

4. Privilege violation when using interrupts in application mode with protected system stack

If the system stack is protected by the MPU and an interrupt occurs in application mode, an MPU DTLB exception will occur.

#### Fix/Workaround

Make a DTLB Protection (Write) exception handler which permits the interrupt request to be handled in privileged mode.

- ISO7816 info register US_NER cannot be read The NER register always returns zero. Fix/Workaround
  - None.
- 2. ISO7816 Mode T1: RX impossible after any TX RX impossible after any TX. Fix/Workaround SOFT RESET on RX+ Config US MR + Config US CR
- 3. The RTS output does not function correctly in hardware handshaking mode

The RTS signal is not generated properly when the USART receives data in hardware handshaking mode. When the Peripheral DMA receive buffer becomes full, the RTS output should go high, but it will stay low.

#### Fix/Workaround

Do not use the hardware handshaking mode of the USART. If it is necessary to drive the RTS output high when the Peripheral DMA receive buffer becomes full, use the normal mode of the USART. Configure the Peripheral DMA Controller to signal an interrupt when the receive buffer is full. In the interrupt handler code, write a one to the RTSDIS bit in the USART Control Register (CR). This will drive the RTS output high. After the next DMA transfer is started and a receive buffer is available, write a one to the RTSEN bit in the USART CR so that RTS will be driven low.

#### 4. Corruption after receiving too many bits in SPI slave mode

If the USART is in SPI slave mode and receives too much data bits (ex: 9bitsinstead of 8 bits) by the the SPI master, an error occurs. After that, the next reception may be corrupted even if the frame is correct and the USART has been disabled, reseted by a soft reset and re-enabled.

# Fix/Workaround None.





USART



12.2.1.12





#### 5. USART slave synchronous mode external clock must be at least 9 times lower in frequency than CLK_USART

When the USART is operating in slave synchronous mode with an external clock, the frequency of the signal provided on CLK must be at least 9 times lower than CLK_USART. **Fix/Workaround** 

When the USART is operating in slave synchronous mode with an external clock, provide a signal on CLK that has a frequency at least 9 times lower than CLK_USART.

12.2.1.13 HMATRIX



In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits
 In the HMATRIX PRAS and PRBS registers MxPR fields are only two bits wide, instead of
 four bits. The unused bits are undefined when reading the registers.
 Fix/Workaround

Mask undefined bits when reading PRAS and PRBS.

#### 12.2.1.14 DSP Operations

1. Instruction breakpoints affected on all MAC instruction

Hardware breakpoints on MAC instructions may corrupt the destination register of the MAC instruction. **Fix/Workaround** Place breakpoints on earlier or later instructions.







#### 查询AT32UC3B1512供应商 **2.2 Rev. F**

### 12.2.2 Rev.

12.2.2.1 PWM



1. PWM channel interrupt enabling triggers an interrupt

When enabling a PWM channel that is configured with center aligned period (CALG=1), an interrupt is signalled.

### Fix/Workaround

When using center aligned mode, enable the channel and read the status before channel interrupt is enabled.

#### 2. PWN counter restarts at 0x0001

The PWM counter restarts at 0x0001 and not 0x0000 as specified. Because of this the first PWM period has one more clock cycle.

#### Fix/Workaround

- The first period is 0x0000, 0x0001, ..., period
- Consecutive periods are 0x0001, 0x0002, ..., period

#### 3. PWM update period to a 0 value does not work

1. SPI Slave / PDCA transfer: no TX UNDERRUN flag

be informed of a character lost in transmission.

It is impossible to update a period equal to 0 by the using the PWM update register (PWM_CUPD).

There is no TX UNDERRUN flag available, therefore in SPI slave mode, there is no way to

#### Fix/Workaround

Fix/Workaround

For PDCA transfer: none.

Do not update the PWM_CUPD register with a value equal to 0.



2.2.2.2 011

- C III
- SPI disable does not work in SLAVE mode SPI disable does not work in SLAVE mode.
   Fix/Workaround Read the last received data, then perform a Software Reset.
- 3. SPI Bad Serial Clock Generation on 2nd chip_select when SCBR = 1, CPOL=1 and NCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an aditional pulse will be generated on SCK. **Fix/workaround** 

When multiple CS are in use, if one of the baudrate equals 1, the other must also equal 1 if CPOL=1 and CPHA=0.

4. SPI Glitch on RXREADY flag in slave mode when enabling the SPI or during the first transfer

In slave mode, the SPI can generate a false RXREADY signal during enabling of the SPI or during the first transfer.

Fix/Workaround

- 1. Set slave mode, set required CPOL/CPHA.
- 2. Enable SPI.
- 3. Set the polarity CPOL of the line in the opposite value of the required one.



- 4. Set the polarity CPOL to the required one.
- 5. Read the RXHOLDING register.
- Transfers can now befin and RXREADY will now behave as expected.

#### 12.2.2.3 Power Manager

- 1. If the BOD level is higher than VDDCORE, the part is constantly resetted
  - If the BOD level is set to a value higher than VDDCORE and enabled by fuses, the part will be in constant reset.

#### Fix/Workaround

Apply an external voltage on VDDCORE that is higher than the BOD level and is lower than VDDCORE max and disable the BOD.

12.2.2.4 ADC

Sleep Mode activation needs additionnal A to D conversion
 If the ADC sleep mode is activated when the ADC is idle the ADC will not enter sleep mode
 before after the next AD conversion.
 Fix/Workaround

Activate the sleep mode in the mode register and then perform an AD conversion.

#### 12.2.2.5 Processor and Architecture

 LDM instruction with PC in the register list and without ++ increments Rp For LDM with PC in the register list: the instruction behaves as if the ++ field is always set, ie the pointer is always updated. This happens even if the ++ field is cleared. Specifically, the increment of the pointer is done in parallel with the testing of R12. Fix/Workaround None.



#### 2. RETE instruction does not clear SREG[L] from interrupts The RETE instruction clears SREG[L] as expected from exceptions. Fix/Workaround

When using the STCOND instruction, clear SREG[L] in the stacked value of SR before returning from interrupts with RETE.

#### 3. Exceptions when system stack is protected by MPU

RETS behaves incorrectly when MPU is enabled and MPU is configured so thatsystem stack is not readable in unprivileged mode.

#### Fix/Workaround

Workaround 1: Make system stack readable in unprivileged mode, or

Workaround 2: Return from supervisor mode using rete instead of rets. This requires: 1. Changing the mode bits from 001b to 110b before issuing the instruction.

Updating the mode bits to the desired value must be done using a single mtsr instruction so it is done atomically. Even if this step is described in general as not safe in the UC technical reference guide, it is safe in this very specific case.

2. Execute the RETE instruction.



#### 查询AT32UC3B1512供应商 .2.3 Bev. B

### 12.2.3 Rev. E

#### 12.2.3.1 PWM



#### 1. PWM counter restarts at 0x0001

The PWM counter restarts at 0x0001 and not 0x0000 as specified. Because of this the first PWM period has one more clock cycle.

- The first period is 0x0000, 0x0001, ..., period
- Consecutive periods are 0x0001, 0x0002, ..., period

#### 2. PWM channel interrupt enabling triggers an interrupt

When enabling a PWM channel that is configured with center aligned period (CALG=1), an interrupt is signalled.

#### Fix/Workaround

When using center aligned mode, enable the channel and read the status before channel interrupt is enabled.

#### **3. PWM update period to a 0 value does not work**

It is impossible to update a period equal to 0 by the using the PWM update register (PWM_CUPD).

#### Fix/Workaround

Do not update the PWM_CUPD register with a value equal to 0.

#### 4. PWM channel status may be wrong if disabled before a period has elapsed

Before a PWM period has elapsed, the read channel status may be wrong. The CHIDx-bit for a PWM channel in the PWM Enable Register will read '1' for one full PWM period even if the channel was disabled before the period elapsed. It will then read '0' as expected. **Fix/Workaround** 

Reading the PWM channel status of a disabled channel is only correct after a PWM period has elapsed.

5. The following alternate C functions PWM[4] on PA16 and PWM[6] on PA31 are not available on Rev B

The following alternate C functions PWM[4] on PA16 and PWM[6] on PA31 are not available on Rev B.

#### Fix/Workaround

Do not use these PWM alternate functions on these pins.

12.2.3<mark>.2</mark> SP

#### 1. SPI Slave / PDCA transfer: no TX UNDERRUN flag

There is no TX UNDERRUN flag available, therefore in SPI slave mode, there is no way to be informed of a character lost in transmission. **Fix/Workaround** 

For PDCA transfer: none.

2. SPI Bad serial clock generation on 2nd chip select when SCBR=1, CPOL=1 and CNCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an additional pulse will be generated on SCK.





#### Fix/Workaround

When multiple CS are in use, if one of the baudrate equals to 1, the other must also equal 1 if CPOL=1 and CPHA=0.

3. SPI Glitch on RXREADY flag in slave mode when enabling the SPI or during the first transfer

In slave mode, the SPI can generate a false RXREADY signal during enabling of the SPI or during the first transfer.

#### Fix/Workaround

- 1. Set slave mode, set required CPOL/CPHA.
- 2. Enable SPI.
- 3. Set the polarity CPOL of the line in the opposite value of the required one.
- 4. Set the polarity CPOL to the required one.
- 5. Read the RXHOLDING register.

Transfers can now befin and RXREADY will now behave as expected.

### 4. SPI CSNAAT bit 2 in register CSR0...CSR3 is not available

SPI CSNAAT bit 2 in register CSR0...CSR3 is not available. Fix/Workaround

- Do not use this bit.
- SPI disable does not work in SLAVE mode
   SPI disable does not work in SLAVE mode.
   Fix/Workaround
   Read the last received data, then perform a Software Reset.
- 6. SPI Bad Serial Clock Generation on 2nd chip_select when SCBR = 1, CPOL=1 and NCPHA=0

When multiple CS are in use, if one of the baudrate equals to 1 and one of the others doesn't equal to 1, and CPOL=1 and CPHA=0, then an aditional pulse will be generated on SCK. **Fix/workaround** 

When multiple CS are in use, if one of the baudrate equals 1, the other must also equal 1 if CPOL=1 and CPHA=0.

#### 12.2.3.3 Power Manager

#### 1. PLL Lock control does not work PLL lock Control does not work. Fix/Workaround

In PLL Control register, the bit 7 should be set in order to prevent unexpected behaviour.

#### 2. Wrong reset causes when BOD is activated

Setting the BOD enable fuse will cause the Reset Cause Register to list BOD reset as the reset source even though the part was reset by another source. **Fix/Workaround** 

Do not set the BOD enable fuse, but activate the BOD as soon as your program starts.

### 3. System Timer mask (Bit 16) of the PM CPUMASK register is not available System Timer mask (Bit 16) of the PM CPUMASK register is not available. Fix/Workaround

Do not use this bit.









 SSC does not trigger RF when data is low The SSC cannot transmit or receive data when CKS = CKDIV and CKO = none, in TCMR or RCMR respectively.
 Fix/Workaround

Set CKO to a value that is not "none" and bypass the output of the TK/RK pin with the GPIO.

#### 1. USB No end of host reset signaled upon disconnection

USBFSM and UHADDR1/2/3 registers are not available

In host mode, in case of an unexpected device disconnection whereas a usb reset is being sent by the usb controller, the UHCON.RESET bit may not been cleared by the hardware at the end of the reset.

#### **Fix/Workaround**

**Fix/Workaround** 

Fix/Workaround

None.

Do not use USBFSM register.

stops, so does incrementing of COUNT.

A software workaround consists in testing (by polling or interrupt) the disconnection (UHINT.DDISCI == 1) while waiting for the end of reset (UHCON.RESET == 0) to avoid being stuck.


Do not use USBFSM register and use HCON[6:0] field instead for all the pipes.

1. CPU Cycle Counter does not reset the COUNT system register on COMPARE match. The device revision B does not reset the COUNT system register on COMPARE match. In this revision, the COUNT register is clocked by the CPU clock, so when the CPU clock

12.2.3.6 Cycle counter

- 12.2.3.7 ADC
- ADC 1. ADC possible miss on DRDY when disabling a channel The ADC does not work properly when more than one channel is enabled. Fix/Workaround Do not use the ADC with more than one channel enabled at a time. 2. ADC OVRE flag sometimes not reset on Status Register read The OVRE flag does not clear properly if read simultaneously to an end of conversion. Fix/Workaround None. 3. Sleep Mode activation needs addtionnal A to D conversion If the ADC sleep mode is activated when the ADC is idle the ADC will not enter sleep mode before after the next AD conversion. Fix/Workaround Activate the sleep mode in the mode register and then perform an AD conversion. 12.2.3.8 USART 1. USART Manchester Encoder Not Working
  - 找 PDF 维库—下 pdf.dzsc.com

Manchester encoding/decoding is not working. Fix/Workaround Do not use manchester encoding.

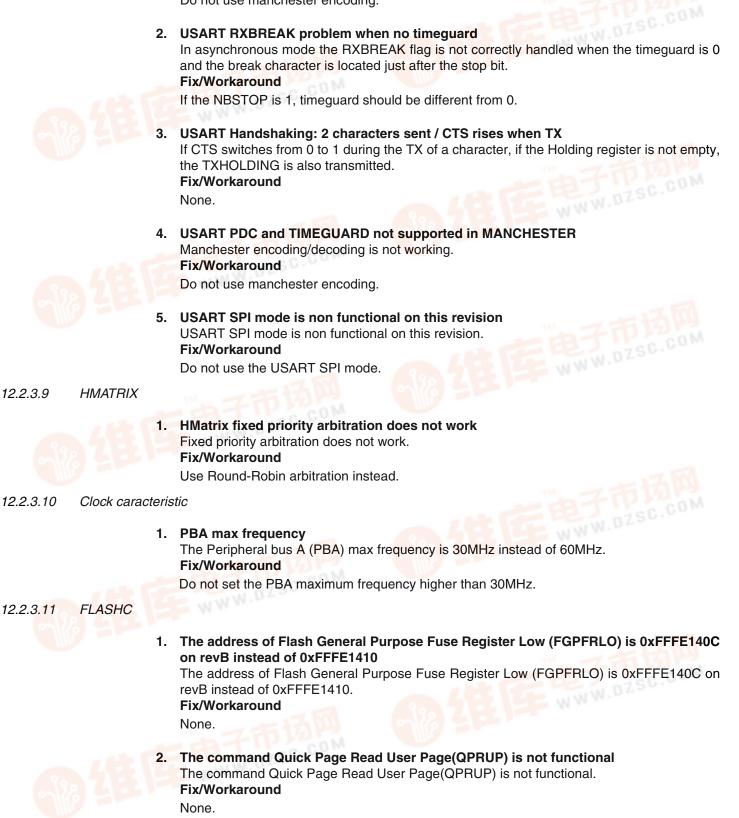



PAGEN Semantic Field for Program GP Fuse Byte is WriteData[7:0], ByteAddress[1:0] 3 on revision B instead of WriteData[7:0], ByteAddress[2:0]

PAGEN Semantic Field for Program GP Fuse Byte is WriteData[7:0], ByteAddress[1:0] on NWW.DZSC.COM revision B instead of WriteData[7:0], ByteAddress[2:0]. Fix/Workaround

None.

12.2.3.12 RTC



Writes to control (CTRL), top (TOP) and value (VAL) in the RTC are discarded if the RTC peripheral bus clock (PBA) is divided by a factor of four or more relative to the HSB clock

Writes to control (CTRL), top (TOP) and value (VAL) in the RTC are discarded if the RTC peripheral bus clock (PBA) is divided by a factor of four or more relative to the HSB clock. Fix/Workaround

Do not write to the RTC registers using the peripheral bus clock (PBA) divided by a factor of four or more relative to the HSB clock.

2. The RTC CLKEN bit (bit number 16) of CTRL register is not available The RTC CLKEN bit (bit number 16) of CTRL register is not available. **Fix/Workaround** Do not use the CLKEN bit of the RTC on Rev B.

12.2.3.13 OCD

- 1. Stalled memory access instruction writeback fails if followed by a HW breakpoint Consider the following assembly code sequence: А
  - В

If a hardware breakpoint is placed on instruction B, and instruction A is a memory access instruction, register file updates from instruction A can be discarded. Fix/Workaround

Do not place hardware breakpoints, use software breakpoints instead. Alternatively, place a hardware breakpoint on the instruction before the memory access instruction and then sin-WWW.DZSC.COM gle step over the memory access instruction.

#### 12.2.3.14 Processor and Architecture

- 1. Local Busto fast GPIO not available on silicon Rev B Local bus is only available for silicon RevE and later. Fix/Workaround Do not use if silicon revison older than F.
- 2. Memory Protection Unit (MPU) is non functional
- Memory Protection Unit (MPU) is non functional. **Fix/Workaround** Do not use the MPU.

3. Bus error should be masked in Debug mode

If a bus error occurs during debug mode, the processor will not respond to debug commands through the DINST register. **Fix/Workaround** 

A reset of the device will make the CPU respond to debug commands again.



Read Modify Write (RMW) instructions on data outside the internal RAM does not work

Read Modify Write (RMW) instructions on data outside the internal RAM does not work. DZSC.COM Fix/Workaround

Do not perform RMW instructions on data outside the internal RAM.

Need two NOPs instruction after instructions masking interrupts

The instructions following in the pipeline the instruction masking the interrupt through SR may behave abnormally.

#### Fix/Workaround

Place two NOPs instructions after each SSRF or MTSR instruction setting IxM or GM in SR

6. Clock connection table on Rev B

Here is the table of Rev B

Source	Name	Connection
Internal	TIMER_CLOCK1	32KHz Oscillator
	TIMER_CLOCK2	PBA Clock / 4
	TIMER_CLOCK3	PBA Clock / 8
	TIMER_CLOCK4	PBA Clock / 16
	TIMER_CLOCK5	PBA Clock / 32
External	XC0	(~)(B)
	XC1	
	XC2	

Figure 12-1. Timer/Counter clock connections on RevB

#### Spurious interrupt may corrupt core SR mode to exception 7.

If the rules listed in the chapter `Masking interrupt requests in peripheral modules' of the AVR32UC Technical Reference Manual are not followed, a spurious interrupt may occur. An interrupt context will be pushed onto the stack while the core SR mode will indicate an exception. A RETE instruction would then corrupt the stack. Fix/Workaround

Follow the rules of the AVR32UC Technical Reference Manual. To increase software robustness, if an exception mode is detected at the beginning of an interrupt handler, change the stack interrupt context to an exception context and issue a RETE instruction.

CPU cannot operate on a divided slow clock (internal RC oscillator) CPU cannot operate on a divided slow clock (internal RC oscillator). WW.DZSC.COM Fix/Workaround

Do not run the CPU on a divided slow clock.

9. LDM instruction with PC in the register list and without ++ increments Rp For LDM with PC in the register list: the instruction behaves as if the ++ field is always set, ie the pointer is always updated. This happens even if the ++ field is cleared. Specifically, the increment of the pointer is done in parallel with the testing of R12. Fix/Workaround None.





#### 10. RETE instruction does not clear SREG[L] from interrupts

The RETE instruction clears SREG[L] as expected from exceptions. **Fix/Workaround** 

When using the STCOND instruction, clear SREG[L] in the stacked value of SR before returning from interrupts with RETE.

#### 11. Exceptions when system stack is protected by MPU

RETS behaves incorrectly when MPU is enabled and MPU is configured so thatsystem stack is not readable in unprivileged mode.

#### Fix/Workaround

or

Workaround 1: Make system stack readable in unprivileged mode,

Workaround 2: Return from supervisor mode using rete instead of rets. This requires: 1. Changing the mode bits from 001b to 110b before issuing the instruction.

Updating the mode bits to the desired value must be done using a single mtsr instruction so it is done atomically. Even if this step is described in general as not safe in the UC technical reference guide, it is safe in this very specific case.

2. Execute the RETE instruction.





### **13. Datasheet Revision History**

2

1.

2

1.

2

1.

1.

Please note that the referring page numbers in this section are referred to this document. The referring revision in this section are referring to the document revision.

- 13.1 Rev. I 06/2010
- Updated SPI section.
- Updated Electrical Characteristics section.
- 13.2 Rev. H 10/2009
- Update datasheet architecture.

Add AT32UC3B0512 and AT32UC3B1512 devices description.

- 13.3 Rev. G 06/2009
- Open Drain Mode removed from GPIO section.
  - Updated Errata section.

### 13.4 Rev. F - 04/2008

- 1. Updated Errata section.
- 13.5 Rev. E 12/2007
- Updated Memory Protection section.
- 13.6 Rev. D 11/2007
- Updated Processor Architecture section.
- Updated Electrical Characteristics section.



#### 查询AT32UC3B1512供应商 13.7 **Rev. C – 10/2007**

3. 4.

5.

- 1. Updated Features sections.
- 2. Updated block diagram with local bus figure
  - Add schematic for HMatrix master/slave connection.
  - Updated Features sections with local bus.
  - Added SPI feature to USART section.
- 6. Updated USBB section.
- 7. Updated ADC trigger selection in ADC section.
- 8. Updated JTAG and Boundary Scan section with programming procedure.
- 9. Add description for silicon revision D

#### 13.8 Rev. B - 07/2007

- 1. Updated registered trademarks
- 2. Updated address page.

### 13.9 Rev. A - 05/2007

Initial revision.







## 查询AT32UC3B1512供应商 Table of Contents

1	Description	
2	Overview	4
	Overview	<b></b> .4
3	Configuration Summary	
	WW.DLSC	
16 4 - 4	Package and Pinout	
	4.1Package	
	4.2Peripheral Multiplexing on I/O lines	
	4.3High Drive Current GPIO	
5	Signals Description	
	5.1JTAG pins	13
	5.2RESET_N pin	14
	5.3TWI pins	
	5.4GPIO pins	
	5.5High drive pins	14
	5.6Power Considerations	
6	Processor and Architecture	
	6.1Features	17
	6.2AVR32 Architecture	17
	6.3The AVR32UC CPU	
	6.4Programming Model	
	6.5Exceptions and Interrupts	
	6.6Module Configuration	
7	Memories	
	7.1Embedded Memories	
	7.2Physical Memory Map	
	7.3Peripheral Address Map	
	7.4CPU Local Bus Mapping	
8	Boot Sequence	
	8.1 Starting of clocks	
	8.2Fetching of initial instructions	
9	Electrical Characteristics	
	9.1Absolute Maximum Ratings*	



JAI32UC3BI5	012(円)		
		9.2DC Characteristics	
		9.3Regulator Characteristics	
		9.4Analog Characteristics	
		9.5Power Consumption	
		9.6System Clock Characteristics	44
		9.7Oscillator Characteristics	45
		9.8ADC Characteristics	47
		9.9JTAG Characteristics	48
		9.10SPI Characteristics	
		9.11Flash Memory Characteristics	52
	10	Mechanical Characteristics	53
		10.1Thermal Considerations	53
		10.2Package Drawings	54
		10.3Soldering Profile	58
	11	Ordering Information	59
	12	Errata	60
		12.1AT32UC3B0512, AT32UC3B1512	60
		12.2AT32UC3B0256, AT32UC3B0128, AT32UC3B064, AT32UC3B1256, AT32UC3B1128, AT32UC3B164 72	
	13	Datasheet Revision History	
		13.1Rev. I – 06/2010	
		13.2Rev. H – 10/2009	
		13.3Rev. G – 06/2009	87
		13.4Rev. F – 04/2008	87
		13.5Rev. E – 12/2007	87
		13.6Rev. D – 11/2007	87
		13.7Rev. C – 10/2007	88
		13.8Rev. B – 07/2007	
		13.9Rev. A – 05/2007	88





#### Headquarters

Atmel Corporation 2325 Orchard Parkway San Jose, CA 95131 USA Tel: 1(408) 441-0311 Fax: 1(408) 487-2600

#### International

Atmel Asia Unit 1-5 & 16, 19/F BEA Tower, Millennium City 5 418 Kwun Tong Road Kwun Tong, Kowloon Hong Kong Tel: (852) 2245-6100 Fax: (852) 2722-1369 Atmel Europe Le Krebs 8, Rue Jean-Pierre Timbaud BP 309 78054 Saint-Quentin-en-Yvelines Cedex France Tel: (33) 1-30-60-70-00 Fax: (33) 1-30-60-71-11

#### Atmel Japan

9F, Tonetsu Shinkawa Bldg. 1-24-8 Shinkawa Chuo-ku, Tokyo 104-0033 Japan Tel: (81) 3-3523-3551 Fax: (81) 3-3523-7581



Disclaimer: The information in this document is provided in connection with Atmel products. No license, express or implied, by estoppel or otherwise, to any intellectual property right is granted by this document or in connection with the sale of Atmel products. EXCEPT AS SET FORTH IN ATMEL'S TERMS AND CONDI-TIONS OF SALE LOCATED ON ATMEL'S WEB SITE, ATMEL ASSUMES NO LIABILITY WHATSOEVER AND DISCLAIMS ANY EXPRESS, IMPLIED OR STATUTORY WARRANTY RELATING TO ITS PRODUCTS INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT. IN NO EVENT SHALL ATMEL BE LIABLE FOR ANY DIRECT, INDIRECT, CONSEQUENTIAL, PUNITIVE, SPECIAL OR INCIDEN-TAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION, OR LOSS OF INFORMATION) ARISING OUT OF THE USE OR INABILITY TO USE THIS DOCUMENT, EVEN IF ATMEL HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES. Atmel makes no representations or warranties with respect to the accuracy or completeness of the contents of this document and reserves the right to make changes to specifically provided otherwise, Atmel products are not suitable for, and shall not be used in, automotive applications. Atmel's products are not intended, authorized, or warranted for use as components in applications intended to support or sustain life.

© 2010 Atmel Corporation. All rights reserved. Atmel[®], Atmel logo and combinations thereof, AVR[®], AVR[®] logo and others are registered trademarks or trademarks of Atmel Corporation or its subsidiaries. Other terms and product names may be trademarks of others.

