
#### 查询TC1270SERC供应商



# CROCHIP

# TC1270/TC1271

# 4-Pin µP Reset Monitors

DZSC.COM

#### Features

- Precision V<sub>CC</sub> Monitor for 1.8V, 2.7V, 3.0V, 3.3V and 5.0V Nominal Supplies
- Manual Reset Input
- 140msec Minimum RESET, RESET Output Duration
- RESET Output Valid to V<sub>CC</sub> = 1.0V (TC1270)
- Low 7µA Supply Current
- V<sub>CC</sub> Transient Immunity
- Small 4-Pin SOT-143 Package
- No External Components
- Replacement for MAX811/812 and Offers a Lower Threshold Voltage Option WWW.DZSC.COM

#### Applications

- Computers
- Embedded Systems
- Battery Powered Equipment
- Critical µP Power Supply Monitoring

#### **Device Selection Table**

Part Number	Package	Temp. Range
TC1270xERC	4-Pin SOT-143	-40°C to +85°C
TC1271xERC	4-Pin SOT-143	-40°C to +85°C

NOTE: "x" denotes a suffix for VCC threshold (see table below)

Suffix*	Reset V <sub>CC</sub> Threshold (V)
L	4.63
М	4.38
Т	3.08
S	2.93
R	2.63
F	1 75

\*Custom thresholds available, contact factory.

# Package Type 4-Pin SOT-143 4 V<sub>CC</sub> GND **TC1270** TC1271 MR TC1270 RESET 2 3 TC1271 (RESET)


#### General Description

The TC1270 and TC1271 are cost-effective system supervisor circuits designed to monitor V<sub>CC</sub> in digital systems and provide a reset signal to the host processor when necessary. A manual reset input is provided to override the reset monitor, and is suitable for use as a push-button reset. No external components are required.

The reset output is driven active within 20µsec (4µsec for F version) of V<sub>CC</sub> falling through the reset voltage threshold. RESET is maintained active for a minimum of 140msec after V<sub>CC</sub> rises above the reset threshold. The TC1271 has an active-high RESET output while the TC1270 has an active-low RESET output. The output of the TC1270 is valid down to  $V_{CC}$  = 1V. Both devices are available in a 4-Pin SOT-143 package.

The TC1270/TC1271 devices are optimized to reject fast transient glitches on the V<sub>CC</sub> line. Low supply current of  $7\mu A$  (V<sub>CC</sub> = 3.3V) makes these devices suitable for battery powered applications.

#### Typical Operating Circuit

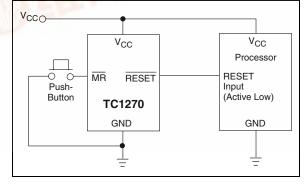



#### **ELECTRICAL** 1.0 **CHARACTERISTICS**

### **Absolute Maximum Ratings\***

Г

Supply Voltage (V <sub>CC</sub> to GND)	+6.0V
RESET, RESET0.3V to (V <sub>CC</sub>	; + 0.3V)
Input Current, V <sub>CC</sub>	20mA
Output Current, RESET, RESET	20mA
Operating Temperature Range40°C t	o +85°C
Storage Temperature Range65°C to	+150°C

\*Stresses above those listed under "Absolute Maximum Ratings" may cause permanent damage to the device. These are stress ratings only and functional operation of the device at these or any other conditions above those indicated in the operation sections of the specifications is not implied. Exposure to Absolute Maximum Rating conditions for extended periods may affect device reliability.

## TC1270/TC1271 ELECTRICAL SPECIFICATIONS

Symbol	Parameter	Min	Тур	Max	Units	Test Conditions
V <sub>CC</sub>	V <sub>CC</sub> Range	1.2	—	5.5	V	
I <sub>CC</sub>	Supply Current	_	7	15	μA	$V_{CC} > V_{TH}$ , for L/M/R/S/T/F
00		—	10	15	-	$V_{CC} < V_{TH}$ , for L/M/R/S/T
		—	6	12		V <sub>CC</sub> < V <sub>TH</sub> , for F
V <sub>TH</sub>	Reset Threshold	4.54	4.63	4.72	V	TC127_L; T <sub>A</sub> = +25°C
		4.50	—	4.75		$T_{A} = -40^{\circ}C \text{ to } +85^{\circ}C$
		4.30	4.38	4.46		TC127_M; T <sub>A</sub> = +25°C
		4.25	—	4.50		$T_A = -40^{\circ}C$ to $+85^{\circ}C$
		3.03	3.08	3.14		TC127_T; T <sub>A</sub> = +25°C
		3.00	_	3.15		$T_A = -40^{\circ}C$ to $+85^{\circ}C$
		2.88	2.93	2.98		TC127_S; $T_A = +25^{\circ}C$
		2.85		3.00		$T_A = -40^{\circ}C$ to $+85^{\circ}C$
		2.58 2.55	2.63	2.68 2.70		TC127_R; T <sub>A</sub> = +25°C T <sub>A</sub> = -40°C to +85°C
		1.71	1.75	1.79		$T_A = -40$ C to +83 C TC127_F; $T_A = +25$ °C
		1.70		1.80		$T_A = -40^{\circ}C \text{ to } +85^{\circ}C$
	Reset Threshold Tempco	_	30	_	ppm/°C	
	V <sub>CC</sub> to Reset Delay	_	20 5		μsec	$V_{CC} = V_{TH}$ to $V_{TH} - 125$ mV; L/M/R/S/T/
t <sub>RP</sub>	Reset Active Timeout Period	140	280	560	msec	$V_{CC} = V_{TH(MAX)}$
	MR Minimum Pulse Width	10	_	_	μsec	
t <sub>MR</sub>	MR Glitch Immunity	—	0.1	—	μsec	
t <sub>MD</sub>	MR to Reset Propagation Delay	_	0.5	—	μsec	
V <sub>IH</sub>	MR Input Threshold	2.3	—	_	V	$V_{CC} > V_{TH(MAX)},$
V <sub>IL</sub>		—	—	0.8		TC127_L/M
V <sub>IH</sub>		0.7 V <sub>CC</sub>	_	_	V	$V_{CC} > V_{TH(MAX)},$
V <sub>IL</sub>		_	_	0.15 V <sub>CC</sub>		TC127_R/S/T/F

 $\frac{Production}{RESET}$  output for TC1270, RESET output for TC1271. Note 1:

2:

# TC1270/TC1271 ELECTRICAL SPECIFICATIONS (CONTINUED)

Symbol	Parameter	Min	Тур	Max	Units	Test Conditions
/ <sub>ОН</sub>	RESET Output Voltage High (TC1271)	0.8 V <sub>CC</sub>	-	—	V	$I_{SOURCE}$ = 150µA; $V_{CC} \le V_{TH(MIN)}$
/ <sub>OL</sub>	RESET Output Voltage Low (TC1271)		_	0.2	V	$TC1271F only, \\ I_{SINK} = 500 \mu A, \\ V_{CC} = V_{TH(MAX)}$
		_	_	0.3		TC1271R/S/T only, $I_{SINK} = 1.2mA, V_{CC} = V_{TH(MAX)}$
		—	_	0.4		TC1271L/M only, $I_{SINK} = 3.2mA$ , $V_{CC} = V_{TH(MAX)}$
V <sub>OL</sub>	RESET Output Voltage Low (TC1270)	—	_	0.3	V	$TC1270R/S/T only, \\I_{SINK} = 1.2mA, V_{CC} = V_{TH(MIN)} \\TC1270F only: \\I_{SINK} = 500\muA, V_{CC} = V_{TH(MIN)}$
			_	0.4 TBD		$\label{eq:IC1270L/M only,} \begin{split} & I_{SINK} = 3.2 \text{mA},  V_{CC} = V_{TH(MIN)} \\ & I_{SINK} = 50 \mu A,  V_{CC} > 1.0 V \end{split}$
V <sub>OH</sub>	RESET Output Voltage High (TC1270)	V <sub>CC</sub> – 1.5	_	_	V	$TC1270L/M only, \\ I_{SOURCE} = 800\mu A, \\ V_{CC} = V_{TH(MAX)}$
		0.8 V <sub>CC</sub>	—	_		TC1270R/S/T/F only, $I_{SOURCE} = 500\mu A$ , $V_{CC} = V_{TH(MAX)}$

Note1:Production testing done at T<sub>A</sub> = +25°C, over temperature limits ensured by design.2:RESET output for TC1270, RESET output for TC1271.

# 2.0 PIN DESCRIPTIONS

The descriptions of the pins are listed in Table 2-1.

## TABLE 2-1: PIN FUNCTION TABLE


Pin No. (SOT-143-4)	Symbol	Description
1	GND	Ground.
2	RESET (TC1270)	$\begin{tabular}{l} \hline RESET & output remains low while V_{CC} is below the reset voltage threshold, and for at least 140msec min. after V_{CC} rises above reset threshold. \end{tabular}$
2	RESET (TC1271)	RESET output remains high while $V_{CC}$ is below the reset voltage threshold, and for at least 140msec min. after $V_{CC}$ rises above reset threshold.
3	MR	Manual reset input generates a reset when $\overline{\text{MR}}$ is below V <sub>IL</sub> .
4	V <sub>CC</sub>	Supply voltage.

# 3.0 APPLICATIONS INFORMATION

### 3.1 V<sub>CC</sub> Transient Rejection

The TC1270/TC1271 provides accurate V<sub>CC</sub> monitoring and reset timing during power-up, power-down, and brownout/sag conditions, and rejects negative-going transients (glitches) on the power supply line. Figure 3-1 shows the maximum transient duration vs. maximum negative excursion (overdrive) for glitch rejection. Any combination of duration and overdrive that lays **under** the curve will **not** generate a reset signal. Combinations above the curve are detected as a brownout or power-down. Transient immunity can be improved by adding a capacitor in close proximity to the V<sub>CC</sub> pin of the TC1270/TC1271.


#### FIGURE 3-1: MAXIMUM TRANSIENT DURATION VS. OVERDRIVE FOR GLITCH REJECTION AT 25°C

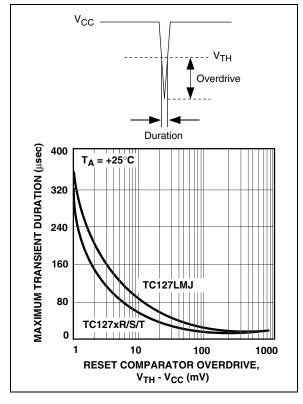


## 3.2 RESET Signal Integrity During Power-Down

The TC1270 RESET output is valid to V<sub>CC</sub> = 1.0V. Below this voltage the output becomes an "open circuit" and does not sink current. This means CMOS logic inputs to the  $\mu$ P will be floating at an undetermined voltage. Most digital systems are completely shut down well above this voltage. However, in situations where RESET must be maintained valid to V<sub>CC</sub> = 0V, a pull-down resistor must

be connected from RESET to ground to discharge stray capacitances and hold the output low (Figure 3-2). This resistor value, though not critical, should be chosen such that it does not appreciably load RESET under normal operation (100k $\Omega$  will be suitable for most applications). Similarly, a pull-up resistor to <u>V<sub>CC</sub></u> is required for the TC1271 to ensure a valid high RESET for V<sub>CC</sub> below 1.1V.



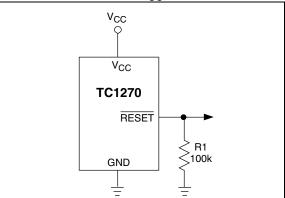


## 3.3 Processors With Bidirectional I/O Pins

Some  $\mu$ P's (such as Motorola 68HC11) have bidirectional reset pins. Depending on the current drive capability of the processor pin, an indeterminate logic level may result if there is a logic conflict. This can be avoided by adding a 4.7 k $\Omega$  resistor in series with the output of the TC1270/TC1271 (Figure 3-3). If there are other components in the system which require a reset signal, they should be buffered so as not to load the reset line. If the other components are required to follow the reset I/O of the  $\mu$ P, the buffer should be connected as shown with the solid line.


FIGURE 3-3:


#### INTERFACING TO BIDIRECTIONAL RESET I/O

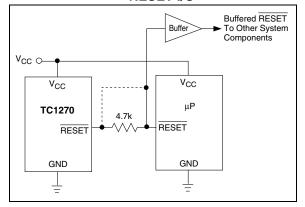



# 4.0 TYPICAL CHARACTERISTICS


**Note:** The graphs and tables provided following this note are a statistical summary based on a limited number of samples and are provided for informational purposes only. The performance characteristics listed herein are not tested or guaranteed. In some graphs or tables, the data presented may be outside the specified operating range (e.g., outside specified power supply range) and therefore outside the warranted range.

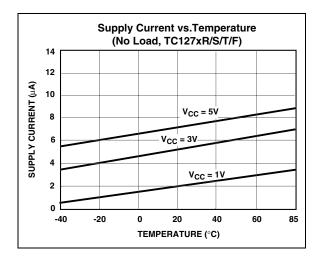


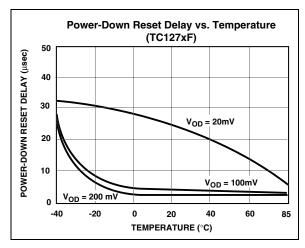

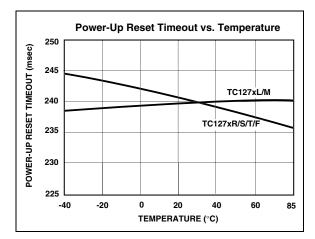

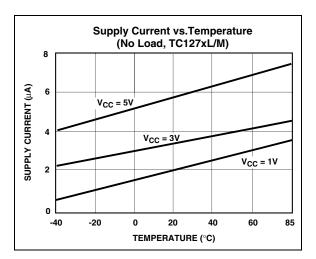


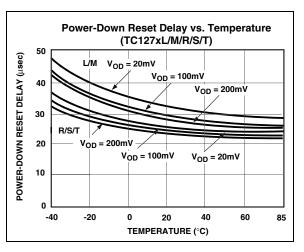

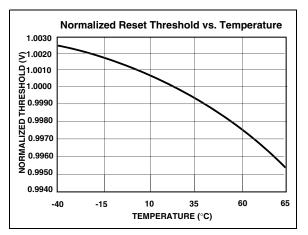

## 5.0 PACKAGING INFORMATION

## 5.1 Package Marking Information




① & ② = part number code + temperature range (two-digit code)

Part Number	(V)	Code
TC1270LERC	4.63	S1
TC1270MERC	4.38	S2
TC1270TERC	3.08	S3
TC1270SERC	2.93	S4
TC1270RERC	2.63	<b>S</b> 5
TC1270FERC	1.75	S7

Part Number	(V)	Code
TC1271LERC	4.63	T1
TC1271MERC	4.38	T2
TC1271TERC	3.08	Т3
TC1271SERC	2.93	T4
TC1271RERC	2.63	T5
TC1271FERC	1.75	Τ7

- ③ represents year and quarter code
- ④ represents production lot ID code

## 5.2 Package Dimensions

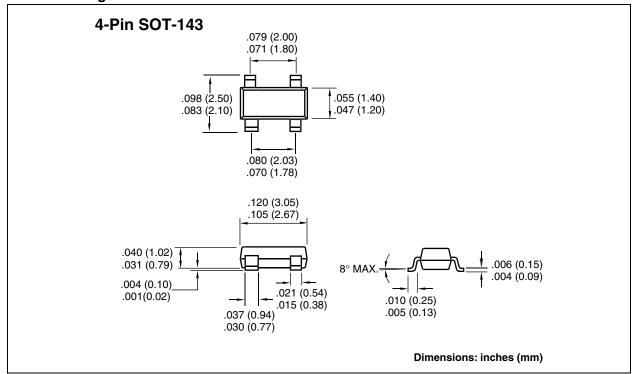

-

NOTES:

#### Sales and Support

#### Data Sheets

Products supported by a preliminary Data Sheet may have an errata sheet describing minor operational differences and recommended workarounds. To determine if an errata sheet exists for a particular device, please contact one of the following:

- 1. Your local Microchip sales office
- The Microchip Corporate Literature Center U.S. FAX: (480) 792-7277 The Microchip Worldwide Site (www.microchip.com)
- 2. 3.

Please specify which device, revision of silicon and Data Sheet (include Literature #) you are using.

#### **New Customer Notification System**

Register on our web site (www.microchip.com/cn) to receive the most current information on our products.

NOTES:

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights.

#### Trademarks


The Microchip name and logo, the Microchip logo, FilterLab, KEELOQ, microID, MPLAB, PIC, PICmicro, PICMASTER, PICSTART, PRO MATE, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

dsPIC, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, microPort, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, MXDEV, MXLAB, PICC, PICDEM, PICDEM.net, rfPIC, Select Mode and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A.

Serialized Quick Turn Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2002, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.





Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999 and Mountain View, California in March 2002. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, non-volatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified.



# WORLDWIDE SALES AND SERVICE

#### AMERICAS

#### Corporate Office

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: 480-792-7627 Web Address: http://www.microchip.com

#### **Rocky Mountain**

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7966 Fax: 480-792-7456

#### Atlanta

500 Sugar Mill Road, Suite 200B Atlanta, GA 30350 Tel: 770-640-0034 Fax: 770-640-0307 **Boston** 2 Lan Drive, Suite 120 Westford, MA 01886

Tel: 978-692-3848 Fax: 978-692-3821 Chicago

333 Pierce Road, Suite 180 Itasca, IL 60143

Tel: 630-285-0071 Fax: 630-285-0075 **Dallas** 

4570 Westgrove Drive, Suite 160 Addison, TX 75001 Tel: 972-818-7423 Fax: 972-818-2924 **Detroit** 

Tri-Atria Office Building 32255 Northwestern Highway, Suite 190 Farmington Hills, MI 48334 Tel: 248-538-2250 Fax: 248-538-2260

#### Kokomo

2767 S. Albright Road Kokomo, Indiana 46902 Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles 18201 Von Karman, Suite 1090 Irvine, CA 92612 Tel: 949-263-1888 Fax: 949-263-1338

New York 150 Motor Parkway, Suite 202 Hauppauge, NY 11788 Tel: 631-273-5305 Fax: 631-273-5335

#### San Jose

Microchip Technology Inc. 2107 North First Street, Suite 590 San Jose, CA 95131 Tel: 408-436-7950 Fax: 408-436-7955

#### Toronto

6285 Northam Drive, Suite 108 Mississauga, Ontario L4V 1X5, Canada Tel: 905-673-0699 Fax: 905-673-6509

#### ASIA/PACIFIC

#### Australia Microchip Technology Australia Pty Ltd Suite 22, 41 Rawson Street

Epping 2121, NSW Australia Tel: 61-2-9868-6733 Fax: 61-2-9868-6755 China - Beijing Microchip Technology Consulting (Shanghai) Co., Ltd., Beijing Liaison Office Unit 915 Bei Hai Wan Tai Bldg. No. 6 Chaoyangmen Beidajie Beijing, 100027, No. China Tel: 86-10-85282100 Fax: 86-10-85282104 China - Chengdu Microchip Technology Consulting (Shanghai) Co., Ltd., Chengdu Liaison Office Rm. 2401, 24th Floor, Ming Xing Financial Tower No. 88 TIDU Street Chengdu 610016, China Tel: 86-28-86766200 Fax: 86-28-86766599 China - Fuzhou Microchip Technology Consulting (Shanghai) Co., Ltd., Fuzhou Liaison Office Unit 28F, World Trade Plaza No. 71 Wusi Road Fuzhou 350001, China Tel: 86-591-7503506 Fax: 86-591-7503521 China - Shanghai Microchip Technology Consulting (Shanghai) Co., Ltd. Room 701, Bldg. B Far East International Plaza No. 317 Xian Xia Road Shanghai, 200051 Tel: 86-21-6275-5700 Fax: 86-21-6275-5060 China - Shenzhen Microchip Technology Consulting (Shanghai) Co., Ltd., Shenzhen Liaison Office Rm. 1315, 13/F, Shenzhen Kerry Centre, Renminnan Lu Shenzhen 518001, China Tel: 86-755-2350361 Fax: 86-755-2366086 China - Hong Kong SAR Microchip Technology Hongkong Ltd. Unit 901-6, Tower 2, Metroplaza 223 Hing Fong Road Kwai Fong, N.T., Hong Kong Tel: 852-2401-1200 Fax: 852-2401-3431 India Microchip Technology Inc. India Liaison Office **Divyasree Chambers** 1 Floor, Wing A (A3/A4) No. 11, O'Shaugnessey Road

Bangalore, 560 025, India

Tel: 91-80-2290061 Fax: 91-80-2290062

#### Japan

Microchip Technology Japan K.K. Benex S-1 6F 3-18-20, Shinyokohama Kohoku-Ku, Yokohama-shi Kanagawa, 222-0033, Japan Tel: 81-45-471-6166 Fax: 81-45-471-6122 Korea Microchip Technology Korea 168-1, Youngbo Bldg. 3 Floor Samsung-Dong, Kangnam-Ku Seoul, Korea 135-882 Tel: 82-2-554-7200 Fax: 82-2-558-5934 Singapore Microchip Technology Singapore Pte Ltd. 200 Middle Road #07-02 Prime Centre Singapore, 188980 Tel: 65-6334-8870 Fax: 65-6334-8850 Taiwan Microchip Technology Taiwan 11F-3, No. 207 Tung Hua North Road Taipei, 105, Taiwan Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

#### EUROPE

#### Denmark

Microchip Technology Nordic ApS Regus Business Centre Lautrup hoj 1-3 Ballerup DK-2750 Denmark Tel: 45 4420 9895 Fax: 45 4420 9910 France Microchip Technology SARL Parc d'Activite du Moulin de Massy 43 Rue du Saule Trapu Batiment A - ler Etage 91300 Massy, France Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 Germany Microchip Technology GmbH Gustav-Heinemann Ring 125 D-81739 Munich, Germany Tel: 49-89-627-144 0 Fax: 49-89-627-144-44 Italy Microchip Technology SRL Centro Direzionale Colleoni Palazzo Taurus 1 V. Le Colleoni 1 20041 Agrate Brianza Milan, Italy Tel: 39-039-65791-1 Fax: 39-039-6899883 United Kingdom Microchip Ltd. 505 Eskdale Road Winnersh Triangle Wokingham Berkshire, England RG41 5TU Tel: 44 118 921 5869 Fax: 44-118 921-5820

05/01/02