## GND

17 RH3 A<sub>0</sub> **CAT** 16 A1 A2 5 5241 15 A3 R<sub>W1</sub> 6 14 SCL R<sub>L1</sub> 7

12

11

19 RW3

18 RL3

13 R<sub>W2</sub>

RL2

R<sub>H2</sub>

## 20 VCC RW0

**TSSOP Package (U, Y)** 

SOIC Package (J, W)

2


3

4

8

10

9

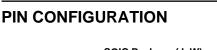

a series of 63 resistive elements connected between two externally accessible end points. The tap points between each resistive element are connected to the wiper outputs with CMOS switches. A separate 6-bit control register

(WCR) independently controls the wiper tap switches for

each DPP. Associated with each wiper control register are four 6-bit non-volatile memory data registers (DR) used for storing up to four wiper settings. Writing to the wiper control register or any of the non-volatile data

The CAT5241 is four Digitally Programmable Potentiometers (DPPs<sup>™</sup>) integrated with control logic and 16 bytes of NVRAM memory. Each DPP consists of

2-wire interface (I<sup>2</sup>C like) **Low wiper resistance, typically 80** $\Omega$ Nonvolatile memory storage for up to four wiper settings for each potentiometer

**End to end resistance 2.5k** $\Omega$ , 10k $\Omega$ , 50k $\Omega$  or 100k $\Omega$ Potentiometer control and memory access via

Quad Digitally Programmable Potentiometers (DPP™)

## DESCRIPTION

**CAT5241** 

potentiometers

**FEATURES** 

with 64 Taps and 2-wire Interface

■ Four linear-taper digitally programmable

64 resistor taps per potentiometer

registers is via a 2-wire serial bus (I<sup>2</sup>C-like). On powerup, the contents of the first data register (DR0) for each of the four potentiometers is automatically loaded into its respective wiper control register (WCR).


The CAT5241 can be used as a potentiometer or as a two terminal, variable resistor. It is intended for circuit level or system level adjustments in a wide variety of applications.


## FUNCTIONAL DIAGRAM



Automatic recall of saved wiper settings at

- Standby current less than 1µA
- 1,000,000 nonvolatile WRITE cycles
- 100 year nonvolatile memory data retention
- 20-lead SOIC and TSSOP packages
- Industrial temperature range

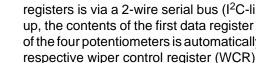

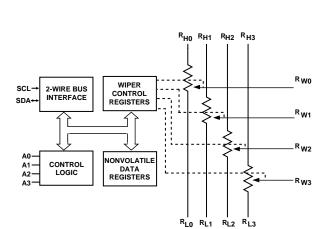



RL0

RH0

RH<sub>1</sub>

SDA

## **PIN DESCRIPTION**

Pin (SOIC)	Name	Function			
1	R <sub>W0</sub>	Wiper Terminal for Potentiometer 0			
2	R <sub>L0</sub>	Low Reference Terminal for Potentiometer 0			
3	R <sub>H0</sub>	High Reference Terminal for Potentiometer 0			
4	A0	Device Address, LSB			
5	A2	Device Address			
6	Rw1	Wiper Terminal for Potentiometer 1			
7	$R_{L1}$	Low Reference Terminal for Potentiometer 1			
8	R <sub>H1</sub>	High Reference Terminal for Potentiometer 1			
9	SDA	Serial Data Input/Output			
10	GND	Ground			
11	R <sub>H2</sub>	High Reference Terminal for Potentiometer 2			
12	R <sub>L2</sub>	Low Reference Terminal for Potentiometer 2			
13	$R_{W2}$	Wiper Terminal for Potentiometer 2			
14	SCL	Bus Serial Clock			
15	A3	Device Address			
16	A1	Device Address			
17	R <sub>H3</sub>	High Reference Terminal for Potentiometer 3			
18	R <sub>L3</sub>	Low Reference Terminal for Potentiometer 3			
19	R <sub>W3</sub>	Wiper Terminal for Potentiometer 3			
20	VCC	Supply Voltage			

## **PIN DESCRIPTIONS**

SCL: Serial Clock

The CAT5241 serial clock input pin is used to clock all data transfers into or out of the device.

SDA: Serial Data

The CAT5241 bidirectional serial data pin is used to transfer data into and out of the device. The SDA pin is an open drain output and can be wireor'd with the other open drain or open collector outputs.

**A0, A1, A2, A3:** Device Address Inputs These inputs set the device address when addressing multiple devices. A total of sixteen devices can be addressed on a single bus. A match in the slave address must be made with the address input in order to initiate communication with the CAT5241.

RH, RL: Resistor End Points

The four sets of  $R_H$  and  $R_L$  pins are equivalent to the terminal connections on a mechanical potentiometer.

Rw: Wiper

The four  $R_W$  pins are equivalent to the wiper terminal of a mechanical potentiometer.

## **DEVICE OPERATION**

The CAT5241 is four resistor arrays integrated with 2wire serial interface logic, four 6-bit wiper control registers and sixteen 6-bit, non-volatile memory data registers. Each resistor array contains 63 separate resistive elements connected in series. The physical ends of each array are equivalent to the fixed terminals of a mechanical potentiometer ( $R_H$  and  $R_L$ ).  $R_H$  and  $R_L$  are symmetrical and may be interchanged. The tap positions between and at the ends of the series resistors are connected to the output wiper terminals ( $R_W$ ) by a

CMOS transistor switch. Only one tap point for each potentiometer is connected to its wiper terminal at a time and is determined by the value of the wiper control register. Data can be read or written to the wiper control registers or the non-volatile memory data registers via the 2-wire bus. Additional instructions allow data to be transferred between the wiper control registers and each respective potentiometer's non-volatile data registers. Also, the device can be instructed to operate in an "increment/decrement" mode.

## **ABSOLUTE MAXIMUM RATINGS\***

Temperature Under Bias
Storage Temperature65°C to +150°C
Voltage on any Pin with Respect to $V_{SS}{}^{(1)(2)}$ 2.0V to +V_{CC} +2.0V
$V_{CC}$ with Respect to Ground2.0V to +7.0V
Package Power Dissipation Capability ( $T_A = 25^{\circ}C$ ) 1.0W
Lead Soldering Temperature (10 secs) 300°C
Wiper Current ±12mA

### \*COMMENT

Stresses above those listed under "Absolute Maximum Ratings" may cause permanent damage to the device. These are stress ratings only, and functional operation of the device at these or any other conditions outside of those listed in the operational sections of this specification is not implied. Exposure to any absolute maximum rating for extended periods may affect device performance and reliability.

Recommended Operating Conditions:						
$V_{CC} = +2.5V$ to +6.0V						
Temperature	Min	Max				
Industrial	-40°C	85°C				

Notes:

(1) The minimum DC input voltage is -0.5V. During transitions, inputs may undershoot to -2.0V for periods of less than 20 ns.

Maximum DC voltage on output pins is  $V_{CC}$  +0.5V, which may overshoot to  $V_{CC}$  +2.0V for periods of less than 20 ns.

(2) Latch-up protection is provided for stresses up to 100 mA on address and data pins from -1V to  $V_{CC}$  +1V.

### POTENTIOMETER CHARACTERISTICS

Symbol	Parameter	Test Conditions	Min	Тур	Мах	Units
R <sub>POT</sub>	Potentiometer Resistance (-00)			100		kΩ
Rpot	Potentiometer Resistance (-50)			50		kΩ
Rpot	Potentiometer Resistance (-10)			10		kΩ
R <sub>POT</sub>	Potentiometer Resistance (-25)			2.5		kΩ
	Potentiometer Resistance Tolerance				<u>+</u> 20	%
	RPOT Matching				1	%
	Power Rating	25°C, each pot			50	mW
Iw	Wiper Current				<u>+</u> 6	mA
Rw	Wiper Resistance	I <sub>W</sub> = <u>+</u> 3mA @ V <sub>CC</sub> =3V			300	Ω
Rw	Wiper Resistance	I <sub>W</sub> = <u>+</u> 3mA @ V <sub>CC</sub> = 5V		80	150	Ω
Vterm	Voltage on any $R_H$ or $R_L$ Pin	V <sub>SS</sub> = 0V	GND		Vcc	V
VN	Noise	(1)		TBD		nV∕√Hz
	Resolution			1.6		%
	Absolute Linearity <sup>(2)</sup>	Rw(n)(actual)-R(n)(expected) <sup>(5)</sup>			<u>+</u> 1	LSB (4)
	Relative Linearity <sup>(3)</sup>	Rw(n+1)-[Rw(n)+LSB] <sup>(5)</sup>			<u>+</u> 0.2	LSB (4)
TC <sub>RPOT</sub>	Temperature Coefficient of RPOT	(1)		<u>+</u> 300		ppm/°C
TCRATIO	Ratiometric Temp. Coefficient	(1)			20	ppm/°C
CH/CL/CW	Potentiometer Capacitances	(1)		10/10/25		pF
fc	Frequency Response	$R_{POT} = 50 k \Omega^{(1)}$		0.4		MHz

Over recommended operating conditions unless otherwise stated.

Notes:

(2) Absolute linearity is utilitzed to determine actual wiper voltage versus expected voltage as determined by wiper position when used as a potentiometer.

(3) Relative linearity is utilized to determine the actual change in voltage between two successive tap positions when used as a potentiometer. It is a measure of the error in step size.

(4)  $LSB = R_{TOT} / 63$  or  $(R_H - R_L) / 63$ , single pot

(5) n = 0, 1, 2, ..., 63

<sup>(1)</sup> This parameter is tested initially and after a design or process change that affects the parameter.

## D.C. OPERATING CHARACTERISTICS

Over recommended operating conditions unless otherwise stated.

Symbol	Parameter	Parameter Test Conditions				Units
Icc	Power Supply Current	f <sub>SCL</sub> = 400kHz			1	mA
I <sub>SB</sub>	Standby Current (V <sub>CC</sub> = 5.0V)	V <sub>IN</sub> = GND or V <sub>CC;</sub> SDA Open			1	μA
ILI	Input Leakage Current	$V_{IN} = GND$ to $V_{CC}$			10	μΑ
ILO	Output Leakage Current	Vout = GND to Vcc			10	μΑ
VIL	Input Low Voltage		-1		V <sub>CC</sub> x 0.3	V
VIH	Input High Voltage		V <sub>CC</sub> x 0.7		V <sub>CC</sub> + 1.0	V
Vol1	Output Low Voltage (V <sub>CC</sub> = 3.0V)	I <sub>OL</sub> = 3 mA			0.4	V

## CAPACITANCE

 $T_A=25^\circ C,\,f=1.0~MHz,\,V_{CC}=5V$ 

Symbol	Test	Conditions	Min	Тур	Max	Units
CI/O <sup>(1)</sup>	Input/Output Capacitance (SDA)	$V_{I/O} = 0V$			8	pF
C <sub>IN</sub> <sup>(1)</sup>	Input Capacitance (A0, A1, A2, A3, SCL)	$V_{IN} = 0V$			6	pF

## A.C. CHARACTERISTICS

Over recommended operating conditions unless otherwise stated.

Symbol	Parameter	Min	Тур	Max	Units
f <sub>SCL</sub>	Clock Frequency			400	kHz
T <sub>I</sub> <sup>(1)</sup>	Noise Suppression Time Constant at SCL, SDA Inputs			50	ns
t <sub>AA</sub>	SLC Low to SDA Data Out and ACK Out			0.9	μs
t <sub>BUF</sub> <sup>(1)</sup>	Time the Bus Must be Free Before a New Transmission Can Start	1.2			μs
t <sub>HD:STA</sub>	Start Condition Hold Time	0.6			μs
t <sub>LOW</sub>	Clock Low Period	1.2			μs
tнigн	Clock High Period	0.6			μs
tsu:sta	Start Condition SetupTime (For a Repeated Start Condition)	0.6			μs
thd:dat	Data in Hold Time	0			ns
t <sub>SU:DAT</sub>	Data in Setup Time	100			ns
t <sub>R</sub> <sup>(1)</sup>	SDA and SCL Rise Time			0.3	μs
t <sub>F</sub> <sup>(1)</sup>	SDA and SCL Fall Time			300	ns
tsu:sto	Stop Condition Setup Time	0.6			μs
t <sub>DH</sub>	Data Out Hold Time	50			ns

## POWER UP TIMING <sup>(1)</sup>

Over recommended operating conditions unless otherwise stated.

Symbol	Parameter	Min	Тур	Мах	Units
tPUR	Power-up to Read Operation			1	ms
tPUW	Power-up to Write Operation			1	ms

### Note:

(1) This parameter is tested initially and after a design or process change that affects the parameter.

## WRITE CYCLE LIMITS

Over recommended operating conditions unless otherwise stated.

Symbol	Parameter	Min	Тур	Max	Units
t <sub>WR</sub>	Write Cycle Time			5	ms

The write cycle is the time from a valid stop condition of a write sequence to the end of the internal program/erase cycle. During the write cycle, the bus interface circuits are disabled, SDA is allowed to remain high, and the device does not respond to its slave address.

### **RELIABILITY CHARACTERISTICS**


Over recommended operating conditions unless otherwise stated.

Symbol	Parameter	Reference Test Method	Min	Тур	Max	Units
N <sub>END</sub> <sup>(1)</sup>	Endurance	MIL-STD-883, Test Method 1033	1,000,000			Cycles/Byte
T <sub>DR</sub> <sup>(1)</sup>	Data Retention	MIL-STD-883, Test Method 1008	100			Years
VZAP <sup>(1)</sup>	ESD Susceptibility	MIL-STD-883, Test Method 3015	2000			Volts
I <sub>LTH</sub> <sup>(1)(2)</sup>	Latch-Up	JEDEC Standard 17	100			mA


Note:

(1) This parameter is tested initially and after a design or process change that affects the parameter.

(2) tPUR and tPUW are the delays required from the time V<sub>CC</sub> is stable until the specified operation can be initiated.

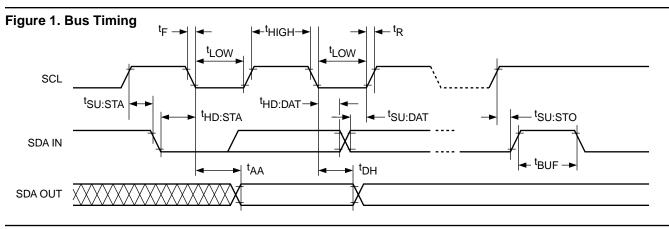

### Figure 2. Write Cycle Timing

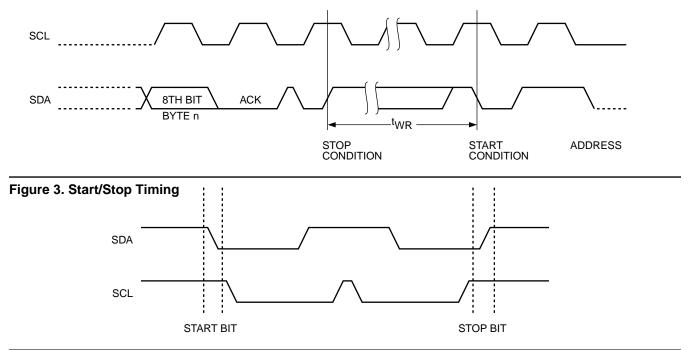

## SERIAL BUS PROTOCOL

The following defines the features of the 2-wire bus protocol:

- (1) Data transfer may be initiated only when the bus is not busy.
- (2) During a data transfer, the data line must remain stable whenever the clock line is high. Any changes in the data line while the clock is high will be interpreted as a START or STOP condition.

The device controlling the transfer is a master, typically a processor or controller, and the device being controlled is the slave. The master will always initiate data transfers and provide the clock for both transmit and receive operations. Therefore, the CAT5241 will be considered a slave device in all applications.

## **START Condition**

The START Condition precedes all commands to the device, and is defined as a HIGH to LOW transition of SDA when SCL is HIGH. The CAT5241 monitors the SDA and SCL lines and will not respond until this condition is met.

### **STOP Condition**

A LOW to HIGH transition of SDA when SCL is HIGH determines the STOP condition. All operations must end with a STOP condition.

## **DEVICE ADDRESSING**

The bus Master begins a transmission by sending a START condition. The Master then sends the address of

the particular slave device it is requesting. The four most significant bits of the 8-bit slave address are fixed as 0101 for the CAT5241 (see Figure 5). The next four significant bits (A3, A2, A1, A0) are the device address bits and define which device the Master is accessing. Up to sixteen devices may be individually addressed by the system. Typically, +5V and ground are hard-wired to these pins to establish the device's address.

After the Master sends a START condition and the slave address byte, the CAT5241 monitors the bus and responds with an acknowledge (on the SDA line) when its address matches the transmitted slave address.


### Acknowledge

After a successful data transfer, each receiving device is required to generate an acknowledge. The Acknowledging device pulls down the SDA line during the ninth clock cycle, signaling that it received the 8 bits of data.

The CAT5241 responds with an acknowledge after receiving a START condition and its slave address. If the device has been selected along with a write operation, it responds with an acknowledge after receiving each 8-bit byte.

When the CAT5241 is in a READ mode it transmits 8 bits of data, releases the SDA line, and monitors the line for an acknowledge. Once it receives this acknowledge, the CAT5241 will continue to transmit data. If no acknowledge is sent by the Master, the device terminates data transmission and waits for a STOP condition.

### Figure 4. Acknowledge Timing

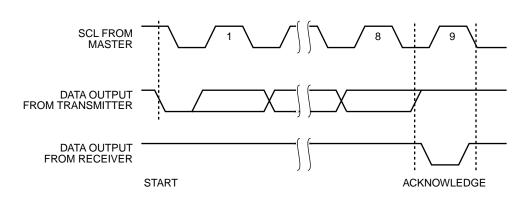

5020 FHD F06


## WRITE OPERATIONS

In the Write mode, the Master device sends the START condition and the slave address information to the Slave device. After the Slave generates an acknowledge, the Master sends the instruction byte that defines the requested operation of CAT5241. The instruction byte consist of a four-bit opcode followed by two register selection bits and two pot selection bits. After receiving another acknowledge from the Slave, the Master device transmits the data to be written into the selected register. The CAT5241 acknowledges once more and the Master generates the STOP condition, at which time if a nonvolatile data register is being selected, the device begins an internal programming cycle to non-volatile memory. While this internal cycle is in progress, the device will not respond to any request from the Master device.

## Acknowledge Polling

The disabling of the inputs can be used to take advantage of the typical write cycle time. Once the stop condition is issued to indicate the end of the host's write operation, the CAT5241 initiates the internal write cycle. ACK polling can be initiated immediately. This involves issuing the start condition followed by the slave address. If the CAT5241 is still busy with the write operation, no ACK will be returned. If the CAT5241 has completed the write operation, an ACK will be returned and the host can then proceed with the next instruction operation.


### Figure 5. Slave Address Bits

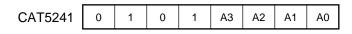

\* A0, A1, A2 and A3 correspond to pin A0, A1, A2 and A3 of the device.

\*\* A0, A1, A2 and A3 must compare to its corresponding hard wired input pins.

### **Figure 6. Write Timing**

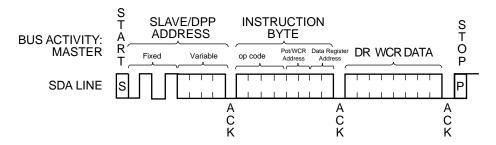

# INSTRUCTION AND REGISTER DESCRIPTION

## SLAVE ADDRESS BYTE

The first byte sent to the CAT5241 from the master/ processor is called the Slave/DPP Address Byte. The most significant four bits of the slave address are a device type identifier. These bits for the CAT5241 are fixed at 0101[B] (refer to Table 1).

The next four bits, A3 - A0, are the internal slave address and must match the physical device address which is defined by the state of the A3 - A0 input pins for the CAT5241 to successfully continue the command sequence. Only the device which slave address matches the incoming device address sent by the master executes the instruction. The A3 - A0 inputs can be actively driven by CMOS input signals or tied to V<sub>CC</sub> or V<sub>SS</sub>.


## INSTRUCTION BYTE

The next byte sent to the CAT5241 contains the instruction and register pointer information. The four most significant bits used provide the instruction opcode I [3:0]. The P1 and P0 bits point to one of four Wiper Control Registers. The least two significant bits, R1 and R0, point to one of the four data registers of each associated potentiometer. The format is shown in Table 2.


### **Data Register Selection**

Data Register Selected	R1	R0
DR0	0	0
DR1	0	1
DR2	1	0
DR3	1	1

### **Table 1. Identification Byte Format**

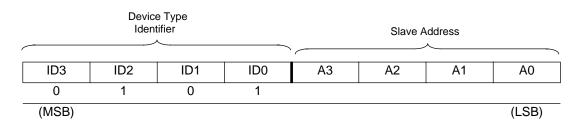

### **Table 2. Instruction Byte Format**

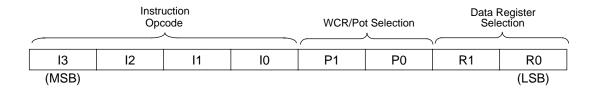

## WIPER CONTROL AND DATA REGISTERS

## Wiper Control Register (WCR)

The CAT5241 contains four 6-bit Wiper Control Registers, one for each potentiometer. The Wiper Control Register output is decoded to select one of 64 switches along its resistor array. The contents of the WCR can be altered in four ways: it may be written by the host via Write Wiper Control Register instruction; it may be written by transferring the contents of one of four associated Data Registers via the XFR Data Register instruction, it can be modified one step at a time by the Increment/decrement instruction (see Instruction section for more details). Finally, it is loaded with the content of its data register zero (DR0) upon power-up.

The Wiper Control Register is a volatile register that loses its contents when the CAT5241 is powered-down. Although the register is automatically loaded with the value in DR0 upon power-up, this may be different from the value present at power-down.

### Data Registers (DR)

Each potentiometer has four 6-bit non-volatile Data Registers. These can be read or written directly by the host. Data can also be transferred between any of the four Data Registers and the associated Wiper Control Register. Any data changes in one of the Data Registers is a non-volatile operation and will take a maximum of 5ms.

If the application does not require storage of multiple settings for the potentiometer, the Data Registers can be used as standard memory locations for system parameters or user preference data.

## INSTRUCTIONS

Four of the nine instructions are three bytes in length. These instructions are:

- Read Wiper Control Register read the current wiper position of the selected potentiometer in the WCR
- Write Wiper Control Register change current wiper position in the WCR of the selected potentiometer
- Read Data Register read the contents of the selected Data Register
- Write Data Register write a new value to the selected Data Register

The basic sequence of the three byte instructions is illustrated in Figure 8. These three-byte instructions

	Instruction Set								
Instruction	13	12	11	10	WCR1/ P1	WCR0/ P0	R1	R0	Operation
Read Wiper Control Register	1	0	0	1	1/0	1/0	0	0	Read the contents of the Wiper Control Register pointed to by P1-P0
Write Wiper Control Register	1	0	1	0	1/0	1/0	0	0	Write new value to the Wiper Control Register pointed to by P1-P0
Read Data Register	1	0	1	1	1/0	1/0	1/0	1/0	Read the contents of the Data Register pointed to by P1-P0 and R1-R0
Write Data Register	1	1	0	0	1/0	1/0	1/0	1/0	Write new value to the Data Register pointed to by P1-P0 and R1-R0
XFR Data Register to Wiper Control Register	1	1	0	1	1/0	1/0	1/0	1/0	Transfer the contents of the Data Register pointed to by P1-P0 and R1-R0 to its associated Wiper Control Register
XFR Wiper Control Register to Data Register	1	1	1	0	1/0	1/0	1/0	1/0	Transfer the contents of the Wiper Control Register pointed to by P1-P0 to the Data Register pointed to by R1-R0
Global XFR Data Registers to Wiper Control Registers	0	0	0	1	0	0	1/0	1/0	Transfer the contents of the Data Registers pointed to by R1-R0 of all four pots to their respective Wiper Control Register
Global XFR Wiper Control Registers to Data Register	1	0	0	0	0	0	1/0	1/0	Transfer the contents of both Wiper Control Registers to their respective data Registers pointed to by R1-R0 of all four pots
Increment/Decrement Wiper Control Register	0	0	1	0	1/0	1/0	0	0	Enable Increment/decrement of the Control Latch pointed to by P1-P0

### Table 3. Instruction Set

Note: 1/0 = data is one or zero

exchange data between the WCR and one of the Data Registers. The WCR controls the position of the wiper. The response of the wiper to this action will be delayed by  $t_{WRL}$ . A transfer from the WCR (current wiper position), to a Data Register is a write to non-volatile memory and takes a minimum of  $t_{WR}$  to complete. The transfer can occur between one of the four potentiometers and one of its associated registers; or the transfer can occur between all potentiometers and one associated register.

Four instructions require a two-byte sequence to complete, as illustrated in Figure 7. These instructions transfer data between the host/processor and the CAT5241; either between the host and one of the data registers or directly between the host and the Wiper Control Register. These instructions are:

- XFR Data Register to Wiper Control Register
   This transfers the contents of one specified Data
   Register to the associated Wiper Control Register.
- XFR Wiper Control Register to Data Register This transfers the contents of the specified Wiper Control Register to the specified associated Data Register.

— Global XFR Data Register to Wiper Control Register This transfers the contents of all specified Data

Registers to the associated Wiper Control Registers.


— Global XFR Wiper Counter Register to Data Register

This transfers the contents of all Wiper Control Registers to the specified associated Data Registers.

### **INCREMENT/DECREMENT COMMAND**

The final command is Increment/Decrement (Figure 5 and 9). The Increment/Decrement command is different from the other commands. Once the command is issued and the CAT5241 has responded with an acknowledge, the master can clock the selected wiper up and/or down in one segment steps; thereby providing a fine tuning capability to the host. For each SCL clock pulse (t<sub>HIGH</sub>) while SDA is HIGH, the selected wiper will move one resistor segment towards the R<sub>H</sub> terminal. Similarly, for each SCL clock pulse while SDA is LOW, the selected wiper will move one resistor segment towards the R<sub>L</sub> terminal.


See Instructions format for more detail.

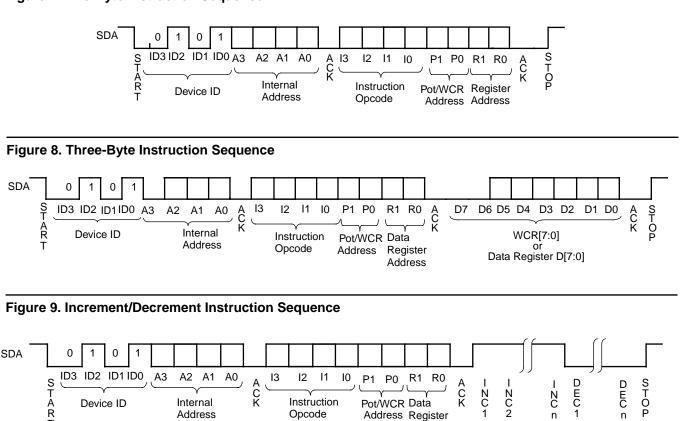


### Figure 7. Two-Byte Instruction Sequence

т

Address

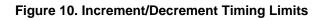

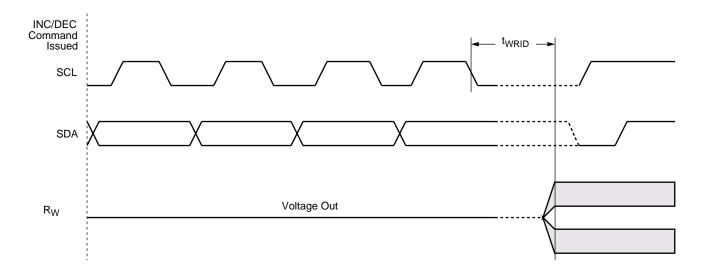

## **INSTRUCTION FORMAT**

## Read Wiper Control Register (WCR)

S	D	EV	ICI	ΞA	DD	RE	SSI	ES	A		IN	IST	<b>T</b> RI	UCI		I	A				DA	TA				Α	S
AR	0	1	0	1	A3	A2	A1	A0	С К	1	0	0	1	P1	Р0	0 0	С К	7	6	5	4	3	2	1	0	C K	Т О Р
Т																											

## Write Wiper Control Register (WCR)

S	DI	EV	ICI	E A	DD	RE	SSI	ES	A		IN	IS'	TRI	JCI	ΓΙΟΙ	N		A				DA	ΔTA				Α	S
A R	0	1	0	1	A3	A2	A1	A0		1	0	1	0	P1	P0	0	0	С К	7	6	5	4	3	2	1	0	С К	Т О Р
Т																												

## Read Data Register (DR)

S	D	EV	ICI	EA	DD	RE	SS	ES	A		I	NS	TR	NC	τιοι	N		Α				DA	ΛTA				Α	S
A R	0	1	0	1	А3	A2	A1	A0		1	0	1	1	P1	P0	R1	R0	C K	7	6	5	4	3	2	1	0	С К	Т О Р
Т																												•

## Write Data Register (DR)

S	DEVICE ADDRESSES	Α		INS	TR	UC	τιοι	N		Α				DA	TA				Α	S
T A	0 1 0 1 A3 A2 A1 A0	C K	1	1 0	0	P1	<b>P0</b>	R1	R0	C K	7	6	5	4	3	2	1	0	C K	Т О
R T																				Ρ

## **INSTRUCTION FORMAT** (continued)

Global Transfer Data Register (DR) to Wiper Control Register (WCR)

S		DE	VI	CE	EAD	DR	ESS	\$	Α		IN	IS1	٢R	UC	TI	ON	1	Α	S
A R	0	1	0	1	A3	A2	A1	A0	С К	0	0	0	1	0	0	R1	R0	С К	і О Р
T																			

Global Transfer Wiper Control Register (WCR) to Data Register (DR)

S		DE	VI	CE		DR	ESS	\$	Α		IN	IST	<b>FR</b>	UC	TI	ON	I	A	S
A	0	1	0	1	A3	A2	A1	A0	С К	1	0	0	0	0	0	R1	R0	С К	0
R																			Ρ
Т																			

Transfer Wiper Control Register (WCR) to Data Register (DR)

S	DEVICE ADDRESS								Α		IN	IS-	<b>F</b> R	UC		I		Α	S
T A R T	0	1	0	1	A3	A2	A1	A0	С К	1	1	1	0	P1	P0	R1	R0	C K	T O P

Transfer Data Register (DR) to Wiper Control Register (WCR)

S	DEVICE ADDRESS						5	Α		IN	IS.	TR	UC	ΓΙΟΝ	1		Α	S	
T A	0	1	0	1	A3	A2	A1	A0	С К	1	1	1	0	<b>P1</b>	<b>P0</b>	R1	R0	C K	0
R T																			Ρ


Increment (I)/Decrement (D) Wiper Control Register (WCR)

S	D	)E\	/IC	E	٩DD	RE	SS		Α		IN	1S1	۲RI	JCI	101	N		A			DATA			A	S
I A R T	0	1	0	1	А3	A2	A1	A0		0	0	1	0	P1	P0	0	0	С К	I/D	I/D	•••	1/[	) I/D		T O P

Notes:

(1) Any write or transfer to the Non-volatile Data Registers is followed by a high voltage cycle after a STOP has been issued.

### **ORDERING INFORMATION**

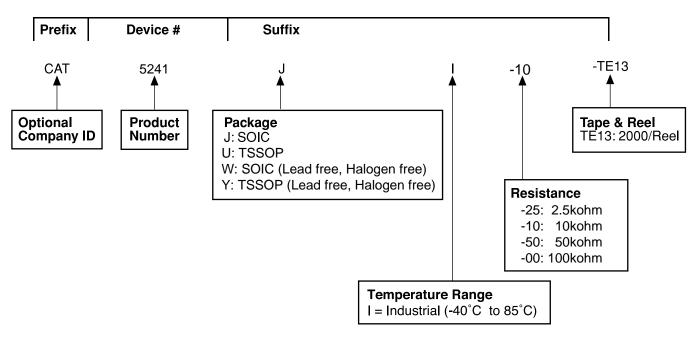



Notes:


(1) The device used in the above example is a CAT5241JI-10-TE13 (SOIC, Industrial Temperature, 10kohm, Tape & Reel)

## PACKAGING INFORMATION


20-LEAD 300 MIL WIDE SOIC (J, W)

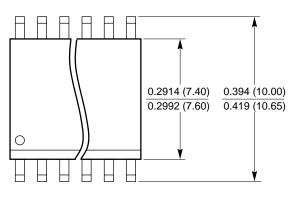


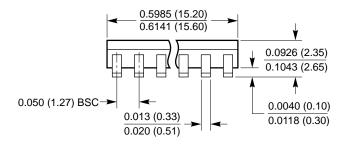


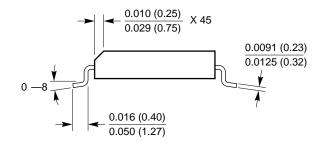



## 20-LEAD 300 MIL WIDE TSSOP (U, Y)

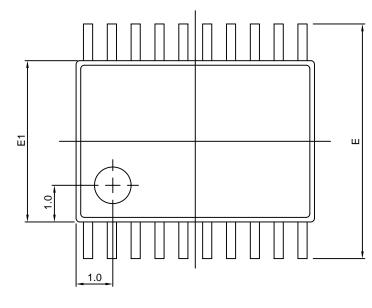

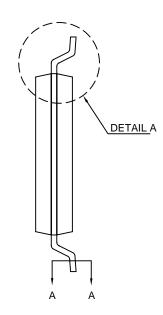

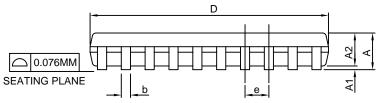

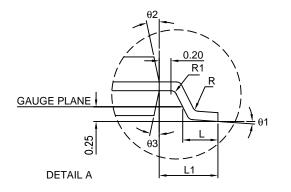

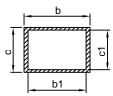



SYMBOL	DIME	NSION I	N MM	DIMEN	ISION II	INCH
STMBOL	MIN	NOM	MAX	MIN	NOM	MAX
A			1.20			.043
A1	0.05		0.15	.002		.006
A2	0.80	0.90	1.05	.031	.035	.041
L	0.50	0.60	0.75	.020	.024	.030
D	6.40	6.50	6.60	.252	.256	.260
E	6.30	6.40	6.50	.248	.252	.256
E1	4.30	4.40	4.50	.169	.173	.177
R	0.09			.004		
R1	0.09			.004		
b	0.19		0.30	.007		.012
b1	0.19	0.22	0.25	.007	.009	.010
с	0.09		0.20	.004		.008
c1	0.09		0.16	.004		.006
L1		1.0 REF	-		039 REF	-
е	(	).65 BS(	C		026 BSC	)
θ1	0		8	0		8
θ2		12 REF			12 REF	
θ3		12 REF			12 REF	
N			2	0		
REF		JEDEC	M0-153	VARIA	TION AC	

## **REVISION HISTORY**

Date	Rev.	Reason
9/30/2003	G	Deleted WP from Functional Diagram, pg. 1
3/3/2004	Н	Added TSSOP package in all areas
3/29/2004	I	Eliminated data sheet designation
		Eliminated Commercial temp range in all areas
		Updated Absolute Max Ratings and Potentiometer Characteristics notes
4/5/2004	J	Corrected Potentiometer Resistance [Changed (-2.5) to (-25)] in table

#### Copyrights, Trademarks and Patents

Trademarks and registered trademarks of Catalyst Semiconductor include each of the following:

Catalyst Semiconductor has been issued U.S. and foreign patents and has patent applications pending that protect its products. For a complete list of patents issued to Catalyst Semiconductor contact the Company's corporate office at 408.542.1000.

CATALYST SEMICONDUCTOR MAKES NO WARRANTY, REPRESENTATION OR GUARANTEE, EXPRESS OR IMPLIED, REGARDING THE SUITABILITY OF ITS PRODUCTS FOR ANY PARTICULAR PURPOSE, NOR THAT THE USE OF ITS PRODUCTS WILL NOT INFRINGE ITS INTELLECTUAL PROPERTY RIGHTS OR THE RIGHTS OF THIRD PARTIES WITH RESPECT TO ANY PARTICULAR USE OR APPLICATION AND SPECIFICALLY DISCLAIMS ANY AND ALL LIABILITY ARISING OUT OF ANY SUCH USE OR APPLICATION, INCLUDING BUT NOT LIMITED TO, CONSEQUENTIAL OR INCIDENTAL DAMAGES.

Catalyst Semiconductor products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Catalyst Semiconductor product could create a situation where personal injury or death may occur.

Catalyst Semiconductor reserves the right to make changes to or discontinue any product or service described herein without notice. Products with data sheets labeled "Advance Information" or "Preliminary" and other products described herein may not be in production or offered for sale.

Catalyst Semiconductor advises customers to obtain the current version of the relevant product information before placing orders. Circuit diagrams illustrate typical semiconductor applications and may not be complete.



Catalyst Semiconductor, Inc. Corporate Headquarters 1250 Borregas Avenue Sunnyvale, CA 94089 Phone: 408.542.1000 Fax: 408.542.1200 www.catalyst-semiconductor.com

Publication #:2011Revison:JIssue date:4/5/04