鲁山化

# 2-phase half-wave motor predriver BA6402F


The BA6402F is a 2-phase, half-wave motor predriver suitable for fan motors.

## Features

- Lock detection and rotational speed sensing mechanisms are built in.
- 2) Hall constant current source is built in.

 Compact 8-pin SOP package reduces the number of external components required.

Block diagram and application example

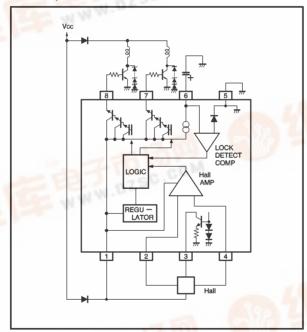

# ●Absolute maximum ratings (Ta = 25°C)

Parameter	Symbol	Limits	Unit
Applied voltage	Vcc	30	V
Power dissipation	Pd	450*	mW
Operating temperature	Topr	<b>−20~+80</b>	°C
Storage temperature	Tstg	<b>−55∼+125</b>	°C
Output current	Іомах.	70	mA

\*Reduced by 4.5 mW for each increase in Ta of 1°C over 25°C.

## Recommended operating conditions

Parameter	Symbol	Min.	Тур.	Max.	Unit	Conditions
Applied voltage	Vcc	4	_	28	٧	Operate within the allowable power dissipation
Input voltage	Vвн	0.8	1	Vcc-0.2	V	for -20℃ < Ta < 80℃

Motor driver ICs BA6402F

Parameter	Symbol	Min.	Тур.	Max.	Unit	Conditions
Supply current	lcc	_	1.9	4.0	mA	
Hall amplifier input hysteresis (十)	V <sub>hys</sub> +	3	_	15	mV	
Hall amplifier input hysteresis (-)	V <sub>hys</sub> -	-3	_	<b>-15</b>	mV	
Pin 3 constant current	l3	5	6.8	10	mA	
Pin 6 constant current	l6	5	6.8	10	μΑ	
Pin 6 clamp voltage	V <sub>6</sub>	3.1	_	3.7	V	
Pin 7 Output high level voltage	V <sub>7</sub> H	10	10.5	_	V	lo=10mA
Pin 8 Output high level voltage	V <sub>8</sub> H	10	10.5	_	V	Io=10mA

# Rotational speed sensing and lock detection (6 pin)

The circuit around pin 6 is described in Fig. 1. Normally, the  $C_6$  external capacitor is charging or discharging around the Hall signal when the motor is running. When the motor is locked, discharging does not occur at  $C_6$  because the Hall signal stops switching. Charging continues at  $C_6$  until the voltage increases to the pin-6 clamp voltage, and then  $Q_1$  turns ON to turn OFF the output. With the pin-6 current being constant ( $I_6$ =6.8 $\mu$ A, typical), the time required after the motor is locked until the output current is turned OFF (duration between B and C in Fig. 2) is determined by the  $C_6$  capacitance.

$$T_{\text{off}} = T_{\text{B-C}} = \frac{\left(V_{\text{6CL}} - V_{\text{BEQ3}}\right) C_6}{I_6}$$

$$\stackrel{\leftarrow}{=} \frac{4V_{\text{BE}} \cdot C_6}{6.8 \mu A \text{ (Typ.)}}$$

$$\stackrel{\leftarrow}{=} 4.12 \times 10^5 \times C_6 \text{ (sec) (Typ.)}$$

where  $V_{\text{BCL}}$  is pin-6 clamp voltage (nearly equal to  $5V_{\text{BE}}$ ) For  $C_6$ =2.2 $\mu$ F, for example,  $T_{\text{off}}$  is about 0.91s (typical).

## Operation notes

(1) Hall constant current source (3 pin, 6.8mA typically), which is directly connected with the IC bias circuit, is not available when pin 3 is OPEN (saturated).

# (2) Power dissipation

The allowable power dissipation is plotted against ambient temperature in Fig. 3.

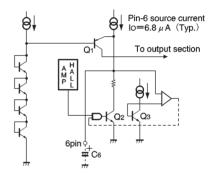


Fig.1


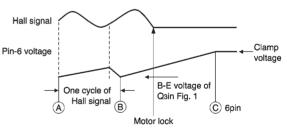


Fig.2

## Thermal derating curve

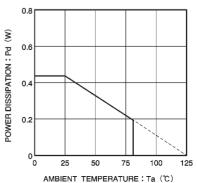

ANDIENT TEIM ETATORE : IN (

Eig 3

Motor driver ICs BA6402F

# (3) Power dissipation

The power consumed in the IC can be calculated from the following equation:

$$Pc = \sum_{i=1}^{3} Pcn$$

1)  $P_{C1}$  is power consumed by the circuit current.  $P_{C1}$ = $V_{CC} \times I_{CC}$ 

2)  $P_{C2}$  is power consumed by the Hall current (pin 3).  $P_{C2}=I_3\times V_3$ 

where V₃=pin 3 voltage. Connecting a resistor between the Vcc pin and pin 3 effectively reduces the IC current consumption.

## Electrical characteristic curve


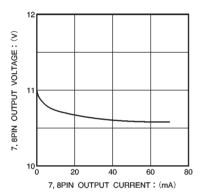


Fig.4 Output voltage vs. output current for pins 7 and 8

## External dimensions (Units: mm)

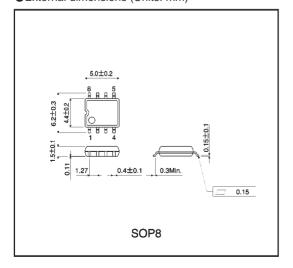

3) Pc3 is power consumed by the output current.

$$P_{C3}=(V_{CC}-V_{OH})\times I_{O}$$

VoH is the HIGH level voltage of pins 7 and 8. Power consumption can be reduced by raising the hFE-rank of the external output transistor and thereby reducing the lo value. Make sure that your application does not exceed the allowable power dissipation of the IC.

## (4) Restarting when motor is locked

The outputs are turned OFF if the motor is stopped for some reason. To restart the motor from this situation, turn off the power first, fully discharge the pin 6 capacitor next, and then turn on the power again.