



Vishay Telefunken

94 9539

Fast Silicon Mesa Rectifiers

Features

- Glass passivated junction
- Hermetically sealed package
- Low reverse current
- Soft recovery characteristics

Applications

Very fast rectifiers and switches

Absolute Maximum Ratings

T_i = 25°C

Parameter	Test Conditions	Туре	Symbol	Value	Unit
Reverse voltage	6140	BYT54A	V _R =V _{RRM}	50	V
=Repetitive peak reverse voltage		BYT54B	V _R =V _{RRM}	100	V
		BYT54D	V _R =V _{RRM}	200	V
		BYT54G	V _R =V _{RRM}	400	V
NO EL		BYT54J	V _R =V _{RRM}	600	V
		BYT54K	V _R =V _{RRM}	800	V
		BYT54M	V _R =V _{RRM}	1000	V
Peak forward surge current	t _p =10ms, half sinewave	486	I _{FSM}	30	A
Average forward current	on PC board		I _{FAV}	0.75	A
	l=10mm, T _L =25°C		I _{FAV}	1.25	A
Junction and storage	COM	BYT54A–BYT54K	T _i =T _{stg}	-65+175	°C
temperature range	120	BYT54M	T _i =T _{stq}	-65+165	°C

Maximum Thermal Resistance

T_i = 25°C

Parameter	Test Conditions	Symbol	Value	Unit
Junction ambient	I=10mm, T _L =constant	R _{thJA}	45	K/W
	on PC board with spacing 25mm	R _{thJA}	100	K/W

Electrical Characteristics

 $T_i = 25^{\circ}C$

Parameter	Test Conditions	Туре	Symbol	Min	Тур	Max	Unit
Forward voltage	I _F =1A		V _F			1.5	V
Reverse current	V _R =V _{RRM}		I _R			5	μΑ
	V _R =V _{RRM} , T _i =150°C		I _R			150	μΑ
Reverse recovery time	I _F =0.5A, I _R =1A, i _R =0.25A		t _{rr}			100	ns




BYT54.



Vishay Telefunken

Characteristics ($T_j = 25^{\circ}C$ unless otherwise specified)

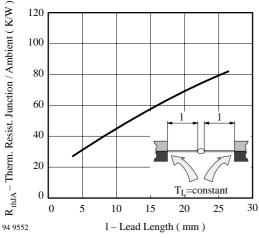



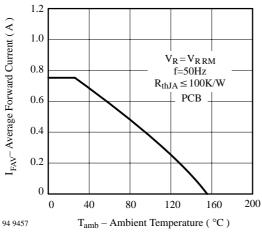


Figure 2. Max. Average Forward Current vs. Ambient Temperature

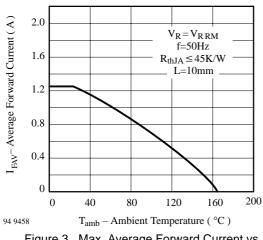
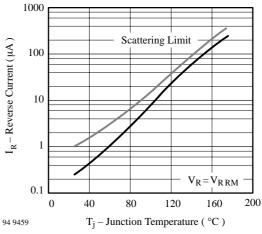



Figure 3. Max. Average Forward Current vs. Ambient Temperature





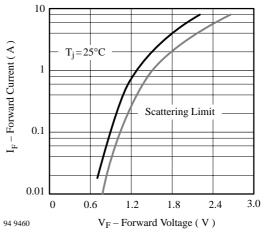


Figure 5. Forward Current vs. Forward Voltage


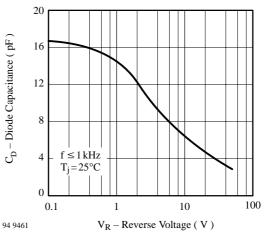


Figure 6. Typ. Diode Capacitance vs. Reverse Voltage



BYT54. Vishay Telefunken

Dimensions in mm

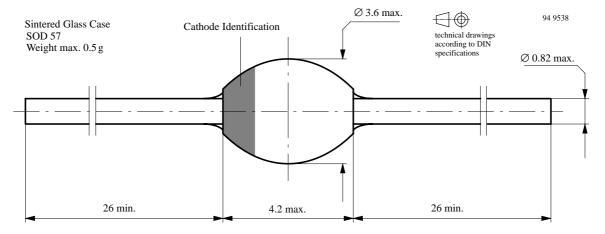

BYT54.

Vishay Telefunken



Ozone Depleting Substances Policy Statement

It is the policy of Vishay Semiconductor GmbH to

1. Meet all present and future national and international statutory requirements.

2. Regularly and continuously improve the performance of our products, processes, distribution and operating systems

with respect to their impact on the health and safety of our employees and the public, as well as their impact on the environment.

It is particular concern to control or eliminate releases of those substances into the atmosphere which are known as ozone depleting substances (ODSs).

The Montreal Protocol (1987) and its London Amendments (1990) intend to severely restrict the use of ODSs and forbid their use within the next ten years. Various national and international initiatives are pressing for an earlier ban on these substances.

Vishay Semiconductor GmbH has been able to use its policy of continuous improvements to eliminate the use of ODSs listed in the following documents.

- 1. Annex A, B and list of transitional substances of the Montreal Protocol and the London Amendments respectively
- 2. Class I and II ozone depleting substances in the Clean Air Act Amendments of 1990 by the Environmental Protection Agency (EPA) in the USA
- 3. Council Decision 88/540/EEC and 91/690/EEC Annex A, B and C (transitional substances) respectively.

Vishay Semiconductor GmbH can certify that our semiconductors are not manufactured with ozone depleting substances and do not contain such substances.

We reserve the right to make changes to improve technical design and may do so without further notice. Parameters can vary in different applications. All operating parameters must be validated for each customer application by the customer. Should the buyer use Vishay-Telefunken products for any unintended or unauthorized application, the buyer shall indemnify Vishay-Telefunken against all claims, costs, damages, and expenses, arising out of, directly or indirectly, any claim of personal damage, injury or death associated with such unintended or unauthorized use.

> Vishay Semiconductor GmbH, P.O.B. 3535, D-74025 Heilbronn, Germany Telephone: 49 (0)7131 67 2831, Fax number: 49 (0)7131 67 2423