

5-phase Stepper Motor Star Connection Unipolar Driver IC

SI-7500A


■ Ratings

Type No.	(Ta = 25°C)						
	Absolute maximum rating		Supply voltage (V)	Output current (A)	Junction temperature (°C)	Operating ambient temperature (°C)	Storage temperature (°C)
	Vcc	Vb	Io	Tj	Top	Tstg	
SI-7500A	40	8	1.2	+125	-20 to +80	-30 to +100	

■ Characteristics

Type No.	(Ta = 25°C)																																								
	Electrical characteristics				Operating supply voltage (V)				Output current (mA/ø)		Power down Ratio (%)		Vb input current (mA)		External zener diode breakdown voltage (V)		*Input voltage (V)		*Input current (mA)		Trigger pulse voltage (V)		Trigger pulse time (μs)		Trigger pulse frequency (kHz)																
	Vcc			Vb			Io			IOPD/Io			Ib			Vz			V _{IH1}			V _{IH2}			V _{IL}			I _{IIH1}			I _{IIH2}			V _{trig}			T _{trig}			F _{trig}	
SI-7500A	17	24	30	4.5	5	5.5	200	750	1000	35	50	100	15	Vcc x1.5	50	3.9	1.3	0.6	0.21	0.22	4.0	Vb	1.0	2.0	20	25															

■ Block diagram

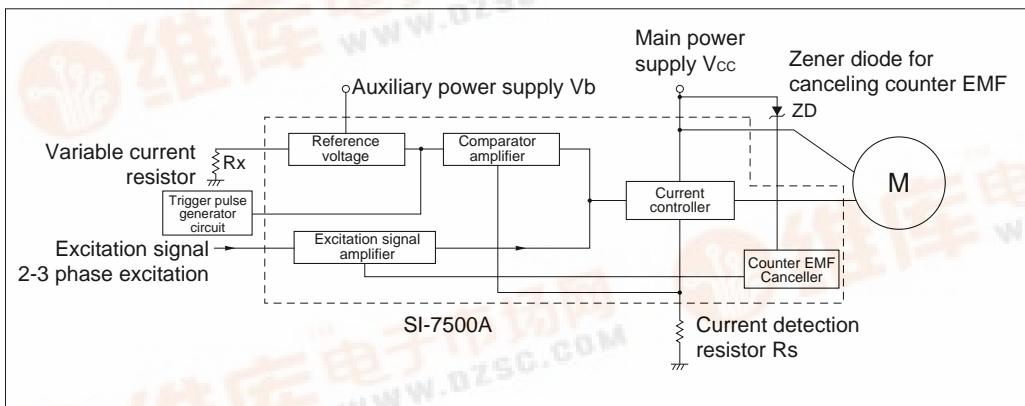

* Input voltage and input current conditions


V_{IH1} : $V_b = 5V$, Q_1 to Q_5 ON
 $R_x = \infty$, $I_{IN} = 0.2mA$

V_{IH2} : $V_b = 5V$, Q_1 to Q_5 OFF,
 $I_{IN} = 0.22mA$

I_{IH1} : $V_b = 5V$, Q_1 to Q_5 ON,
 $V_{IN} = 3.7V$

I_{IH2} : $V_b = 5V$, Q_1 to Q_5 OFF,
 $V_{IN} = 0.9V$


■ Equivalent circuit diagram

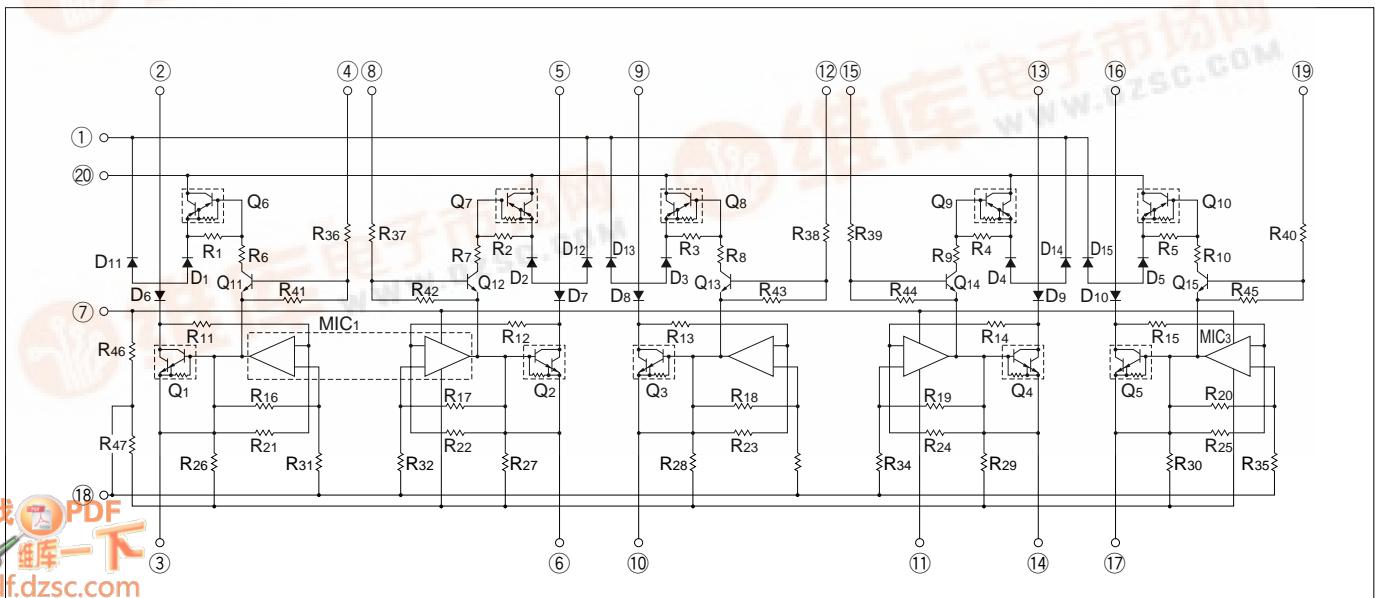

SI-7500A


■ Diagram of external circuits

SI-7500A

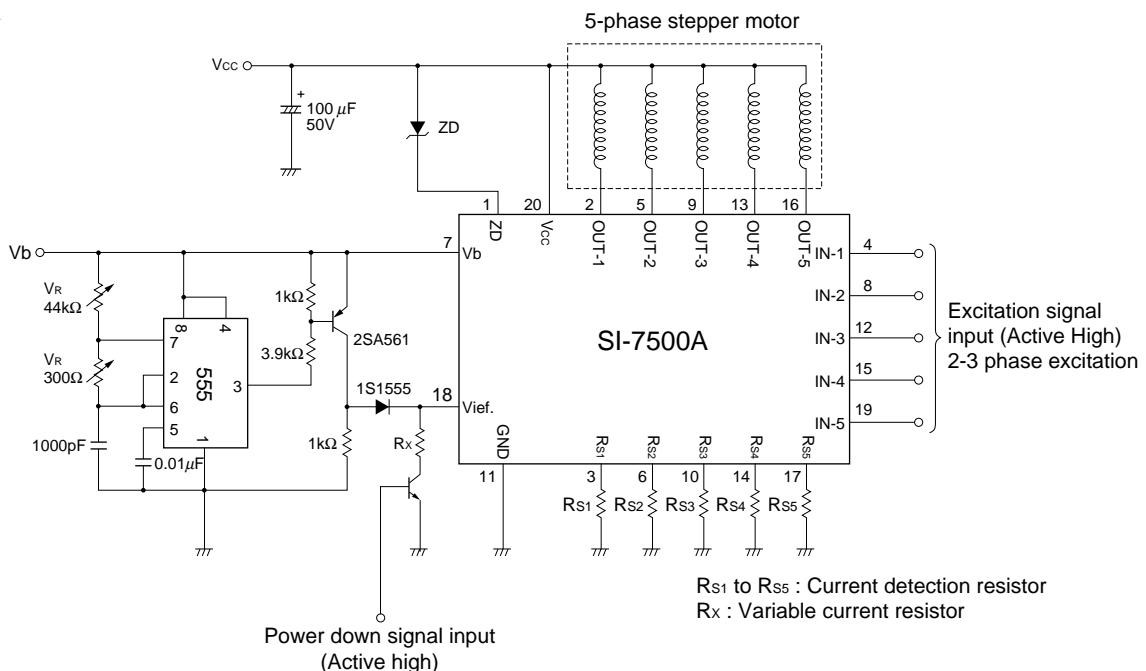


■ External dimensions


(Unit: mm)

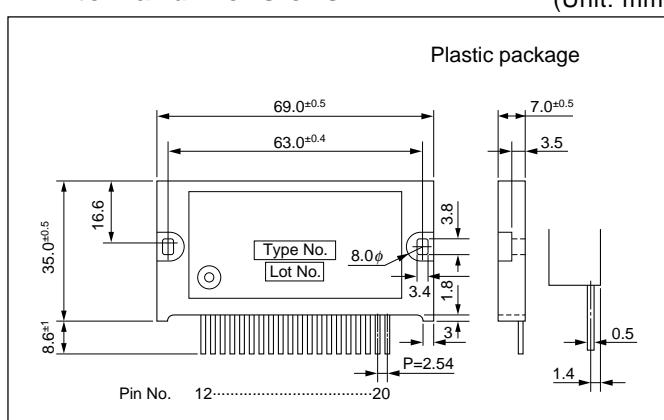


■ Case temperature vs. Output current

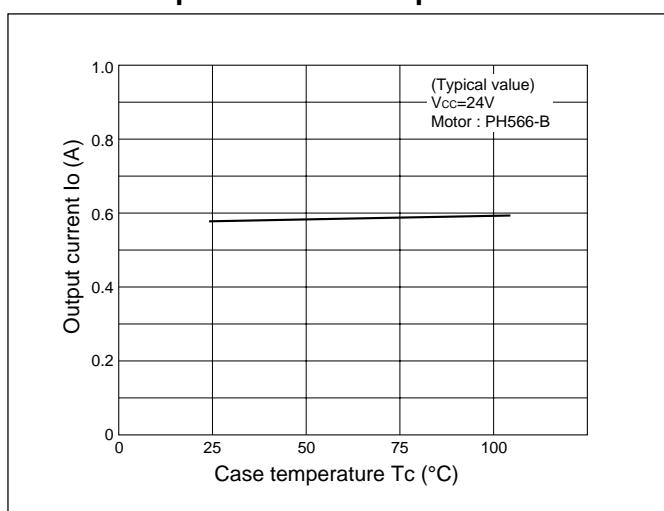

■ Supply voltage vs. Output current

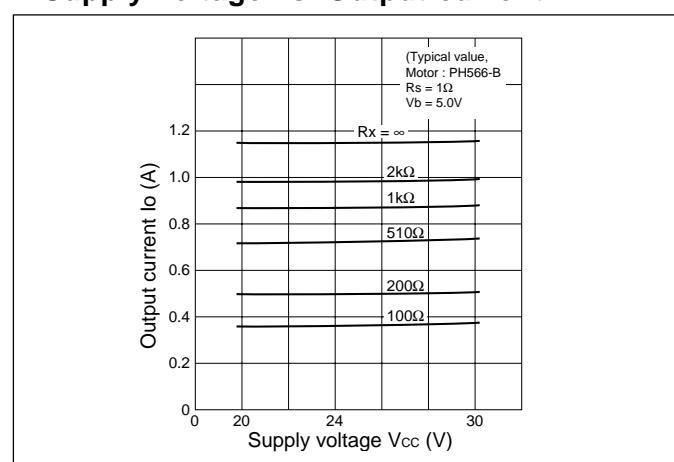

■ Torque characteristics

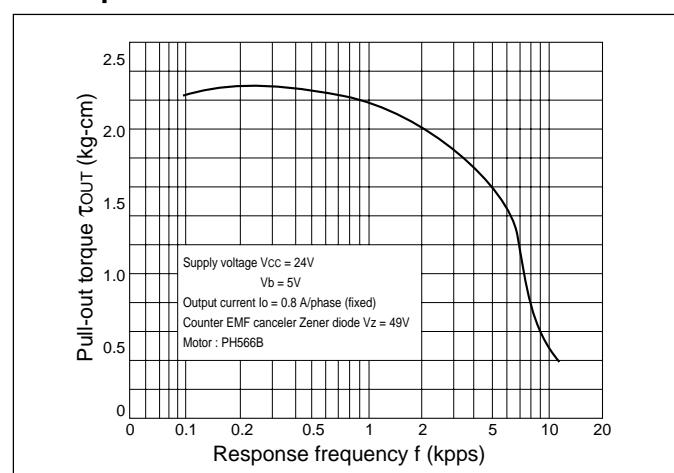

SI-7500A

Application Note

■ Determining the output current I_o (motor coil current)

The main elements that determine the output current are Current detection resistor R_s , Supply voltage V_b , and Variable current resistor R_x .

(1) Normal mode

To operate a motor at maximum current level, set R_x to infinity (open).

From Fig. A, when the maximum output current ripple is designated as I_{OH} , its value will be,

$$I_{OH} = \frac{V_{RSH}}{R_s} \quad \text{[A]}$$

V_{RSH} can be computed as follows:

$$V_{RSH} = 0.2 V_b + 0.213 \text{ (center value)} \quad \text{[B]}$$

From equations [A] and [B], the output current I_{OH} can be computed as follows:

$$I_{OH} = \frac{1}{R_s} (0.2 V_b + 0.213)$$

The relationship between I_{OH} and R_s is shown in Fig. B.

(2) Power down mode

When an external resistor R_x is connected, V_{RSH} changes as shown in the Fig. B even when R_s is retained. Obtain the power down output current I_{OHPD} from Fig. B and equation [A].


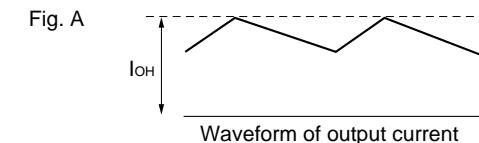


Fig. B

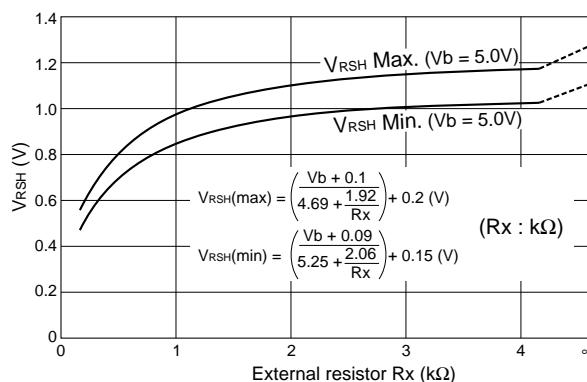

■ Thermal design

Obtain the internal power dissipation that corresponds to the output current to be required from Fig. C, multiply this by three, and determine the size of the heatsink from the derating curve in Fig. D. The derating curve is based on junction temperature of 125°C. However, make some allowance so that T_c is 85°C or less and then select the proper heatsink size.

Fig. C SI-7500A Internal power dissipation per phase P_D vs. Output current I_o


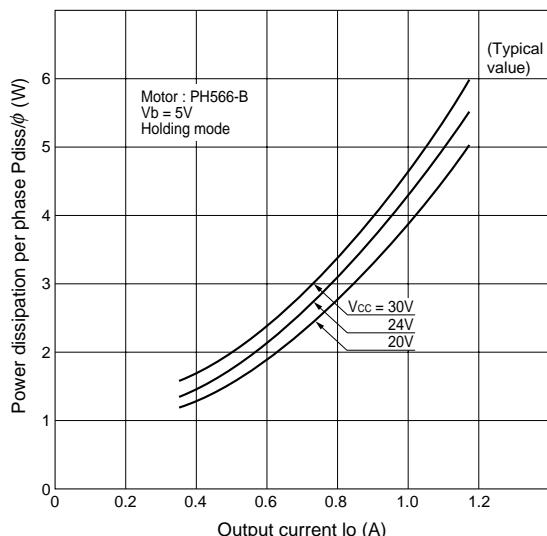


Fig. D SI-7500A Derating curve

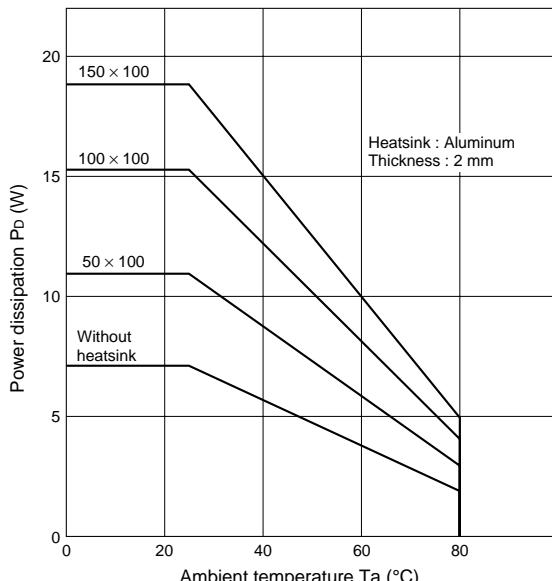

SI-7200M, SI-7230M, SI-7115B, SI-7300A, SI-7330A, SI-7500A and SI-7502

Handling Precautions

(Note: The SI-7502 is applicable for item (2) only.)

For details, refer to the relevant product specifications.

(1) Tightening torque:

The torque to be applied in tightening screws when mounting the IC on a heatsink should be below 49N•m.

(2) Solvent:

Do not use the following solvents:

Substances that dissolve the package	Chlorine-based solvents : Trichloroethylene, Trichloroethane, etc. Aromatic hydrogen compounds: Benzene, Toluene, Xylene, etc. Ketone and Acetone group solvents
Substances that weaken the package	Gasoline, Benzine and Kerosene

(3) Silicone grease:

The silicone grease to be used between the aluminum base plate of the hybrid IC and the heatsink should be any of the following:

- G-746 SHINETSU CHEMICAL INDUSTRIES CO., LTD.
- YG6260 TOSHIBA SILICONE CO., LTD.
- SC102 DOW CORNING TORAY SILICONE CO., LTD.

Please pay sufficient attention in selecting silicone grease since oil in some grease may penetrate the product, which will result in an extremely short product life.

Others

• Resistance against radiation

Resistance against radiation was not considered in the development of these ICs because it is assumed that they will be used in ordinary environment.