OSHIBA

FIBER OPTIC TRANSMITTING MODULE

TOTX196

FIBER OPTIC TRANSMITTING MODULE FOR SIMPLEX DIGITAL SIGNAL TRANSMISSION


Data rate: DC to 6Mb/s (NRZ code)

Transmission distance: Up to 1000m

TTL interface

LED is driven by Differential cuicuit.

No need to change a resistor according to transmission distance.

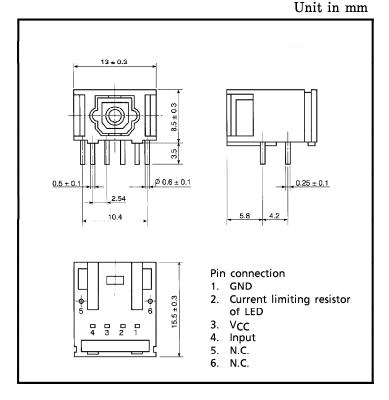

1. Maximum Ratings (Ta = 25°C)

| ITEM | SYMBOL | RATING | UNIT |
|-----------------------|----------------|----------------------------|----------------------|
| Storage Temperature | $ m T_{stg}$ | -40 to 85 | $^{\circ}\mathrm{C}$ |
| Operating Temperature | $T_{ m opr}$ | -40 to 85 | $^{\circ}\mathrm{C}$ |
| Supply Voltage | $v_{\rm CC}$ | -0.5 to 7 | V |
| Input Voltage | v_{IN} | -0.5 to $V_{\rm CC}+0.5$ | V |
| Soldering Temperature | ${ m T_{sol}}$ | 260 (¹) | $^{\circ}\mathrm{C}$ |

Soldering time≤3 seconds (More than 1mm apart from package).

Handling precaution: The LEDs used in this product contain GaAs (Gallium Arsenide).

Care must be taken to protect the safety of people and the

environment when scrapping or terminal processing.

- 961001EAC;

 TOSHIBA is continually working to improve the quality and the reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to observe standards of safety, and to avoid situations in which a malfunction or failure of a TOSHIBA product could cause loss of human life, bodily injury or damage to property. In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as sat forth in the most recent products specifications. Also, please keep in mind the precautions and conditions set forth in the TOSHIBA Semiconductor Reliability Handbook.

 Callium arsenide (GaAs) is a substance used in the products described in this document. GaAs dust and fumes are toxic. Do not break, cut or pulverize the product, or use chemicals to dissolve them. When disposing of the products, follow the appropriate regulations. Do not dispose of the products with other industrial waste or with domestic garbage.

 The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others.

2. Recommended Operating Conditions

| ITEM | SYMBOL | MIN. | TYP. | MAX. | UNIT |
|--------------------------|--------------|------|------|--------------|------|
| Supply Voltage | v_{CC} | 4.75 | 5.0 | 5.25 | V |
| High Level Input Voltage | $v_{ m IH}$ | 2.0 | _ | $v_{\rm CC}$ | V |
| Low Level Input Voltage | $V_{\rm IL}$ | 0 | | 0.8 | V |

3. Electrical and Optical Characteristics (Ta = 25°C, $V_{CC} = 5V$)

| ITEM | SYMBOL | CONDITION | MIN. | TYP. | MAX. | UNIT |
|----------------------------|------------------------|---|------|------|------|---------|
| Data Rate | | NRZ code (2) | DC | _ | 6 | Mb/s |
| | | Using PCF (3), TORX196 | 0.2 | _ | 1000 | m |
| Transmission Distance | | Using PCF (4), TORX196 | 0.2 | _ | 800 | m |
| | | Using PCF (5), TORX196 | 0.2 | _ | 500 | m |
| Pulse Width Distortion (4) | Δtw | Using TORX196 Pulse width 165ns Pulse cycle 330ns, C _L =10pF | -55 | _ | 55 | ns |
| Fiber Output Power | $P_{\mathbf{f}}$ | PCF 2m, R=1.2k Ω (5) | -20 | _ | -14 | dBm |
| Peak Emission Wavelength | $\lambda_{\mathbf{p}}$ | | - | 800 | _ | nm |
| Current Consumption | ICC | $R = 1.2k\Omega$ | _ | 40 | 55 | mA |
| High Level Input Voltage | $ m v_{IH}$ | | 2.0 | _ | _ | V |
| Low Level Input Voltage | $ m V_{IL}$ | | _ | _ | 0.8 | V |
| High Level Input Current | ${ m I}_{ m IH}$ | | | _ | 20 | μ A |
| Low Level Input Current | ${ m I}_{ m IL}$ | | | _ | -0.4 | mA |

| (2) | LED is on | when input | cional ic | high | امتتما | it ic | off when | 10337 | امتتما | |
|-----|--------------|-------------|-----------|------|--------|--------|----------|-------|--------|--|
| (-) | LICILI IS ON | when inbili | SIPHALIS | nign | ievei. | 11. 18 | on when | 10 W | ievei | |


⁽³⁾ TOCP100Q- \square B, TOCP150Q- \square B, TOCP100X- \square B, TOCP150X- \square B (4) TOCP101Q- \square B, TOCP151Q- \square B, TOCP101X- \square B, TOCP151X- \square B


⁽⁵⁾ TOCP156Q- \square B, TOCP156X- \square B


⁽⁶⁾ Between input of TOTX196 and output of TORX196.

⁽⁷⁾ Measure with a standard optical fiber with fiber optic connectors. Valued by peak.


Example of Typical Characteristics (8)

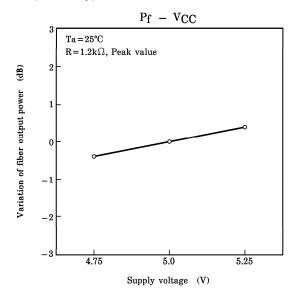

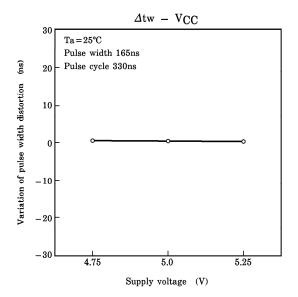

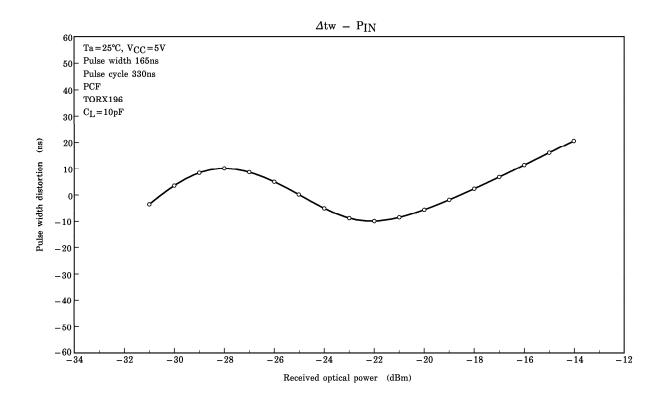


Note. (8) There give characteristic examples, and its values are not guaranteed.

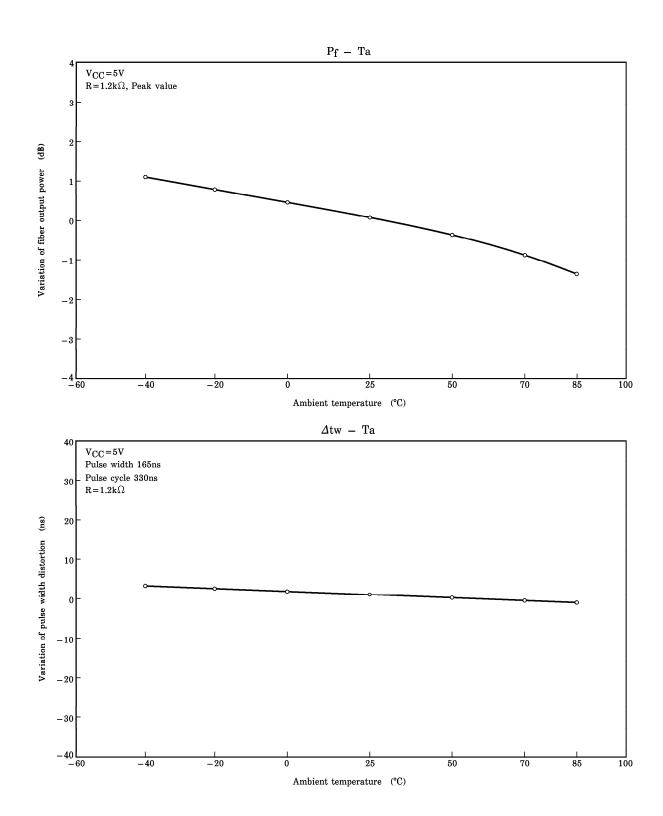

Note. (8) There give characteristic examples, and its values are not guaranteed.

5. Connection Method

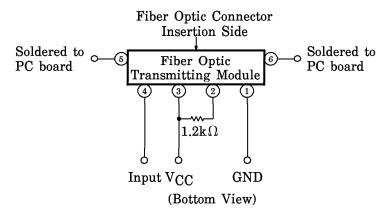

| FIBER OPTIC CONNECTOR TYPE NAME | TRANSMISSION DISTANCE (m) | $\mathop{\hbox{RESISTOR}}_{(\Omega)}$ |
|--|---------------------------|---------------------------------------|
| $TOCP100Q-\square\square B$ $TOCP100X-\square\square B$ $TOCP150Q-\square\square B$ $TOCP150X-\square\square B$ | 0.2 to 1000 | |
| $egin{array}{c} 	ext{TOCP101Q-} \square \square \ B \ 	ext{TOCP151Q-} \square \square \ B \ 	ext{TOCP151X-} \square \square \ B \end{array}$ | 0.2 to 800 | 1.2k |
| TOCP156Q- \Box B TOCP156X- \Box B | 0.2 to 500 | |

6. Applicable Optical Fiber with Fiber Optic Connectors

| TOCP100Q- $\square \square B$, | TOCP150Q- $\square \square B$, | TOCP100X- $\square\square$ B, | $TOCP150X-\square\squareB$ |
|---------------------------------|---------------------------------|---------------------------------|----------------------------|
| TOCP101Q- $\square \square B$, | TOCP151Q- $\square \square B$, | TOCP101X- $\square \square B$, | $TOCP151X-\square\squareB$ |
| TOCP156Q-□□B. | TOCP156X-□□B | | |

7. Precaution on Use

(1) Maximum Rating

The maximum ratings are the limit values which must not be exceeded when using the device. Any one of the rating must not be exceeded. If The maximum rating is exceeded, the characteristics may not be recovered. In some extreme cases, the device may be permanently damage.

(2) Life of Light Emitters

When the optical module is used for over a long period, degeneration of characteristics is mostly due to lowering of the fiber output power (Pf). This is caused by the degradation of the optical output of the LED's used as the light source. The cause of degradation of the optical output of the LED's may be defects in wafer crystallization or mold resin stress. The detailed causes are, however, not clear.

The life of light emitters is greatly influenced by operating conditions and usage environment as well as the life characteristics unique to the device. Thus, when selecting a light emitter and setting the operating conditions, Toshiba recommends that you check the life characteristics.

Depending on the environment conditions, Toshiba recommends maintenance such as regular checks on the amount of optical output.

(3) Soldering

Optical modules use semiconductor devices internally. However, in principle, optical modules are optical components. At soldering, take care that flux dose not contact the emitting surface or detecting surface. Also take care at flux removal after soldering. Some optical modules come with protective cap. The protective cap is used to avoid malfunction when the optical module is not in use. Not that it is not dust or waterproof. As mentioned before, optical modules are optical component. Thus, in principle, soldering where there may be flux residue or flux removal after soldering is not recommended. Toshiba recommends that soldering be performed without the optical module mounted on the board. Then, after the board is cleaned, solder the optical module manually. Do not perform any further cleaning.

If the optical module cannot be soldered manually, use non-halogen (chlorine-free) flux and make sure, without cleaning, there is no residue such as chlorine. This is one of the ways to eliminate the effects of flux. In such a case, check the reliability.

(4) Vibration and Shock

This module is resin-molded construction with wire fixed by resin. This structure is relatively sound against vibration or shock, In actual equipment, there are some cases where vibration, shock, and stress is applied to soldered parts or connected parts, resultingin line cut. Attention must be paid to the design of the mechanism for applications which are subject to large amounts of vibration.

(5) Fixing Fiber Optical Transmitting Module

Solder the fixed pin (pins 5 and 6) of fiber optic transmitting module TOTX196 to the printed circuit board to fix the module to the board.

(6) Solvent

When using solvent for flux removal, do not use a high acid or high alkali solvent. Be careful not to pour solvent in the optical connector ports. If solvent is inadvertently poured there, clean with cotton tips.

(7) Protective Cap

When the fiber optic transmitting module TOTX196 is not in use, use the protective cap.

(8) Supply Voltage

Use the supply voltage within the Typ. operating condition ($V_{CC} = 5 \pm 0.25V$). Make sure that supply voltage does not exceed the maximum rating value of 7V, even instantaneously.

(9) Input Voltage

If a voltage exceeding the maximum rating value ($V_{CC} + 0.5V$) is applied to the transmitter input, the internal IC may degrade causing some damage. If excessive voltage due to surges may be added to the input, insert a protective circuit.

(10) Soldering Condition

Solder at 260°C or less within three seconds.

(11) Precaution on Waste

When discarding devices and packing materials, follow procedures stipulated by local regulations in order to protect the environment against contamination. Compound semiconductors such as GaAs are used as LED materials for this module. When discarding waste or at final processing, attention must be paid to workers and the environment.

(12)Precaution on Use

Toshiba is continually working to improve the quality and the reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing Toshiba products, to observe standards of safety, and to avoid situations in which a malfunction or failure of a Toshiba product could cause loss of human life, bodily injury or damage to property.

In developing your designs, please ensure that Toshiba products are used within specified operating ranges as set forth in the most recent product specifications. Also, please keep in mind the precautions and conditions set forth in the Toshiba Semiconductor Reliability Handbook.

Copyright Each Manufacturing Company.

All Datasheets cannot be modified without permission.

This datasheet has been download from:

www.AIIDataSheet.com

100% Free DataSheet Search Site.

Free Download.

No Register.

Fast Search System.

www.AIIDataSheet.com